

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Pomo	Accessible Parking at Parking Lot #2	Parking	Signage: No "Tow Away" sign at parking lot entrance (required in CA only).	Provide "Tow Away" sign at parking lot entrance when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	P.O.T. from Accessible Parking to Pomo Complex	Sidewalk	Paved area has excessively rough, irregular surface.	Repave area to provide smooth surface for path of travel.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Ramps within Pomo Complex (Building #'s 3-7)	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	Provide new handrail for each side including extensions.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Ramps within Pomo Complex (Building #'s 3-7)	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Ramps within Pomo Complex (Building #'s 3-7)	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.	Provide ramp handrail extension (cost for each extension piece).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Ramps within Pomo Complex (Building #'s 3-7)	Handrail	Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).	Provide new guardrail, including handrail at ramp.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Ramps within Pomo Complex (Building #'s 3-7)	Ramp	Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.	Provide 2" minimum curb or wheel guide.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Ramps within Pomo Complex (Building #'s 3-7)	Ramp	Ramp: Slope greater than 1:12 (8.3%).	Demolish existing and provide new ramp with handrails.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Pomo	Ramps within Pomo Complex (Building #'s 3-7)	Ramp	Ramp: Cross slope more than 1/4":12" (2%).	Modify ramp's cross slope.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Ramps within Pomo Complex (Building #'s 3-7)	Ramp	Landing less than 60" long.	Modify ramp landing.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Ramps within Pomo Complex (Building #'s 3-7)	Ramp	Ramp: Rise more than 30" between landings.	Rebuild ramp to provide landings at 30" maximum rise.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Stairs within Pomo Complex	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	Provide new handrail for each side including extensions.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Stairs within Pomo Complex	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Stairs within Pomo Complex (Building #'s 3-7)	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	Extend stair handrail at bottom (cost for each extension piece).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Stairs within Pomo Complex (Building #'s 3-7)	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Staircase at South side of Building #3	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Pomo	Staircase at South side of Building #3	Route Sign	No sign by inaccessible route directing persons to an accessible route.	Provide directional sign.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Staircase at South side of Building #3	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Drinking Fountain at Building #5	Drinking Fountain	Fountain bubbler not easily activated by lever, push bar, or other accessible control.	Provide new, accessible fountain.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pomo	Drinking Fountain at Building #5	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide an alcove for the drinking fountain.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Accessible Parking on East side of Parking Lot #6	Parking	Accessible parking space has slope greater than 1/4":12" (2%).	Modify slope at accessible parking space.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Accessible Parking on East side of Parking Lot #6	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	Provide accessible path of travel in front of stalls.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Accessible Parking on East side of Parking Lot #6	Parking	Signage: No "Tow Away" sign at parking lot entrance (required in CA only).	Provide "Tow Away" sign at parking lot entrance when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Accessible Parking on East side of Parking Lot #6	Parking Signage	Sign for accessible parking space is missing or non-compliant.	Provide compliant parking signage.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Miwok	Accessible Parking on East side of Parking Lot #5	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	Relocate parking and provide curb ramp to accessible route.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Passenger Drop-off Zone at Main Entrance	Curb Ramp	No curb ramp provided at passenger drop-off zone.	Provide new curb ramp.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Passenger Drop-off Zone at Main Entrance	Passenger Drop-off	Aisle at passenger drop-off, adjacent to the vehicle pull-up space is not 60"x 240" and/or slopes more than 1/4":12" (2%).	Modify passenger drop-off and provide "Loading Zone" sign.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Van Accessible Parking Stall in Drop-off Zone	Parking	Accessible parking space does not have 5' x 18' access aisle (van accessible aisle 8' x 18' to the right of the parking stall).	Modify parking space(s) or aisle(s) to create accessible space by restriping.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Van Accessible Parking Stall in Drop-off Zone	Parking	Location of parking requires wheelchair users to wheel themselves parallel to vehicular traffic lane.	Provide curb ramp at shortest possible distance.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Accessible Parking at North side of Building #11	Parking	Signage: International Symbol of Accessibility (36" square, in white on blue) is not painted on the pavement near the rear end of the parking space (required in CA only).	Apply symbol on parking space pavement when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Accessible Parking at North side of Building #11	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	Provide wheel-stop at accessible parking space to allow for passing space in front of parked vehicles.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Accessible Parking at North side of Building #11	Parking	Accessible parking space does not have 5' x 18' access aisle (van accessible aisle 8' x 18' to the right of the parking stall).	Modify parking space(s) or aisle(s) to create accessible space by restriping.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	Status	
							RESOLVED	PENDING
Indian Va	Exterior Site	Miwok	Accessible Parking at North side of Building #11	Parking	Signage: International Symbol of Accessibility (36" square, in white on blue) painted on the pavement near the rear end of the parking space has faded.	Apply symbol on parking space pavement when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Staircase at North side of Building #11	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Staircase at North side of Building #11	Handrail	Bottom extension of handrail does not return creating a hazard for blind individuals.	Remodel handrail return.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Staircase at North side of Building #11	Route Sign	No sign by inaccessible route directing persons to an accessible route.	Provide directional sign.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Staircase at North side of Building #11	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramp at East side of Building #12	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramp at East side of Building #12	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.	Provide ramp handrail extension (cost for each extension piece).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramp at East side of Building #12	Ramp	Ramp: Slope greater than 1:12 (8.3%).	Demolish existing and provide new ramp.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	Status	
							RESOLVED	PENDING
Indian Va	Exterior Site	Miwok	Ramp at East side of Building #12	Ramp	Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.	Provide 2" minimum curb or wheel guide.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Public Telephone at Administration Office Entrance	Sign	Public text telephone not identified with a sign that includes the international T.D.D. symbol.	Provide compliant text phone sign.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Public Telephone at Administration Office Entrance	T.D.D.	T.D.D. service not provided in administration, constituent or student service area that communicates by telephone.	Provide T.D.D. service.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Public Telephone at Administration Office Entrance	Telephone	Telephone: Clear floor space, 30" wide x 48" out from wall, not provided.	Provide clear space in front of telephone, 30" wide x 48" out from wall.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Drinking Fountain at Administration Office Entrance	Drinking Fountain	Fountain bubbler not easily activated by lever, push bar, or other accessible control.	Provide new, accessible fountain.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Drinking Fountain at Administration Office Entrance	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide an alcove for drinking fountain.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramp at East end of Building #8	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramp at East end of Building #8	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.	Provide ramp handrail extension (cost for each extension piece).		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Miwok	Ramp at East end of Building #8	Ramp	Ramp: Slope greater than 1:12 (8.3%).	Demolish existing and provide new ramp with handrails.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Stairs at East end of Building #8	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Stairs at East end of Building #8	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	Extend stair handrail at bottom (cost for each extension piece).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Stairs at East end of Building #8	Handrail	Bottom extension of handrail does not return creating a hazard for blind individuals.	Remodel handrail return.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Stairs at East end of Building #8	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	South Entrance to Student Services Office in Building #8	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	South Entrance to Student Services Office in Building #8	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	Extend stair handrail at bottom (cost for each extension piece).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	South Entrance to Student Services Office in Building #8	Signage	No signs at non-accessible entrances directing persons to an accessible entrance of the building.	Provide directional signage to indicate route to the nearest accessible entrance.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Miwok	South Entrance to Student Services Office in Building #8	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Entrance to Campus Store in Building #12	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	Provide new handrail for each side including extensions.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Entrance to Campus Store in Building #12	Signage	No signs at non-accessible entrances directing persons to an accessible entrance of the building.	Provide directional signage to indicate route to the nearest accessible entrance.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Entrance to Campus Store in Building #12	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramps within Miwok Complex (Buildings #'s 13-16)	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	Provide new handrail for each side including extensions.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramps within Miwok Complex (Buildings #'s 13-16)	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramps within Miwok Complex (Buildings #'s 13-16)	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.	Provide ramp handrail extension (cost for each extension piece).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramps within Miwok Complex (Buildings #'s 13-16)	Handrail	Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).	Provide new guardrail, including handrail at ramp.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	Status	
							RESOLVED	PENDING
Indian Va	Exterior Site	Miwok	Ramps within Miwok Complex (Buildings #'s 13-16)	Ramp	Ramp: Rise more than 30" between landings.	Rebuild ramp to provide landings at 30" maximum rise.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramps within Miwok Complex (Buildings #'s 13-16)	Ramp	Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.	Provide 2" minimum curb or wheel guide.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramps within Miwok Complex (Buildings #'s 13-16)	Ramp	Concrete ramp with slope greater than 1:12 (8.3%).	Demolish existing and provide new ramp with handrails.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Ramps within Miwok Complex (Buildings #'s 13-16)	Ramp	Bottom landing is less than 72" in length.	Modify ramp bottom landing to 72" length.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Stairs within Miwok Complex (Buildings #'s 13-16)	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	Provide new handrail for each side including extensions.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Stairs within Miwok Complex (Buildings #'s 13-16)	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Stairs within Miwok Complex (Buildings #'s 13-16)	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	Extend stair handrail at bottom (cost for each extension piece).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Stairs within Miwok Complex (Buildings #'s 13-16)	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Miwok	Staircase at South side of Building #13	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Staircase at South side of Building #13	Route Sign	No sign by inaccessible route directing persons to an accessible route.	Provide directional sign.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Staircase at South side of Building #13	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Drinking Fountain at Building #15	Drinking Fountain	Fountain bubbler not easily activated by lever, push bar, or other accessible control.	Provide new, accessible fountain.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Miwok	Drinking Fountain at Building #15	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alcove for the drinking fountain.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Accessible Parking at Lot #7	Parking	Accessible parking space has slope greater than 1/4":12" (2%).	Modify slope at accessible parking space.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Accessible Parking at Lot #7	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	Relocate parking and provide curb ramp to accessible route.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Accessible Parking at Lot #7	Parking	Signage: No "Tow Away" sign at parking lot entrance (required in CA only).	Provide "Tow Away" sign at parking lot entrance when altering area.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Ohlone	Accessible Parking at Lot #7	Parking	Parking-Ticket vending machine is not accessible.	Modify access to Parking-Ticket vending machine.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Accessible Parking at West side of Parking Lot #6	Parking	Accessible parking space has slope greater than 1/4":12" (2%).	Modify slope at accessible parking space.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Accessible Parking at West side of Parking Lot #6	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	Provide accessible path of travel in front of accessible parking stalls.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Accessible Parking on West side of the Ohlone Complex	Parking	Accessible parking space has slope greater than 1/4":12" (2%).	Modify slope at accessible parking space.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Accessible Parking on West side of the Ohlone Complex	Parking	Signage: International Symbol of Accessibility (36" square, in white on blue) painted on the pavement near the rear end of the parking space has faded.	Reapply symbol on parking space pavement when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Accessible Parking on West side of the Ohlone Complex	Parking Signage	Sign for accessible parking space is missing or non-compliant.	Relocate existing sign to a more visible location.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	P.O.T. from Accessible Parking to Ohlone Complex	Ramp	Ramp: Rise more than 30" between landings.	Rebuild ramp to provide landings at 30" maximum rise.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	P.O.T. from Accessible Parking to Ohlone Complex	Sidewalk	Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.	Provide ramp with handrails on both (2) sides.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Ohlone	Ramps within Ohlone Complex (Building #'s 18-20)	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	Provide new handrail for each side including extensions.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Ramps within Ohlone Complex (Building #'s 18-20)	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Ramps within Ohlone Complex (Building #'s 18-20)	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.	Provide ramp handrail extension (cost for each extension piece).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Ramps within Ohlone Complex (Building #'s 18-20)	Handrail	Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).	Provide new guardrail, including handrail at ramp.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Ramps within Ohlone Complex (Building #'s 18-20)	Ramp	Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.	Provide 2" minimum curb or wheel guide.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Ramps within Ohlone Complex (Building #'s 18-20)	Ramp	Concrete Ramp: Slope greater than 1:12 (8.3%).	Demolish existing and provide new ramp with handrails.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Ramps within Ohlone Complex (Building #'s 18-20)	Ramp	Ramp: Cross slope more than 1/4":12" (2%).	Modify ramp's cross slope.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Ramps within Ohlone Complex (Building #'s 18-20)	Ramp	Wood Ramp: Slope greater than 1:12 (8.3%).	Demolish existing and provide new ramp with handrails.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Ohlone	Ramps within Ohlone Complex (Building #'s 18-20)	Ramp	Ramp: Rise more than 30" between landings.	Rebuild ramp to provide landings at 30" maximum rise.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Stairs within Ohlone Complex (Building #'s 18-20)	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	Provide new handrail for each side including extensions.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Stairs within Ohlone Complex (Building #'s 18-20)	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Stairs within Ohlone Complex (Building #'s 18-20)	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	Extend stair handrail at bottom (cost for each extension piece).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Stairs within Ohlone Complex (Building #'s 18-20)	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Entrance to Computer Room in Building #20	Entrance Door	Public entrance not accessible to disabled persons.	Modify entrance to be accessible. Requires automatic door opener, ramp, or wheelchair lift, as itemized in entries below.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Entrance to Computer Room in Building #20	Ramp	Ramp needed to provide disabled access at steps or change of level along path of travel.	Provide new concrete ramp with handrails [slope more than 1:20 (5.0%) needed].		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Entrance to Computer Room in Building #20	Signage	No signs at non-accessible entrances directing persons to an accessible entrance of the building.	Provide directional signage to indicate route to the nearest accessible entrance.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Ohlone	Accessible Parking at South side of Library Building	Parking	Signage: International Symbol of Accessibility (36" square, in white on blue) is not painted on the pavement near the rear end of the parking space (required in CA only).	Apply symbol on parking space pavement when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Accessible Parking at South side of Library Building	Parking Signage	Sign for accessible parking space is missing or non-compliant.	Provide compliant parking signage.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Drinking Fountain at Building #20	Drinking Fountain	Fountain bubbler not easily activated by lever, push bar, or other accessible control.	Provide new, accessible fountain.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Ohlone	Drinking Fountain at Building #20	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alcove for drinking fountain.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Accessible Parking at Parking Lot #8	Parking	Accessible parking space has slope greater than 1/4":12" (2%).	Modify slope at accessible parking space.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Accessible Parking at Parking Lot #8	Parking	Signage: No "Tow Away" sign at parking lot entrance (required in CA only).	Provide "Tow Away" sign at parking lot entrance when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Accessible Parking at Parking Lot #8	Parking Signage	Parking stall incorrectly identified as being "Van Accessible".	Provide compliant parking signage.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Path leading to Baseball & Soccer Fields	Sidewalk	Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.	Modify walk/sidewalk slope to 1:20 or less.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	Status	
							RESOLVED	PENDING
Indian Va	Exterior Site	Pool Complex	Accessible Parking on West side of Locker Rooms	Parking	Accessible parking space has slope greater than 1/4":12" (2%).	Modify slope at accessible parking space.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Accessible Parking on West side of Locker Rooms	Parking	Signage: International Symbol of Accessibility (36" square, in white on blue) painted on the pavement near the rear end of the parking space has faded.	Reapply symbol on parking space pavement when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Accessible Parking on West side of Locker Rooms	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	Provide wheel-stop at accessible spaces to allow for passing space in front of parked vehicles.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Path leading to Tennis Courts	Curb Ramp	Curb ramp: Slope greater than 1:12 (8.3%).	Demolish existing and provide new curb ramp.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Path leading to Tennis Courts	Curb Ramp	Curb ramp: 12" wide grooved border not provided (CA requirement only).	Not an ADAAG requirement (Provide 12" wide grooved border per CBC when remodeling).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Path leading to Tennis Courts	Curb Ramp	Transition from ramp to gutter does not have a way-finding 1/2" lip at 45°.	Provide 1/2" beveled lip at 45°.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Path leading to Tennis Courts	Sidewalk	Paved area has excessively rough, irregular surface.	Repave area to provide smooth surface for path of travel.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Path leading to Tennis Courts	Sidewalk	Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.	Modify walk/sidewalk slope to 1:20 or less.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Pool Complex	Entrance to Tennis Courts	Curb Ramp	No curb ramp available where an accessible route crosses a curb.	Provide new curb ramp.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Entrance to Tennis Courts	Drinking Fountain	Fountain bubbler not easily activated by lever, push bar, or other accessible control.	Provide new, accessible fountain.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Entrance to Tennis Courts	Drinking Fountain	CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.	Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Entrance to Tennis Courts	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate textured floor 12" from front & sides of drinking fountain. (Interim solution only. Not an ADAAG compliant permanent solution).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Entrance to Tennis Courts	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Entrance to Tennis Courts	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	Extend stair handrail at top and bottom (cost for both extensions).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Entrance to Tennis Courts	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Porch at Locker Room Entrance	Drinking Fountain	Fountain bubbler not easily activated by lever, push bar, or other accessible control.	Provide new, accessible fountain.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Exterior Site	Pool Complex	Porch at Locker Room Entrance	Drinking Fountain	CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.	Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Porch at Locker Room Entrance	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate textured floor 12" from front & sides of drinking fountain. (Interim solution only. Not an ADAAG compliant permanent solution).		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Porch at Locker Room Entrance	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.	COMPLETED 2016 Measure C project 411A	
Indian Va	Exterior Site	Pool Complex	Porch at Locker Room Entrance	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	Extend stair handrail at top and bottom (cost for both extensions).	COMPLETED 2016 Measure C project 411A	
Indian Va	Exterior Site	Pool Complex	Porch at Locker Room Entrance	Sidewalk	Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.	Modify walk/sidewalk slope to 1:20 or less.	COMPLETED 2016 Measure C project 411A	
Indian Va	Exterior Site	Pool Complex	Porch at Locker Room Entrance	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Va	Exterior Site	Pool Complex	Porch at Locker Room Entrance	Telephone	Telephone enclosure: Protrudes more than 4" and has more than 27" height from floor to lowest edge.	Lower telephone enclosure.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Porch at Locker Room Entrance	Telephone	Telephone amplification for hearing impaired persons not provided (push button volume control).	Provide telephone amplification for hearing impaired persons. To be provided by utility company.		Full modernization planned in next Bond 2017
Indian Va	Exterior Site	Pool Complex	Stairs leading to Green in front of Pool Complex	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	Remove existing and provide new handrail.	COMPLETED 2016 Measure C project 411A	
Indian Va	Exterior Site	Pool Complex	Stairs leading to Green in front of Pool Complex	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	Extend stair handrail at top and bottom (cost for both extensions).	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
							COMPLETED	
Indian Va	Exterior Site	Pool Complex	Stairs leading to Green in front of Pool Complex	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	Provide contrasting color strips at all exterior stair treads when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Va	Exterior Site	Pool Complex	Ramped portion of Walkway	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	Provide new handrail for each side including extensions.	COMPLETED 2016 Measure C project 411A	
Indian Va	Exterior Site	Pool Complex	Ramped portion of Walkway	Ramp	Ramp: Slope greater than 1:12 (8.3%).	Demolish existing and provide new ramp with handrails.	COMPLETED 2016 Measure C project 411A	
Indian Va	Exterior Site	Pool Complex	Ramped portion of Walkway	Ramp	Landing less than 60" long.	Modify ramp landing.	COMPLETED 2016 Measure C project 411A	
Indian Va	Auto Workshop - Building 1	Level 1	Entrance/exit door at east end	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Entrance/exit door at east end	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Entrance/exit door at east end	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Entrance/exit door at east end	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Entrance/exit door at east end	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	Provide relocated new door and frame; remodel walls as needed.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Spray booth unit (#148)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).	Provide new, larger door and frame with new accessible hardware.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Spray booth unit room #148	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 1	Level 1	Spray booth unit room #148	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Rooms #146, 147, 149	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Rooms #146, 147, 149	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Rooms #146, 147, 149	Door Threshold	Door inaccessible due to threshold or step at door more than 6" high.	Provide ramp including handrails and compliant landings, matching floor level inside door (+/-1/4").	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Parts and issue (#145)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Parts xxxxxxxx (#145)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Parts xxxxxxxx (#145)	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	Provide auxiliary shelf, clipboard, or table as equivalent facilitation.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Parts xxxxxxxx (#145)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Parts xxxxxxxx (#145)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	Remove or relocate furniture or storage items.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	O.S & Y. Valve (#144)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	O.S & Y. Valve (#144)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	Remove/relocate protruding object. Patch existing surface.	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Grab Bars	Grab bars not provided or are not code compliant.	Provide accessible grab bars.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Locker Facilities	No accessible bench provided at accessible lockers.	Provide accessible bench with adequate wheelchair space between locker and bench.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Shower	Curb or threshold at 30" x 60" shower or more than 1/2" at 36" square shower (CA only: Lip not beveled [45°] or more than 1/2" high).	Provide new or modify present shower threshold.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Shower	Shower spray unit with hose at least 60" long that can be used fixed and hand-held is not provided (Exception: Where vandalism is a consideration, a fixed shower head mounted at 48" height is allowed).	Provide new shower spray unit with hose.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Shower	In 36" x 36" shower stall, L-shaped grab bar that is located along the full depth of the control wall (opposite the seat) and halfway along the back wall (18") is not provided.	Provide new grab bar in shower.	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Shower	In 36" x 36" stall no seat at 17" to 19" height above floor opposite controls provided (CA only: folding seat at 18").	Provide new, or relocate, folding wall-mounted shower seat.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	Provide new partition and stall door with compliant width.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	Remove adjacent fixture and provide new enclosure at accessible water closet.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	Provide new enclosure at existing water closet fixture.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Toilet Stall	Toilet stall less than 60" wide.	Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Urinal	CA only: Front of rim projects less than 14" from wall.	Provide accessible urinal. Remodel restroom as needed.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	Provide accessible urinal flush control.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	Replace flush control with properly mounted accessible type.	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 1	Level 1	Men's lockers (#143)	Water Closet	Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").	Provide new accessible water closet and relocate plumbing.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Room (#142)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Room (#142)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	Provide new, accessible fountain.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.	Provide new, accessible fountain.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	Remove/relocate protruding object. Patch existing surface.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.	Provide relocated new door and frame. Remodel walls as needed.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Locker Facilities	No accessible bench section provided at lockers	Provide accessible bench with adequate wheelchair space between locker and bench.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Shower	Curb or threshold at 30" x 60" shower or more than 1/2" at 36" square shower (CA only: Lip not beveled [45°] or more than 1/2" high).	Provide new or modify present shower threshold.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Shower	In 36" x 36" shower stall, L-shaped grab bar that is located along the full depth of the control wall (opposite the seat) and halfway along the back wall (18") is not provided.	Provide new grab bar in shower.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Shower	In 36" x 36" stall no seat at 17" to 19" height above floor opposite controls provided (CA only: folding seat at 18").	Provide new, or relocate, folding wall-mounted shower seat.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	Provide new partition and stall door with compliant width.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").	Provide relocated new door and frame; remodel walls as needed.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	Remove adjacent fixture and provide new enclosure at accessible water closet.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	Provide new enclosure at existing water closet fixture.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Toilet Stall	Toilet stall less than 60" wide.	Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Women's lockers	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	Replace flush control with properly mounted accessible type.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Entry/exit door at west side	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Entry/exit door at west side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Entry/exit door at west side	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 1	Level 1	Entry/exit door at west side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Entry/exit door at east side	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 2	Level 1	Entry/exit door at east side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Entry/exit door at east side	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Entry/exit door at east side	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Entry/exit door at east side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Room #126	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Room #126	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Auto Lab Shop	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	Provide new, accessible fountain.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Auto Lab Shop	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.	Provide new, accessible fountain.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Auto Lab Shop	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Auto Lab Shop	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Auto Lab Shop	Reach Range	At medical cabinet, reach height to opening latch, where side approach is available, exceeds 54".	Modify emergency shower handle to be within 48" A.F.F.	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 2	Level 1	Auto Lab Shop	Studio/Shop	Eye wash spout more than 36" above floor.	Remount eye-wash at accessible height.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Tool room (#124)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Tool room (#124)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Tool room (#124)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Tool room (#124)	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	Provide auxiliary shelf, clipboard, or table as equivalent facilitation.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Tool room (#124)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Grab Bars	Grab bars not provided or are not code compliant.	Provide accessible grab bars.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Locker Facilities	"Adequate wheelchair space between lockers and benches not provided (44" width needed)."	Remove and relocate bench and patch floor to provide adequate wheelchair space between locker and bench.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	Provide new partition and stall door with compliant width.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	Provide relocated new door and frame; remodel walls as needed.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	Remove adjacent fixture and provide new enclosure at accessible water closet.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Toilet Stall	Toilet stall less than 60" wide.	Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	Provide new enclosure at existing water closet fixture.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Urinal	CA only: Front of rim projects less than 14" from wall.	Provide accessible urinal. Remodel restroom as needed.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	Provide accessible urinal flush control.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Urinal	30" x 48" clear floor space in front of accessible urinal not provided.	Provide clear floor space in front of accessible urinal. Remodel restroom as needed.	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	Replace flush control with properly mounted accessible type.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Men's lockers	Water Closet	Height of water closet seat less than 17" or more than 19" from floor.	Provide new accessible water closet.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.	Provide new, accessible fountain.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	Provide new, accessible fountain.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Room #133	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed feminine napkin disposal container.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.	Provide relocated new door and frame. Remodel walls as needed.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Grab Bars	Grab bars not provided or are not code compliant.	Provide accessible grab bars.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Locker Facilities	"Adequate wheelchair space between lockers and benches not provided (44" width needed)."	Remove and relocate bench and patch floor to provide adequate wheelchair space between locker and bench.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	Provide new partition and stall door with compliant width.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").	Provide relocated new door and frame; remodel walls as needed.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	Remove adjacent fixture and provide new enclosure at accessible water closet.	COMPLETED 2010 Measure C project 402A	
Indian Va	Auto Workshop - Building 2	Level 1	Women's lockers	Toilet Stall	Toilet stall less than 60" wide.	Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).	COMPLETED 2010 Measure C project 402A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Valley	Auto Workshop - Building 2	Level 1	Women's lockers	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	Provide new enclosure at existing water closet fixture.	COMPLETED 2010 Measure C project 402A	
Indian Valley	Auto Workshop - Building 2	Level 1	Women's lockers	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	Replace flush control with properly mounted accessible type.	COMPLETED 2010 Measure C project 402A	
Indian Valley	Auto Workshop - Building 2	Level 1	Women's lockers	Water Closet	Height of water closet seat less than 17" or more than 19" from floor.	Provide new accessible water closet.	COMPLETED 2010 Measure C project 402A	
Indian Valley	Auto Workshop - Building 2	Level 1	Entry/exit door adjacent to women's locker room	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2010 Measure C project 402A	
Indian Valley	Auto Workshop - Building 2	Level 1	Entry/exit door adjacent to women's locker room	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2010 Measure C project 402A	
Indian Valley	Auto Workshop - Building 2	Level 1	Entry/exit door adjacent to women's locker room	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2010 Measure C project 402A	
Indian Valley	Auto Workshop - Building 2	Level 1	Entry/exit door adjacent to women's locker room	Door Threshold	Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.	Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.	COMPLETED 2010 Measure C project 402A	
Indian Valley	Auto Workshop - Building 2	Level 1	Entry/exit door adjacent to women's locker room	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2010 Measure C project 402A	
Indian Valley	Auto Workshop - Building 2	Level 1	Entry/exit door adjacent to women's locker room	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2010 Measure C project 402A	
Indian Valley	Pomo Cluster - Building 3	Level 1	Lobby	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 3	Level 1	Lobby	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Lobby	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Lobby	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Lobby	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Lobby	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Lobby	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Lobby	Signage	Accessible building entrance when not all are accessible not identified with a sign showing the International Symbol of Accessibility.	Provide building entrance sign that shows international symbol at accessible entrance.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Laboratory w/ prep. room (#151-152)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Laboratory w/ prep. room (#151-152)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Laboratory w/ prep. room (#151-152)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 3	Level 1	Laboratory w/ prep. room (#151-152)	Lab	Recommended only: Minimum of one non-fixed station per lab not provided at specialized laboratory equipment (height between 28" and 34", with leg room 27" high x 30" wide x 19" deep).	Remodel existing cabinet/counter to provide lab/studio equipment for disabled person.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Laboratory w/ prep. room (#151-152)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Laboratory w/ prep. room (#151-152)	Sink	Sink in workstation not accessible.	Modify existing sink and casework.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Laboratory w/ prep. room (#151-152)	Studio/Shop	Minimum of one accessible fume hood station with specialized laboratory equipment not provided. (height between 28"-34" with knee space 27" high x 30" wide x 19" deep)	Provide worktop at accessible height.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Biology Preparation (#153)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Biology Preparation (#153)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Biology Preparation (#153)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	Remodel sink cabinet.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Sink	Kitchenette sink rim higher than 34" above floor.	Remodel sink cabinet to lower sink.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Sink	Kitchenette sink is more than 6 1/2" deep.	Provide new sink remodel and cabinet as needed.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Sink	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Studio/Shop	Minimum of one accessible fume hood station with specialized laboratory equipment not provided. (height between 28"-34"; with knee space 27" high x 30" wide x 19" deep).	Provide worktop at accessible height.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 1	Classroom #154	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	Remove or relocate furniture or storage items.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lobby	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lobby	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lobby	Door Threshold	Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.	Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lobby	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lobby	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT ROUTE" sign at door.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#251)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#251)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#251)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#251)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	Change hinge/latch side.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#252)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#252)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#252)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#252)	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	Remodel sink cabinet.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#252)	Sink	Kitchenette sink rim higher than 34" above floor.	Remodel sink cabinet to lower sink.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#252)	Sink	Kitchenette sink is more than 6 1/2" deep.	Provide new sink remodel and cabinet as needed.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#252)	Sink	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Medical Assisting (#252)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	Change hinge/latch side	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 3	Level 2	Lecture room (#254)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lecture room (#254)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lecture room (#254)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lecture room (#255)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lecture room (#255)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Lecture room (#255)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Faculty offices (#258-259, #261-262)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Faculty offices (#258-259, #261-262)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 3	Level 2	Faculty offices (#258-259, #261-262)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Custodian (#260)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Exit door at west side	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Exit door at west side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Exit door at west side	Door Threshold	Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.	Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Exit door at west side	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT ROUTE" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 3	Level 2	Exit door at west side	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	Change hinge/latch side.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Machine Technology (#160)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Machine Technology (#160)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Tool room (#162)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Store room (#165)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
							COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Private offices (#163-164)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Locker room (#166)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Locker room (#166)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Locker room (#166)	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in good condition.	Remount fountain at accessible height.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Locker room (#166)	Locker Facilities	No accessible bench section provided at locker facilities.	Provide accessible bench with adequate wheelchair space between locker and bench.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Locker room (#166)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Unisex restrooms (#170)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Unisex restrooms (#170)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Unisex restrooms (#170)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Unisex restrooms (#170)	Grab Bars	Grab bars not at 33" to 36" from floor (CA only: 33" from floor if no tank toilet).	Relocate accessible grab bars.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Unisex restrooms (#170)	Grab Bars	Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).	Provide or relocate accessible side grab bar.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 4	Level 1	Unisex restrooms (#170)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Unisex restrooms (#170)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Unisex restrooms (#170)	Water Closet	CA only: In single-accommodation restroom less than 48" in front of water closet provided.	Remove storage cabinet to provide at least 48" in front of water closet (install overhead shelving for storage).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Welding room (#167)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Welding room (#167)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Welding room (#167)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Store room (#169)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 4	Level 1	Private office (#168)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Testing room (#180)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Testing room (#180)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Testing room (#180)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Valley	Pomo Cluster - Building 5	Level 1	Testing room (#180)	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Testing room (#180)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Testing room (#180)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Men's restroom	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Men's restroom	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	Relocate or provide new accessible mirror.	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Men's restroom	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Men's restroom	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Provide 10" min. "kick plate" covering width of door when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Men's restroom	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Men's restroom	Grab Bars	Grab bars not provided or are not code compliant.	Provide accessible grab bars.	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Men's restroom	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2016 Measure C project 411A	
Indian Valley	Pomo Cluster - Building 5	Level 1	Men's restroom	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	Provide accessible faucet at accessible lavatory.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 5	Level 1	Men's restroom	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Men's restroom	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Men's restroom	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	Provide new partition and stall door with compliant width.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Men's restroom	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Men's restroom	Urinal	CA only: Front of rim projects less than 14" from wall.	Provide accessible urinal. Remodel restroom as needed.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Men's restroom	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	Provide accessible urinal flush control.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Men's restroom	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	Replace flush control with properly mounted accessible type.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Men's restroom	Water Closet	Height of water closet seat less than 17" or more than 19" from floor.	Provide new accessible water closet.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	Relocate or provide new accessible mirror.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Accessories	Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed feminine napkin disposal container.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Provide 10" min. "kick plate" covering width of door when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Grab Bars	Grab bars not provided or are not code compliant.	Provide accessible grab bars.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	Provide accessible faucet at accessible lavatory.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	Provide new partition and stall door with compliant width.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	Replace flush control with properly mounted accessible type.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Women's restroom	Wheelchair Clearance	Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide).	Modify facility passage to be min. 44" wide. Demolish existing partition and replace.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Lounge room (#189)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Lounge room (#189)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Provide 10" min. "kick plate" covering width of door when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Lounge room (#189)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Lounge room (#189)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Com. Medical Center	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Com. Medical Center	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Com. Medical Center	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 5	Level 1	Com. Medical Center	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
							COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Rooms (#s 185-186)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Classroom (#188)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Classroom (#188)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Classroom (#188)	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	Provide new, accessible fountain.	COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Classroom (#188)	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.	COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Classroom (#188)	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."	COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Classroom (#188)	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Classroom (#188)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Classroom (#188)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED	
Indian Va	Pomo Cluster -Building 5	Level 1	Classroom (#188)	Signage	At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "TO EXIT" sign at door.	COMPLETED	
Indian Va	Pomo Cluster -Building 6	Level 1	Entrance/exit door at west side	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 6	Level 1	Entrance/exit door at west side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Entrance/exit door at west side	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Entrance/exit door at west side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Faculty offices #101-104	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Faculty offices #101-104	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Faculty offices #101-104	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Faculty offices #101-104	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Custodian room	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Faculty offices (#105-106)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Faculty offices (#105-106)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Room (#107)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 6	Level 1	Room (#107)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Room (#107)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Room (#107)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Room (#107)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Environmental Science Lab (#108)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Environmental Science Lab (#108)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Environmental Science Lab (#108)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Environmental Science Lab (#108)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Environmental Science Lab (#108)	Studio/Shop	Minimum of one accessible fume hood station with specialized laboratory equipment not provided. (height between 28" -34", with knee space 27" high X 30" wide X 19" deep)	Provide worktop at accessible height.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Preparatory room	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Provide 10" min. "kick plate" covering width of door when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Prep. room	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 6	Level 1	Prep. room	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Prep. room	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Prep. room	Sink	Kitchenette sink rim higher than 34" above floor.	Remodel sink cabinet to lower sink.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Prep. room	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	Remodel sink cabinet.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Prep. room	Sink	Kitchenette sink is more than 6 1/2" deep.	Provide new sink remodel and cabinet as needed.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Prep. room	Sink	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Room #111	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Room #111	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.	Change door swing.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	Provide accessible grab bars.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Lavatory	Stall door swings into required clear space in front of lavatory.	Relocate existing lavatory.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").	Change door swing.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	Remove adjacent fixture and provide new enclosure at accessible water closet.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Toilet Stall	Toilet stall less than 60" wide.	Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Urinal	CA only: Front of rim projects less than 14" from wall.	Provide accessible urinal. Remodel restroom as needed.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	Provide accessible urinal flush control.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	Replace flush control with properly mounted accessible type.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Water Closet	Height of water closet seat less than 17" or more than 19" from floor.	Provide new accessible water closet.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Men's restrooms	Water Closet	Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").	Provide new accessible water closet and relocate plumbing.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Accessories	Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed feminine napkin disposal container.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.	Change door swing.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	Provide accessible grab bars.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").	Change door swing.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	Remove adjacent fixture and provide new enclosure at accessible water closet.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Toilet Stall	Toilet stall less than 60" wide.	Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	Replace flush control with properly mounted accessible type.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 1	Women's restrooms	Water Closet	Height of water closet seat less than 17" or more than 19" from floor.	Provide new accessible water closet.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster - Building 6	Level 1	Entrance/exit door	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 1	Entrance/exit door	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 1	Entrance/exit door	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 1	Entrance/exit door	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 1	Custodian room	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Entrance doors at east side	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Entrance doors at east side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Entrance doors at east side	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Entrance doors at east side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 6	Level 2	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Faculty offices #201-202, #204-205	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Faculty offices #201-202, #204-205	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Faculty offices #201-202, #204-205	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Custodian room #203	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Faculty offices #207-208, #210-211	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Faculty offices #207-208, #210-211	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Faculty offices #207-208, #210-211	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Custodian room (#209)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Lab (#214)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Lab (#214)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Lab (#214)	Lab	Accessible science lab fixed work station(s) not provided (5% of stations; not less than one).	Provide accessible science lab fixed work station(s).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Lab (#214)	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	Provide auxiliary shelf, clipboard, or table as equivalent facilitation.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Lab (#214)	Reach Range	At reach height where front approach is available, exceeds 48".	Modify emergency shower handle to be within 48" A.F.F.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Lab (#214)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Lab (#214)	Sink	Sink in workstation not accessible.	Provide new accessible sink.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Lab (#214)	Studio/Shop	Minimum of one accessible fume hood station with specialized laboratory equipment not provided. (height between 28"-34", with knee space 27" high X 30" wide X 19" deep).	Provide worktop at accessible height.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Preparatory Area	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Preparatory Area	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster -Building 6	Level 2	Chemestry Preparatory Area	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster - Building 6	Level 2	Chemestry Preparatory Area	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	Change door swing.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Chemestry Preparatory Area	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	Remove closer, if latch is to remain on door leading to hallway.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Instrumentation room (#215)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Instrumentation room (#215)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Private office (#212)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Private office (#212)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Exit door at west side	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Exit door at west side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Exit door at west side	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 6	Level 2	Exit door at west side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Entrance/exit at east side	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster - Building 7	Level 1	Entrance/exit at east side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Entrance/exit at east side	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Entrance/exit at east side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#190)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#190)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#190)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#191-192)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#191-192)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#191-192)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#191-192)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#191-192)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#191-192)	Sink	Kitchenette sink rim higher than 34" above floor.	Remodel sink cabinet to lower sink.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#191-192)	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	Remodel sink cabinet.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#191-192)	Sink	Kitchenette sink is more than 6 1/2" deep.	Provide new sink remodel and cabinet as needed.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#191-192)	Sink	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Pantry (#193)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Pantry (#193)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Pantry (#193)	Sink	Kitchenette sink rim higher than 34" above floor.	Remodel sink cabinet to lower sink.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Pantry (#193)	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	Remodel sink cabinet.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Pantry (#193)	Sink	Kitchenette sink is more than 6 1/2" deep.	Provide new sink remodel and cabinet as needed.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Pantry (#193)	Sink	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Faculty offices	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Faculty offices	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Custodian	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.	COMPLETED 2016 Measure C project 411A	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Pomo Cluster - Building 7	Level 1	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.	Provide new, accessible fountain.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Exit door at south side	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Exit door at south side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Exit door at south side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#199)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#199)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.	COMPLETED 2016 Measure C project 411A	
Indian Va	Pomo Cluster - Building 7	Level 1	Lecture room (#199)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.	COMPLETED 2016 Measure C project 411A	
Indian Va	Administrative Services	Level 1	Main entrance doors	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Administrative Services	Level 1	Main entrance doors	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Main entrance doors	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT ROUTE" sign at door.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Reception area	Brochure Bins	Information brochure bins mounted above accessible height (see IE* codes for dims).	Relocate/remount bins at accessible height.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Reception area	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Reception area	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.	Provide new, accessible fountain.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Reception area	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Reception area	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Reception area	Public Counter	Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide).	Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Administrative Services	Level 1	Reception area	Reach Range	Reach height to control or access point, where side approach is available, exceeds 54" or is less than 9".	Modify equipment or mounting.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Exit door at south end of reception area	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Exit door at south end of reception area	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Exit door at south end of reception area	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Private office	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Private office	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Mail room	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Mail room	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	Provide auxiliary shelf, clipboard, or table as equivalent facilitation.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Administrative Services	Level 1	Mail room	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Back office	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Back office	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Entrance door to financial aid office	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Entrance door to financial aid office	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Entrance door to financial aid office	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Entrance door to financial aid office	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Financial aid counter	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Administrative Services	Level 1	Financial aid counter	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	Provide auxiliary shelf, clipboard, or table as equivalent facilitation.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Financial aid counter	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Private office	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Private office	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Entrance door to suite 100	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Entrance door to suite 100	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Entrance door to suite 100	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT ROUTE" sign at door.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Suite 100	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Valley	Administrative Services	Level 1	Suite 100	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	Provide new, accessible fountain.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Suite 100	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Suite 100	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	Provide auxiliary shelf, clipboard, or table as equivalent facilitation.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Exit doors at east end	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Exit doors at east end	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Exit doors at east end	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Conference room	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Conference room	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	Remove or relocate furniture or storage items.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Administrative Services	Level 1	Electrical room	Door Hardware	Cabinet or storage door / drawer does not have accessible hardware.	Provide accessible pull / latch (touch latches or U-pulls).		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Electrical room	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Private offices (#102-103)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Private offices (#102-103)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Pantry	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	Relocate existing restroom accessories.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Pantry	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Pantry	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Pantry	Sink	Kitchenette sink rim higher than 34" above floor.	Remodel sink cabinet to lower sink.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Valley	Administrative Services	Level 1	Pantry	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	Remodel sink cabinet.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Pantry	Sink	Kitchenette sink is more than 6 1/2" deep.	Provide new sink remodel and cabinet as needed.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Pantry	Sink	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Private office	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Private office	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Men's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Men's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED	
Indian Valley	Administrative Services	Level 1	Men's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	Provide accessible grab bars.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Men's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Men's restrooms	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	Provide accessible faucet at accessible lavatory.	COMPLETED	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Administrative Services	Level 1	Men's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED	
Indian Va	Administrative Services	Level 1	Men's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED	
Indian Va	Administrative Services	Level 1	Men's restrooms	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	Provide new partition and stall door with compliant width.	COMPLETED	
Indian Va	Administrative Services	Level 1	Men's restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.	COMPLETED	
Indian Va	Administrative Services	Level 1	Men's restrooms	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	Change latch/hinge side of outer door.	COMPLETED	
Indian Va	Administrative Services	Level 1	Men's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	Remove adjacent fixture and provide new enclosure at accessible water closet.	COMPLETED	
Indian Va	Administrative Services	Level 1	Men's restrooms	Toilet Stall	Toilet stall less than 60" wide.	Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).	COMPLETED	
Indian Va	Administrative Services	Level 1	Men's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	Provide new enclosure at existing water closet fixture.	COMPLETED	
Indian Va	Administrative Services	Level 1	Men's restrooms	Urinal	CA only: Front of rim projects less than 14" from wall.	Provide accessible urinal. Remodel restroom as needed.	COMPLETED	
Indian Va	Administrative Services	Level 1	Men's restrooms	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	Provide accessible urinal flush control.	COMPLETED	
Indian Va	Administrative Services	Level 1	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	Provide recessed toilet paper dispenser or disposal container.	COMPLETED	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
							COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Accessories	Toilet paper dispenser not continuous paper flow type.	Provide continuous-flow toilet paper dispenser.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	Provide accessible grab bars.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	Provide accessible faucet at accessible lavatory.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	Provide new partition and stall door with compliant width.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	Remove adjacent fixture and provide new enclosure at accessible water closet.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Toilet Stall	Toilet stall less than 60" wide.	Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).	COMPLETED	
Indian Valley	Administrative Services	Level 1	Women's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	Provide new enclosure at existing water closet fixture.	COMPLETED	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Valley	Administrative Services	Level 1	Women's restrooms	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	Replace flush control with properly mounted accessible type.	COMPLETED	
Indian Valley	Administrative Services	Level 1	Staff Lounge	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Staff Lounge	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Staff Lounge	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Staff Lounge	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Staff Lounge	Sink	Kitchenette sink does not have knee space (min. 27" high x 19" deep x 30" wide).	Replace efficiency kitchen with new sink counter and oven range.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Student Health Services Office	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Student Health Services Office	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	Status	
							RESOLVED	PENDING
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	Remove door stopper when altering area. Provide rubber wedge.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	Fire alarm station to be 48" from floor to center.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	Provide auxiliary shelf, clipboard, or table as equivalent facilitation.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Sink	Kitchenette sink rim higher than 34" above floor.	Remodel sink cabinet to lower sink.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	Remodel sink cabinet.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Sink	Kitchenette sink is more than 6 1/2" deep.	Provide new sink remodel and cabinet as needed.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	A.S.E.C Room	Sink	Hot or sharp-surfaced water/drain pipe not insulated or covered.	Insulate or cover water/drain pipe.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	E.O.P. & S. Tutoring Center	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	E.O.P. & S. Tutoring Center	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Hallway	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Hallway	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	Provide raised letter/Braille "EXIT" sign at door.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Elevator	Elevator	"Door opening has less than 36"" clear opening width. "	"Enlarge elevator door opening to 36"" width."		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Elevator	Elevator	Elevator control panel buttons not illuminated.	Provide illuminated elevator control panel buttons .		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	RESOLVED	PENDING
Indian Va	Administrative Services	Level 1	Elevator	Elevator	Elevator car lacks emergency communication device that is not dependent on speaking/hearing ability of elevator passenger.	Provide elevator communication device that has combination voice and light signal communications.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Elevator	Elevator	"Handrail not mounted with top 32", plus or minus one inch, above the floor of car. "	"Remount handrail at 32" above floor."		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Elevator	Elevator	Neither audible signal nor visual wall lantern provided.	"Provide audible signal, and wall lantern device."		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Elevator	Elevator	"Floor numbers not provided at all elevator entrances with both raised characters 2" high and Braille numbers, on each entrance jamb."	Provide compliant floor numbering on elevator door jambs.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Elevator	Elevator	Small size of car makes elevator difficult to use or unusable by persons in wheelchairs.	Provide new elevator with two stops.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Equipment room (#106)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Equipment room (#106)	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Va	Administrative Services	Level 1	Equipment room (#106)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Indian Valley Campus

Campus	Building/Location	Floor/Area	Item Name	Specific Item	Problem Description	Solution	Status	
							RESOLVED	PENDING
Indian Valley	Administrative Services	Level 1	Private offices	Door Hardware	Door does not have accessible operating hardware.	Provide lever handle or other accessible hardware.		Full modernization planned in next Bond 2017
Indian Valley	Administrative Services	Level 1	Private offices	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	Provide new compliant signage including California Grade 2 Braille.		Full modernization planned in next Bond 2017