



College of Marin

Kentfield Campus

Access Compliance Survey Report Update

August 2013





NAVIGATION & LEGEND

Description of Barrier Removal Data Format for Buildings and Site Work

1	2	3	4	5	6	7	8	9	10	11	12
College of Marin											
Access Compliance Survey Report Update											
Campus: XXXXXXXXXXXXXXXX				Building/Part: Exterior				Area/Floor: On-Site			
Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info				Qty	Unit	Cost	Total		
1	Accessible Parking										
Floor or Ground Surfaces											
11585	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). • <i>As-Built:</i> 3.5% • <i>Proposed Solution:</i> Modify slope at accessible parking space. 	<ul style="list-style-type: none"> PCODE EA05 ADAAG 4.6.3 CSAS 1129B.3.3 ADA ABA 502.4 DSA App. # XX-XXXXXX Year Mitigated 20XX - 20XX Funding Bond Program Mitigation Note Demolish and relocated 				575	SF	\$12	\$6900		

- Item Number:** Unique for each part/building in SSA Database.
- Area / Location:** Describes the building location / item title (e.g.: parking lot, room name).
- As-Built:** Description of as-is barrier based on applicable accessibility codes.
- As-is Measurement:** Existing conditions/dimensions.
- Proposed Solution:** Description of steps necessary to remove barrier and, if applicable, an interim solution or notes.
- Funding Source:/ Mitigation Info:** Identifies the DSA application number, funding source, project year and includes additional notes.
- Codes / Info:**
 - *PCODE:* specifies the relevant SSA database code. Database code plus suffix:
 - REF: data shown for reference only [scope of work related to or covered by other item];
 - NT: non-typical problem or solution.
 - *ADAAG, CSAS, ADA ABA and ADA PRow:* specifies applicable sections of Federal and State accessibility codes.
- Qty:** Number of units required.
- Unit:** Unit of measurement used to compute cost estimate. LF=linear feet; SF=square feet; JOB=lump sum.
- Cost:** Estimated cost of specific solution per one unit.
(The final cost of the barrier-removal projects may exceed this estimate based on year of mitigation and design approach.)
- Total:** Total estimated cost for removing identified barrier (multiplied Qty by Cost).
- ID No:** Specifies Facility Number, Area Number: 1= Interior / 0 = Exterior, and Part / Floor Number.



Access Compliant Report Format

ADA	Americans with Disabilities Act	MoM	Method of mitigation
ADAAG	ADA Accessibility Guidelines	MP	Master priority
ADACO	ADA-Coordinator	MRR	Men's restroom
AFF	Above finished floor	N	North
C.T.P.	Contact third party	N.A.R.	No action required
CA	State of California	NE	Northeast
CDD	Community Development Director	NT	Non-typical
cl	Center line	NW	Northwest
CMGR	City Manager	NWn	Northwest: North side
CP	Chief of Police	NWs	Northwest: South side
CSAS	CA State Accessibility Standards	o.c.	On center
D.A.	Designated accessible	O/R	Official responsible
Dep.	Deputy	PAR	Public Access Route
Dept. Rep	Department representative	P.A.	Physical alteration
DF	Drinking fountain	P.M.	Program modification
DH	Department Head	POT	Path of travel
Dir.	Director	PROW	Public Right of Way
E	East	PTD	Paper towel dispenser
E.D.	Executive Director	PWD	Public Works Director
E.F.	Equivalent facilitation	Qty	Quantity
F-B-F	Facility-Building-Floor	REF	Reference
FC	Fire Chief	S	South
FD	Finance Director	SCD	Seat cover dispenser
Fig.	Figure	SD	Soap dispenser
FM&O	Facilities, Maintenance & Operations	sec.	Second
FND	Feminine napkin dispenser	Sec.	Section
FTD	Feminine tampon dispenser	SE	Southeast
Gov.	Government	SF	Square foot
HQ	Headquarters	SW	Southwest
JOB	per one job (lump sum)	TBD	To be determined
Lab	Laboratory	up	Ramp or stair direction up
Lav	Lavatory	W	West
lbs	Pounds	WC	Water Closet
LF	Linear foot	WRR	Women's Restroom
MOD	Modernization project		

STANDARDS

PERPENDICULAR CURB RAMP	
Width of Ramp	48" wide min.
Slope of Ramp	8.3% max.
X Slope of the Ramp	2.0% max.
Top Landing Length	48" long min.
Top Landing Slope	2.0% max.
Top Landing X Slope	2.0% max.
Left Flare	10% max.
Right Flare	10% max.
Gutter Slope	5% max.
Gutter X Slope	2% max.
Gutter Lip	0" lip (Flush)
Grooved Borders	12" grooves
Truncated Domes	36" deep x width of ramp
Within Crosswalk	48" within crosswalk

PARALLEL CURB RAMP		
	LEFT	RIGHT
Width of Ramp	48" wide min.	48" wide min.
Slope of Ramp	8.3% max.	8.3% max.
X Slope of the Ramp	2.0% max.	2.0% max.
Top Landing X Slope	2.0% max.	2.0% max.
Bottom Landing Length	48" long x 48" wide	
Bottom Landing Slope	2.0% max.	
Bottom Landing X Slope	2.0% max.	
Gutter Slope	5% max.	
Gutter X Slope	2% max.	
Gutter Lip	0" lip (Flush)	
Grooved Border	12" grooves (on both sides)	
Truncated Domes	36" deep x width of ramp	
Within Crosswalk	48" within crosswalk	

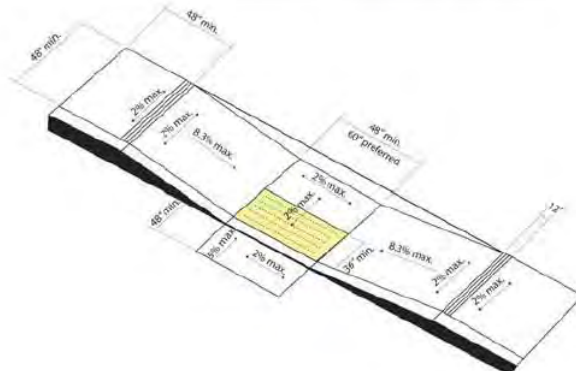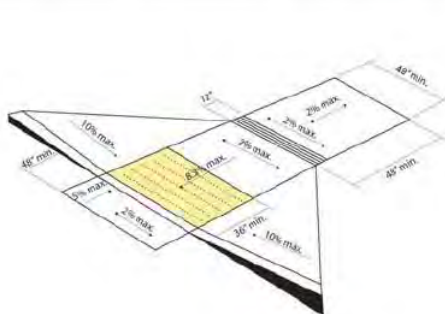



COST SUMMARY

DSA Application #: **01-108949**

Campus: 2 Kentfield Campus	\$158,433.00
Building/Part: 0 Exterior	\$14,845.00
Area/Floor: 2-0-1 On-site	\$14,845.00
Building/Part: 14 Physical Educational Complex	\$143,588.00
Area/Floor: 2-14-1 Lower Level	\$143,588.00

DSA Application #: **01-109358**

Campus: 2 Kentfield Campus	\$751,125.00
Building/Part: 0 Exterior	\$690,625.00
Area/Floor: 2-0-1 On-site	\$690,625.00
Building/Part: 2 Dickson Hall	\$35,155.00
Area/Floor: 2-2-1 Lower Level	\$26,060.00
Area/Floor: 2-2-2 Upper level	\$9,095.00
Building/Part: 3 D.S.P.S. Center	\$14,565.00
Area/Floor: 2-3-1 Lower Level	\$14,565.00
Building/Part: 4 Dance/Landscape Buidling	\$10,780.00
Area/Floor: 2-4-1 Lower Level	\$2,700.00
Area/Floor: 2-4-2 Upper level	\$8,080.00

DSA Application #: **01-110237**

Campus: 2 Kentfield Campus	\$449,500.00
Building/Part: 1 Fine Arts Building	\$449,500.00
Area/Floor: 2-1-1 Lower Level	\$86,625.00
Area/Floor: 2-1-2 Upper level	\$345,855.00
Area/Floor: 2-1-3 Roof level	\$17,020.00

DSA Application #: **01-112613**

Campus: 2 Kentfield Campus	\$1,206,050.00
<hr/>	
Building/Part: 6 Harlan Center	\$512,650.00
Area/Floor: 2-6-1 Lower Level	\$502,980.00
Area/Floor: 2-6-2 Upper Level	\$9,670.00
<hr/>	
Building/Part: 7 Administrative Services	\$323,742.00
Area/Floor: 2-7-1 Lower Level	\$74,238.00
Area/Floor: 2-7-2 Upper Level	\$249,504.00
<hr/>	
Building/Part: 8 Olney Hall	\$339,608.00
Area/Floor: 2-8-1 Lower Level	\$275,448.00
Area/Floor: 2-8-2 Upper level	\$64,160.00
<hr/>	
Building/Part: 9 Business Management Building	\$30,050.00
Area/Floor: 2-9-1 Lower Level	\$30,050.00

DSA Application #: **Pending - To Be Submitted By Ssa On 12/1/2013**

Campus: 2 Kentfield Campus	\$525,465.00
<hr/>	
Building/Part: 5 Fusselman Hall	\$57,601.00
Area/Floor: 2-5-1 Level 1	\$36,386.00
Area/Floor: 2-5-2 Level 2	\$16,538.00
Area/Floor: 2-5-3 Level 3	\$4,677.00
<hr/>	
Building/Part: 10 Learning Resources Center	\$374,745.00
Area/Floor: 2-10-1 Lower Level	\$191,185.00
Area/Floor: 2-10-2 Upper Level	\$183,560.00
<hr/>	
Building/Part: 11 Student Services Buidling	\$93,119.00
Area/Floor: 2-11-1 Lower Level	\$32,893.00
Area/Floor: 2-11-2 Upper level	\$60,226.00

DSA Application #: **TBD**

Campus: 2 Kentfield Campus	\$211,908.00
Building/Part: 12 Temporary Building-1	\$89,010.00
Area/Floor: 2-12-1 Lower Level	\$89,010.00
Building/Part: 13 Science Center	\$122,898.00
Area/Floor: 2-13-2 Upper Level	\$122,898.00



SURVEY DATA

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
50 Accessible Parking at the West end of Parking Lot #12						
1921	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign for accessible parking space is missing, obscured or non-compliant. • <i>Proposed Solution:</i> Trim hedges obscuring signs. 	PCODE EA04BNT ADAAG 4.6.4 CSAS 1129B.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$315	\$315
1922	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own. • <i>Proposed Solution:</i> Widen path on front of vehicles. 	PCODE EA03NT ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$730	\$730
51 Steps leading from Parking Lot #12 to Pool Complex						
1923	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	50	LF	\$9	\$450
1924	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	15	LF	\$75	\$1,125
1925	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06AREF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
52 Ramps and Steps from sidewalk along College Ave. to Pool						
1927	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign at inaccessible ramp directing persons to an accessible route. • <i>Proposed Solution:</i> Provide sign stating "Too Steep!" include a sign directing persons to an accessible route. 	PCODE SA22 ADAAG 35.163(b) Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$250	\$250
1928	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 31" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	30	LF	\$75	\$2,250
1929	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework		REF		
1930	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	275	LF	\$9	\$2,475
53 Sidewalk along College Ave. in front of Pool Complex						
1931	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	20	LF	\$95	\$1,900
1932	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cross slope more than 1/4":12" (2%). • <i>As-is Measurement:</i> 4.1% • <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 CSAS 1133B.7.1.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	50	SF	\$12	\$600

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1933	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No curb ramp provided at passenger drop-off area. • <i>Proposed Solution:</i> Provide curb ramp at passenger drop-off area. 	PCODE EA08NT ADAAG 4.6.6 CSAS 1131B.2.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$2,500	\$2,500

54**Fenced Areas - Tennis Courts and Athletic Field**

1934	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Gate in accessible path of travel does not have compliant hardware. • <i>Proposed Solution:</i> Provide sign on or adjacent to gate stating: "Gate is to remain locked in the open position during regular college hours and during any other public function." 	PCODE ID03ANT ADAAG 4.13.10 & 11 CSAS 1133B.1.1.1.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	3	JOB	\$375	\$1,125
1935	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wheelchair space (33" x 48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat). • <i>Proposed Solution:</i> Remove fixed seating and provide wheelchair space plus necessary maneuvering clearance. Provide access to Press Box. 	PCODE GB01ANT ADAAG 4.2.4 CSAS 1104.3.6 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$450	\$450

55**Steps leading up to East Entrance from Parking Lot #10**

1936	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	75	LF	\$9	\$675
------	--	--	----	----	-----	-------

Total Costs for**Area/Floor: On-site****\$14,845.00**

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Exterior				\$14,845.00	

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Reception area (#10)						
3481	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$90	\$90
3482	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$50	\$50
3483	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 42" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$150	\$150
2 Private offices (#11-13)						
3484	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	3	JOB	\$90	\$270
3485	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	3	JOB	\$250	\$750

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3	Pantry					
3486	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$250	\$250
3487	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$90	\$90
3488	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		
3489	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide. • <i>As-is Measurement:</i> no knee clearance • <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$1,850	\$1,850
3490	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep. • <i>As-is Measurement:</i> 8" • <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4 Unisex restrooms						
3491	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$100	\$100
3492	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$90	\$90
3493	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$250	\$250
3494	<p>• <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations.</p> <p>• <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom.</p>	<p>PCODE WA01</p> <p>ADAAG 4.22</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$17,000	\$17,000
5 Women's locker room						
3495	<p>• <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.</p> <p>• <i>As-is Measurement:</i> 29"</p> <p>• <i>Proposed Solution:</i> Provide new, wider door pair and frame with new accessible hardware.</p>	<p>PCODE ID08</p> <p>ADAAG 4.13.4</p> <p>CSAS 1133B.2.3.1</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$2,400	\$2,400

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3496	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	2	JOB	\$50	\$100
3497	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$90	\$90
3498	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$100	\$100
3499	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	2	JOB	\$90	\$180
3500	<p>• <i>As-Built Description:</i> No bench provided at accessible lockers.</p> <p>• <i>Proposed Solution:</i> Provide new bench with adequate wheelchair space between locker and bench.</p>	<p>PCODE GG01NT</p> <p>-</p> <p>CSAS 3103(a)2D(5)</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3501	<ul style="list-style-type: none"> • <i>As-Built Description:</i> An adequate number of accessible lockers (5% total ; min 1 not provided. • <i>Proposed Solution:</i> Provide accessible lockers with accessible hardware. 	PCODE GG02NT - CSAS 3103(a)2D(5) Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$450	\$450
3502	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bar not mounted between 33" to 36" above the shower floor. • <i>As-is Measurement:</i> 37" A.F.F. • <i>Proposed Solution:</i> Remount grab bar in shower. 	PCODE WF08 ADAAG Fig. 37(a) CSAS 1115B.6.2.4.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$500	\$500
3503	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Where extreme vandalism is a consideration, two fixed shower heads that can be operated independently and one mounted at 48" [+/- 1"] are not provided. • <i>As-is Measurement:</i> fixed shower head at 54" A.F.F. • <i>Proposed Solution:</i> Provide shower head at accessible height. 	PCODE WF05A CSAS 1115B.6.2.4.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$500	\$500
3504	<ul style="list-style-type: none"> • <i>As-Built Description:</i> The bottom of the control area less than 38" or top more than 48" above the shower floor, or area not within 18" of the front of the shower (CA only: center line of controls not at 40" [+/-1"]). • <i>As-is Measurement:</i> shower control at 36" A.F.F. • <i>Proposed Solution:</i> Provide new, or relocate, shower controls. 	PCODE WF12 ADAAG 4.27.3 CSAS 1115B.6.2.4.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$800	\$800
3505	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	3	JOB	\$1,900	\$5,700

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3506	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Oval and round drinking fountains: bubbler outlet more than 3" from front edge of fountain (CA only: all drinking fountain bubbler outlets more than 6" from front edge). • <i>As-is Measurement:</i> 6" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03AREF ADAAG 4.15.3 CSAS 1507.3.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		
3507	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back). • <i>As-is Measurement:</i> 13" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$2,000	\$2,000
3508	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	5	JOB	\$120	\$600
3509	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 48" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$150	\$150
3510	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 48" F.T.D: 50" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	2	JOB	\$100	\$200

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3511	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i></p>	1	JOB	\$100	\$100
3512	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE WB10 ADAAG 4.16.5 & 4.27.4 CSAS 1502.0 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i></p>	1	JOB	\$500	\$500
3513	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 30" from front edge of wc.</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB03 ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i></p>	1	JOB	\$1,500	\$1,500
3514	<p>• <i>As-Built Description:</i> Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).</p> <p>• <i>As-is Measurement:</i> 52" from rear wall</p> <p>• <i>Proposed Solution:</i> Provide or relocate accessible side grab bar.</p>	<p>PCODE WB07A ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i></p>	1	JOB	\$300	\$300
3515	<p>• <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall.</p> <p>• <i>As-is Measurement:</i> 38" from side wall</p> <p>• <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar.</p>	<p>PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i></p>	1	JOB	\$300	\$300

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3516	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. • <i>As-is Measurement:</i> 15" • <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 CSAS 1502 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$1,400	\$1,400
3517	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible coat hook not within reach range. • <i>As-is Measurement:</i> 68" • <i>Proposed Solution:</i> Recommended: Adjust existing or provide new coat hook at 48" height. 	PCODE WG03A ADAAG 4.2.5 (1110B.1.7) Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$75	\$75
3518	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. • <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 CSAS 1504.1.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$600	\$600
6 Private office (#93)						
3519	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$2,600	\$2,600
3520	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3521	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$90	\$90
7 Room #91						
3522	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$250	\$500
3523	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$90	\$180
8 Men's locker room (#70)						
3524	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, unequal width door leafs in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$1,500	\$1,500
3525	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$50	\$100

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3526	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$90	\$90
3527	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$100	\$100
3528	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	2	JOB	\$90	\$180
3529	<p>• <i>As-Built Description:</i> No bench provided at accessible lockers.</p> <p>• <i>Proposed Solution:</i> Provide new bench with adequate wheelchair space between locker and bench.</p>	<p>PCODE GG01NT</p> <p>-</p> <p>CSAS 3103(a)2D(5)</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$150	\$150
3530	<p>• <i>As-Built Description:</i> An adequate number of accessible lockers (5% of total; min 1 accessible is not provided).</p> <p>• <i>Proposed Solution:</i> Provide accessible lockers with accessible operating hardware.</p>	<p>PCODE GG02NT</p> <p>-</p> <p>CSAS 3103(a)2D(5)</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$450	\$450

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3531	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bar not mounted between 33" to 36" above the shower floor. • <i>As-is Measurement:</i> grab bar at 37" A.F.F. • <i>Proposed Solution:</i> Remount grab bar in shower. 	PCODE WF08 ADAAG Fig. 37(a) CSAS 1115B.6.2.4.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$500	\$500
3532	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Where extreme vandalism is a consideration, two fixed shower heads that can be operated independently and one mounted at 48" [+/- 1"] are not provided. • <i>As-is Measurement:</i> Fixed shower head at 54" A.F.F. • <i>Proposed Solution:</i> Provide fixed shower head at accessible height. 	PCODE WF05A CSAS 1115B.6.2.4.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$500	\$500
3533	<ul style="list-style-type: none"> • <i>As-Built Description:</i> The bottom of the control area less than 38" or top more than 48" above the shower floor, or area not within 18" of the front of the shower (CA only: center line of controls not at 40" [+/-1"]). • <i>As-is Measurement:</i> shower control at 36" A.F.F. • <i>Proposed Solution:</i> Provide new, or relocate, shower controls. 	PCODE WF12 ADAAG 4.27.3 CSAS 1115B.6.2.4.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$800	\$800
3534	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>As-is Measurement:</i> 6" • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	3	JOB	\$1,900	\$5,700
3536	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in good condition. • <i>As-is Measurement:</i> 6" • <i>Proposed Solution:</i> Remount fountain at accessible height. 	PCODE IA03CREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3537	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back). • <i>As-is Measurement:</i> 13" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$2,000	\$2,000
3538	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	5	JOB	\$120	\$600
3539	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 48" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$150	\$150
3540	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 48" F.T.D: 50" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$100	\$200
3541	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock). • <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides. 	PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3542	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type. 	PCODE WB10 ADAAG 4.16.5 & 4.27.4 CSAS 1502.0 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$500	\$500
3543	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 30" from front edge of wc • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03 ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$1,500	\$1,500
3544	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet). • <i>As-is Measurement:</i> 52" from rear wall • <i>Proposed Solution:</i> Provide or relocate accessible side grab bar. 	PCODE WB07A ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$300	\$300
3545	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall. • <i>As-is Measurement:</i> 38" from side wall • <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar. 	PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$300	\$300
3546	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. • <i>As-is Measurement:</i> 15" • <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 CSAS 1502 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$1,400	\$1,400

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3547	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible coat hook not within reach range. • <i>As-is Measurement:</i> 68" • <i>Proposed Solution:</i> Recommended: Adjust existing or provide new coat hook at 48" height. 	PCODE WG03A ADAAG 4.2.5 (1110B.1.7) Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$75	\$75
3548	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. • <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 CSAS 1504.1.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$600	\$600
3549	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 CSAS 1503.2.1 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$4,000	\$4,000
3550	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		
3551	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 50" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
9 Private office (#76)						
3552	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$90	\$90
3553	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$250	\$250
10 Private office (#77)						
3554	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$90	\$180
3555	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$250	\$500
11 Team room						
3557	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$250	\$500

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3558	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$90	\$180
12 Room #61						
3559	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2		\$90	\$180
3560	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$250	\$500
13 Gymnastic room (#60)						
3561	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$90	\$180
3562	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back). • <i>As-is Measurement:</i> 7" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$2,000	\$2,000

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3563	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$1,900	\$1,900
14 Physical Education Department Office (#50)						
3564	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 28" • <i>Proposed Solution:</i> Provide new, wider door pair and frame with new accessible hardware. 	PCODE ID08 ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	2	JOB	\$2,400	\$4,800
3565	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	2	JOB	\$90	\$180
15 Private office (#51-56)						
3566	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	8	JOB	\$90	\$720
3567	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	8	JOB	\$250	\$2,000

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
16 Cardio-vascular equipment room (#40)						
3568	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$90	\$90
3569	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Floor-mounted closer (internal). Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 13 lbs • <i>Proposed Solution:</i> Disable floor-mounted closing mechanism and install new, door-mounted closer. 	PCODE ID03B ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$450	\$900
3570	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back). • <i>As-is Measurement:</i> 7" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$2,000	\$2,000
3571	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework		JOB	\$1,900	
17 Pool area						
3572	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Pool edges, ramps and stairs are not identified by texture and/or color change." • <i>Proposed Solution:</i> Provide alternating color bands. 	PCODE GJ03 ADAAG pending CSAS 3105(d)4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	430	LF	\$73	\$31,390

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3574	<p>• <i>As-Built Description:</i> "Pool steps: No 34"" high railings, with complying end extensions."</p> <p>• <i>Proposed Solution:</i> Provide new handrails at pool steps.</p>	<p>PCODE GJ05A</p> <p>-</p> <p>CSAS 3105(d)4</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	16	LF	\$98	\$1,568
18 Men's restrooms						
3575	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$100	\$100
3576	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$90	\$90
3577	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$50	\$50
3578	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 13"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$2,000	\$2,000

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3579	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework		REF		
3580	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 45" from front edge of wc. • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework		REF		
3581	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type. 	PCODE WB10 ADAAG 4.16.5 & 4.27.4 CSAS 1502.0 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$500	\$500
3582	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$500	\$500
3583	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. • <i>As-is Measurement:</i> 15" • <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 CSAS 1502 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$1,400	\$1,400

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3584	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18"). • <i>As-is Measurement:</i> 17" • <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02REF ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		
3585	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		
3586	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$150	\$150
3587	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	5	JOB	\$120	\$600
3588	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. • <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 CSAS 1504.1.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$600	\$600
3589	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 48" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3590	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 CSAS 1503.2.1 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$4,000	\$4,000
3591	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		
3592	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 52" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$500	\$500
19 Women's restrooms						
3593	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$100	\$100
3594	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3595	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$50	\$50
3596	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 13"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$2,000	\$2,000
3597	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06REF</p> <p>ADAAG 4.17.3</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>		REF		
3598	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 45" from front edge</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB03REF</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>		REF		
3599	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE WB10</p> <p>ADAAG 4.16.5 & 4.27.4</p> <p>CSAS 1502.0</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-108949</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework</p>	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3600	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$500	\$500
3601	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. • <i>As-is Measurement:</i> 15" • <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 CSAS 1502 C.P.C. Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$1,400	\$1,400
3602	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18"). • <i>As-is Measurement:</i> 17" • <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02REF ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		
3603	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>		REF		
3604	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	1	JOB	\$150	\$150
3605	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Complex, Parking Lots and Associated Sitework</i>	5	JOB	\$120	\$600

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3606	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. • <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 CSAS 1504.1.3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$600	\$600
3607	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 48" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$150	\$150
20 Gymnasium Lobby (#30)						
3611	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	4	JOB	\$90	\$360
3612	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	2	JOB	\$1,900	\$3,800
3613	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	8	JOB	\$50	\$400

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
21 Gymnasium						
3614	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	4	JOB	\$90	\$360
3615	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	8	JOB	\$50	\$400
5001	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than one percent of total seating are aisle seats with removable armrest (at aisle side) that are identified by by a sign. • <i>Proposed Solution:</i> Provide aisle seats with no or removable armrest and post availability at ticket office. 	PCODE GE01A ADAAG 4.1.2(19)a CSAS 1104B.3.4 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	6	EA	\$350	\$2,100
22 Weight Training Room (#20)						
3616	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$90	\$90
3617	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 27" • <i>Proposed Solution:</i> Provide new, wider door pair and frame with new accessible hardware. 	PCODE ID08 ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$2,400	\$2,400

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
23 Classroom (#22)						
3618	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$90	\$90
3619	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high. • <i>As-is Measurement:</i> 1.5" • <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed. 	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	40	SF	\$12	\$480
3620	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$50	\$50
24 Classroom (#23)						
3621	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	1	JOB	\$90	\$90
3622	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high. • <i>As-is Measurement:</i> 1.25" • <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed. 	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated 2008-2009 DSA App. # 01-108949 Funding Bond Program Mitigation Note Alterations to Complex, Parking Lots and Associated Sitework	40	SF	\$12	\$480

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3623	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	<ul style="list-style-type: none"> <i>PCODE</i> ID03 <i>ADAAG</i> 4.13.10 & 11 <i>CSAS</i> 1133B.2.5 <i>Year Mitigated</i> 2008-2009 <i>DSA App. #</i> 01-108949 <i>Funding</i> Bond Program <i>Mitigation Note</i> Alterations to Complex, Parking Lots and Associated Sitework 	1	JOB	\$50	\$50
Total Costs for Area/Floor: Lower Level					\$143,588.00	

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Physical Educational Complex				\$143,588.00	

Campus: **Kentfield Campus** Building/Part: **Physical Educational Complex** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Grand Total for	Campus: Kentfield Campus				\$158,433.00	

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Accessible Parking at Parking Lot #3						
1751	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own. • <i>Proposed Solution:</i> Provide new curb ramps and walkway in front of accessible stalls to connect accessible parking to an accessible route. 	PCODE EA03NT ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	2	JOB	\$2,500	\$5,000
1752	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). • <i>As-is Measurement:</i> 6.1% • <i>Proposed Solution:</i> Regrade area and relocate accessible parking. 	PCODE EA05NT ADAAG 4.6.3 CSAS 1129B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	900	SF	\$12	\$10,800
2 P.O.T. from Intersection of St. Francis & Elm to Parking Lot #3						
1753	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cross slope more than 1/4":12" (2%). • <i>As-is Measurement:</i> 6.0% - 9.0% • <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 CSAS 1133B.7.1.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	350	SF	\$12	\$4,200
3 Box Office Counter at Fine Arts Building						
1754	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Counter top exceeds 36". Complex code issue: Provision of auxiliary counter per ADAAG triggers California requirement for 34" high full counter. • <i>As-is Measurement:</i> 42" • <i>Proposed Solution:</i> Provide new or remodel existing counter to provide a 36" long section that is 34" high, or obtain variance from local building authority to install an auxiliary counter. Interim: Advise staff to make clip board available. 	PCODE RA01 ADAAG 7.2(1) CSAS 1122B.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$2,500	\$2,500

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4 Grove to the East of Dickson Hall						
1755	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wheelchair space (33" x 48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat). • <i>Proposed Solution:</i> Remove fixed seating and provide wheelchair space plus necessary maneuvering clearance. 	PCODE GB01A ADAAG 4.2.4 CSAS 1104.3.6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$450	\$450
1756	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Paved area has excessively rough, irregular surface. • <i>Proposed Solution:</i> Repare area to provide smooth surface for path of travel. 	PCODE EF10A ADAAG 4.5.2 CSAS 1133B.7.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	600	SF	\$6	\$3,600
5 Ramp/Stairs to the North of Dickson Hall						
1757	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60). • <i>Proposed Solution:</i> Enlarge landing; demolish existing ramp or portion and replace landing (CA only: comply with Tbl. 11B-38(a) Note 1) 	PCODE EB09REF ADAAG Fig. 25 CSAS Tbl. 11B-38(a) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1758	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 9.5% - 11.1% • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	750	SF	\$100	\$75,000
1759	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Pavement dislocation creates abrupt change in level exceeding 1/2" in ramp. • <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EB04REF ADAAG 4.5.2 CSAS 1133B.7.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1760	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Rise more than 30" between landings. • <i>As-is Measurement:</i> 38" - 45" • <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise. 	PCODE EB05REF ADAAG 4.8.2 CSAS 1133B.5.4.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		
1761	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Landing at change of direction not at least 60" x 60" (CA only: 72" x width of ramp runs). • <i>Proposed Solution:</i> Modify ramp bottom landing to 72" length. 	PCODE EB08REF ADAAG 4.8.4(3) CSAS 1133B.5.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		
1762	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>	200	LF	\$95	\$19,000
1763	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		
1764	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1765	<p>• <i>As-Built Description:</i> Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).</p> <p>• <i>Proposed Solution:</i> Provide new guardrail, including handrail at ramp.</p>	<p>PCODE ED08</p> <p>CSAS CBC 509</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	150	LF	\$120	\$18,000
1766	<p>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</p>	<p>PCODE EC02</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	100	LF	\$9	\$900
1767	<p>• <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06AREF</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>		REF		
6 Accessible Entrance to Fine Arts Building from Parking Lot #4						
1768	<p>• <i>As-Built Description:</i> CA only: Top landing less than 60" x 60".</p> <p>• <i>Proposed Solution:</i> Modify handrail at top landing of ramp.</p>	<p>PCODE EB07ANT</p> <p>CSAS 1133B.5.4.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	1	JOB	\$600	\$600
1769	<p>• <i>As-Built Description:</i> Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60).</p> <p>• <i>Proposed Solution:</i> Enlarge landing; demolish existing ramp or portion and replace landing (CA only: comply with Tbl. 11B-38(a) Note 1)</p>	<p>PCODE EB09REF</p> <p>ADAAG Fig. 25</p> <p>CSAS Tbl. 11B-38(a)</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1770	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Ramp landing does not extent 24" (at exterior ramp) or 18" (at interior ramp) past the strike edge of door or gate. • <i>Proposed Solution:</i> Enlarge landing; demolish existing ramp or portion and replace landing. 	PCODE EB09AREF CSAS 1133B.5.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site		REF		
7 Accessible Parking at Parking Lot #4						
1771	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). • <i>As-is Measurement:</i> 4% • <i>Proposed Solution:</i> Modify slope at accessible parking space. 	PCODE EA05 ADAAG 4.6.3 CSAS 1129B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site	1	JOB	\$480	\$480
1772	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign for accessible parking space is missing or non-compliant. • <i>Proposed Solution:</i> Provide compliant parking signage. 	PCODE EA04B ADAAG 4.6.4 CSAS 1129B.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site	1	JOB	\$315	\$315
1773	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own. • <i>Proposed Solution:</i> Relocate parking and provide curb ramp to accessible route. 	PCODE EA03NT ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site	8	JOB	\$1,500	\$12,000
1774	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 9.5% • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site	1	SF	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1775	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Parking-Ticket vending machine is not accessible. • <i>Proposed Solution:</i> Relocate or modify access to Parking-Ticket vending machine. 	PCODE EA02ANT ADAAG 4.6.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>	1	JOB	\$2,500	\$2,500
8 Accessible Entrance to Dickson Hall from Parking Lot #4						
1776	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 9.1% • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>	200	SF	\$100	\$20,000
1777	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Rise more than 30" between landings. • <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise. 	PCODE EB05REF ADAAG 4.8.2 CSAS 1133B.5.4.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		
1778	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Top landing less than 60" x 60". • <i>Proposed Solution:</i> Modify ramp top landing to 60" x 60" length. 	PCODE EB07AREF CSAS 1133B.5.4.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		
1779	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>	50	LF	\$95	\$4,750

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1780	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1781	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1782	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign at inaccessible ramp directing persons to an accessible route. • <i>Proposed Solution:</i> Provide sign stating "Too Steep!" Include a sign directing persons to an accessible route. 	PCODE SA22 ADAAG 35.163(b) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$250	\$250
9 Staircase to Upper Level of Dance/Landscape Building						
1783	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	150	LF	\$9	\$1,350
1784	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser. • <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece). 	PCODE ED07 ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	2	JOB	\$170	\$340

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
10 Ramp to the East end of Dance/Landscape Building						
1785	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site	35	LF	\$75	\$2,625
1786	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site		REF		
11 Steps to the West of Fusselman Hall						
1787	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site	50	LF	\$9	\$450
1789	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site	5	LF	\$75	\$375
1790	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06BREF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1937	<p>• <i>As-Built Description:</i> No signs at non-accessible entrances directing persons to an accessible entrance of the building.</p> <p>• <i>Proposed Solution:</i> Provide directional signage to indicate route to the nearest accessible entrance.</p>	<p>PCODE SA14</p> <p>ADAAG 4.1.2(7)(c)</p> <p>CSAS 1117B.5.7</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	1	JOB	\$230	\$230

12**Lower-Level Ramp to Elevator in Fusselman Hall**

1791	<p>• <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%).</p> <p>• <i>As-is Measurement:</i> 9.2%</p> <p>• <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails.</p>	<p>PCODE EB02</p> <p>ADAAG 4.8.2</p> <p>CSAS 1133.B.5.3</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	150	SF	\$100	\$15,000
1792	<p>• <i>As-Built Description:</i> Ramp: Rise more than 30" between landings.</p> <p>• <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise.</p>	<p>PCODE EB05REF</p> <p>ADAAG 4.8.2</p> <p>CSAS 1133B.5.4.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>		REF		
1793	<p>• <i>As-Built Description:</i> Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60).</p> <p>• <i>Proposed Solution:</i> Enlarge landing; demolish existing ramp or portion and replace landing (CA only: comply with Tbl. 11B-38(a) Note 1)</p>	<p>PCODE EB09REF</p> <p>ADAAG Fig. 25</p> <p>CSAS Tbl. 11B-38(a)</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>		REF		
1794	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01</p> <p>ADAAG 4.8.5 & 4.9.4</p> <p>CSAS 1133B.4.1 & B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	40	LF	\$95	\$3,800

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1795	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1796	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
13 Accessible P.O.T. to the South of Fusselman Hall						
1797	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cross slope more than 1/4":12" (2%). • <i>As-is Measurement:</i> 8.0% • <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 CSAS 1133B.7.1.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	150	SF	\$12	\$1,800
1798	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign at inaccessible ramp directing persons to an accessible route. • <i>Proposed Solution:</i> Provide sign stating "Too Steep!" Include a sign directing persons to an accessible route. 	PCODE SA22 ADAAG 35.163(b) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$250	\$250
14 Steps to the North of the Student Services Building						
1799	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	300	LF	\$9	\$2,700

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1800	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site	20	LF	\$95	\$1,900
15 Accessible Ramp on the North side of the Student Services Building						
1801	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 8.5% - 10.0% • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site	250	SF	\$100	\$25,000
1802	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Landing at change of direction not at least 60"x60" (CA only: 72"x width of ramp runs). • <i>Proposed Solution:</i> Modify ramp bottom landing to 72" length. 	PCODE EB08REF ADAAG 4.8.4(3) CSAS 1133B.5.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site		REF		
1803	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 31" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site	60	LF	\$75	\$4,500
1804	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPC Building and Site		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
16 Steps leading up to the Campus Greens from Student Services						
1805	<p>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</p>	<p>PCODE EC02</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	250	LF	\$9	\$2,250
1806	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01</p> <p>ADAAG 4.8.5 & 4.9.4</p> <p>CSAS 1133B.4.1 & B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	25	LF	\$95	\$2,375
1807	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>As-is Measurement:</i> 32"</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02REF</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 & B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>		REF		
1808	<p>• <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06AREF</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>		REF		
17 Upper-Level Ramp to Elevator in Fusselman Hall						
1809	<p>• <i>As-Built Description:</i> Ramp: Rise more than 30" between landings.</p> <p>• <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise.</p>	<p>PCODE EB05</p> <p>ADAAG 4.8.2</p> <p>CSAS 1133B.5.4.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	100	SF	\$45	\$4,500

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1810	<p>• <i>As-Built Description:</i> Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).</p> <p>• <i>Proposed Solution:</i> Provide new guardrail, including handrail at ramp.</p>	<p>PCODE ED08</p> <p>CSAS CBC 509</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>	5	LF	\$120	\$600
1811	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01</p> <p>ADAAG 4.8.5 & 4.9.4</p> <p>CSAS 1133B.4.1 & B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>	30	LF	\$95	\$2,850
1812	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>As-is Measurement:</i> 30"</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02REF</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 & B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>		REF		
1813	<p>• <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.</p> <p>• <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece).</p>	<p>PCODE ED05REF</p> <p>ADAAG 4.8.5(2)</p> <p>CSAS 1133B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>		REF		
1814	<p>• <i>As-Built Description:</i> Ramp: Pavement dislocation creates abrupt change in level exceeding 1/2" in ramp.</p> <p>• <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level.</p>	<p>PCODE EB04REF</p> <p>ADAAG 4.5.2</p> <p>CSAS 1133B.7.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1815	<p>• <i>As-Built Description:</i> Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60).</p> <p>• <i>Proposed Solution:</i> Enlarge landing; demolish existing ramp or portion and replace landing (CA only: comply with Tbl. 11B-38(a) Note 1)</p>	<p>PCODE EB09REF</p> <p>ADAAG Fig. 25</p> <p>CSAS Tbl. 11B-38(a)</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>		REF		
18 Accessible Entrance to Fusselman Hall from Campus Green						
1816	<p>• <i>As-Built Description:</i> Ramp: Rise more than 30" between landings.</p> <p>• <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise.</p>	<p>PCODE EB05</p> <p>ADAAG 4.8.2</p> <p>CSAS 1133B.5.4.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	150	SF	\$45	\$6,750
1817	<p>• <i>As-Built Description:</i> Ramp: Pavement dislocation creates abrupt change in level exceeding 1/2" in ramp.</p> <p>• <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level.</p>	<p>PCODE EB04REF</p> <p>ADAAG 4.5.2</p> <p>CSAS 1133B.7.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>		REF		
1818	<p>• <i>As-Built Description:</i> Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.</p> <p>• <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide.</p>	<p>PCODE EB14REF</p> <p>ADAAG 4.8.7</p> <p>CSAS 1133B.5.6</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>		REF		
1819	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01</p> <p>ADAAG 4.8.5 & 4.9.4</p> <p>CSAS 1133B.4.1 & B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site</p>	40	LF	\$95	\$3,800

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
19 Ramp to the West of the Learning Resources Building						
1820	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 9.0% • <i>Proposed Solution:</i> Demolish non-compliant ramp run and regrade. 	PCODE EB02NT ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>	350	SF	\$100	\$35,000
1821	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp. • <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide. 	PCODE EB14REF ADAAG 4.8.7 CSAS 1133B.5.6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>		REF		
1822	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>	100	LF	\$95	\$9,500
1823	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>		REF		
1824	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
20 Steps leading up to Campus Green from Learning Resources						
1825	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	100	LF	\$9	\$900
1826	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	16	LF	\$75	\$1,200
1827	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06AREF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1828	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom extension of handrail does not return creating a hazard for blind individuals. • <i>Proposed Solution:</i> Remodel handrail return. 	PCODE ED12REF ADAAG 4.4.1 CSAS 1133B.4.2.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
21 Steps to the West of the Learning Resources Building						
1829	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	150	LF	\$9	\$1,350

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1830	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	35	LF	\$75	\$2,625
1831	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06AREF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1832	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom extension of handrail does not return creating a hazard for blind individuals. • <i>Proposed Solution:</i> Remodel handrail return. 	PCODE ED12REF ADAAG 4.4.1 CSAS 1133B.4.2.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
22 Sloped Walkway leading up to the Learning Resources Building						
1833	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. • <i>As-is Measurement:</i> 4.0% - 6.0% • <i>Proposed Solution:</i> Modify walk/sidewalk slope to 1:20 or less. 	PCODE EF01 ADAAG 4.8.1 CSAS 1133B.7.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	900	SF	\$45	\$40,500
1834	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wheelchair space (33" x 48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat). • <i>Proposed Solution:</i> Remove fixed seating and provide wheelchair space plus necessary maneuvering clearance. 	PCODE GB01A ADAAG 4.2.4 CSAS 1104.3.6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$450	\$450

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1835	<p>• <i>As-Built Description:</i> No sign at inaccessible ramp directing persons to an accessible route.</p> <p>• <i>Proposed Solution:</i> Provide sign stating "Too Steep!" include a sign directing persons to an accessible route.</p>	<p>PCODE SA22</p> <p>ADAAG 35.163(b)</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>	2	JOB	\$250	\$500
23 Stairs to the East of Student Services						
1836	<p>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</p>	<p>PCODE EC02</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>	450	LF	\$9	\$4,050
1837	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>As-is Measurement:</i> 30"</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 & B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>	50	LF	\$75	\$3,750
1838	<p>• <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06AREF</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>		REF		
1839	<p>• <i>As-Built Description:</i> Bottom extension of handrail does not return creating a hazard for blind individuals.</p> <p>• <i>Proposed Solution:</i> Remodel handrail return.</p>	<p>PCODE ED12REF</p> <p>ADAAG 4.4.1</p> <p>CSAS 1133B.4.2.3</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
24 East-side Entrance to Student Services						
1840	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Public text telephone not identified with a sign that includes the international T.D.D. symbol. • <i>Proposed Solution:</i> Provide compliant text phone sign. 	PCODE IB11 ADAAG 4.30.7(3) CSAS 3105A(d)2I(iii) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>	1	JOB	\$95	\$95
1841	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "T.D.D. service not provided in administration, constituent or student service area that communicates by telephone." • <i>Proposed Solution:</i> Provide T.D.D. service. 	PCODE IB13REF ADAAG 35.161 - Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		
25 Studio Entrance at South end of Learning Resources Building						
1842	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign at inaccessible ramp directing persons to an accessible route. • <i>Proposed Solution:</i> Provide sign stating "Too Steep!" include a sign directing persons to an accessible route. 	PCODE SA22 ADAAG 35.163(b) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>	1	JOB	\$250	\$250
1843	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 14.0% • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02REF ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		
26 Parking Lot #5						
1844	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space(s) not located close to the nearest possible entrance on an accessible route. • <i>Proposed Solution:</i> Relocate accessible parking space(s). 	PCODE EA06 ADAAG 4.6.2 CSAS 1129B.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>	2	JOB	\$350	\$700

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1845	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Night deposit box mounted with handle or deposit slot higher than 48" above sidewalk. • <i>Proposed Solution:</i> Remount night deposit at accessible height. 	PCODE AB08 ADAAG 4.2.5 CSAS 3105A(h)4c Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$3,200	\$3,200
1846	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign for accessible parking space is missing or non-compliant. • <i>Proposed Solution:</i> Provide compliant parking signage. 	PCODE EA04B ADAAG 4.6.4 CSAS 1129B.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	2	JOB	\$315	\$630
27 Stairs to Library Entrance from Parking Lot #5						
1847	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	50	LF	\$9	\$450
1848	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser. • <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece). 	PCODE ED07 ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$170	\$170
28 Ramp to Library Entrance from Parking Lot #5						
1849	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 12.6% • <i>Proposed Solution:</i> Demolish existing and provide new ramp of dog-legged type. 	PCODE EB02NT ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	250	SF	\$100	\$25,000

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1850	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	50	LF	\$95	\$4,750
1851	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1852	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60). • <i>Proposed Solution:</i> Enlarge landing; demolish existing ramp or portion and replace landing (CA only: comply with Tbl. 11B-38(a) Note 1) 	PCODE EB09REF ADAAG Fig. 25 CSAS Tbl. 11B-38(a) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1853	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp. • <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide. 	PCODE EB14REF ADAAG 4.8.7 CSAS 1133B.5.6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
29 Accessible Ramp at North side of Learning Resources Building						
1854	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 9.0% - 12.0% • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	450	SF	\$100	\$45,000

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1855	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Rise more than 30" between landings. • <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise. 	PCODE EB05REF ADAAG 4.8.2 CSAS 1133B.5.4.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>		REF		
1856	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Landing less than 60" long. • <i>Proposed Solution:</i> Modify ramp landing. 	PCODE EB07REF ADAAG 4.8.4(2) CSAS 1133B.5.4.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>		REF		
1857	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>	50	LF	\$95	\$4,750
1858	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60). • <i>Proposed Solution:</i> Enlarge landing; demolish existing ramp or portion and replace landing (CA only: comply with Tbl. 11B-38(a) Note 1) 	PCODE EB09REF ADAAG Fig. 25 CSAS Tbl. 11B-38(a) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>		REF		
30 Staircase at North side of Learning Resources Building						
1859	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>	300	LF	\$9	\$2,700

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1860	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	50	LF	\$75	\$3,750
1861	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06AREF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1862	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom extension of handrail does not return creating a hazard for blind individuals. • <i>Proposed Solution:</i> Remodel handrail return. 	PCODE ED12REF ADAAG 4.4.1 CSAS 1133B.4.2.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
31 Steps at South side of Olney Hall						
1863	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	650	LF	\$9	\$5,850
1864	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	40	LF	\$75	\$3,000

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1865	<ul style="list-style-type: none"> As-Built Description: Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. Proposed Solution: Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06AREF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1866	<ul style="list-style-type: none"> As-Built Description: Bottom extension of handrail does not return creating a hazard for blind individuals. Proposed Solution: Remodel handrail return. 	PCODE ED12REF ADAAG 4.4.1 CSAS 1133B.4.2.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
32 Information Board at South Entrance of Olney Hall						
1867	<ul style="list-style-type: none"> As-Built Description: No level area for wheelchair users is provided at Information Board. Proposed Solution: Relocate sign to more accessible area. 	PCODE SA06NT Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$80	\$80
33 Accessible Entrance at West side of Olney Hall						
1868	<ul style="list-style-type: none"> As-Built Description: Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. Proposed Solution: Modify walk/sidewalk slope to 1:20 or less. 	PCODE EF01 ADAAG 4.8.1 CSAS 1133B.7.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	600	SF	\$45	\$27,000
1869	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). Proposed Solution: Modify surface slope at door. 	PCODE ID11REF ADAAG 4.13.6 CSAS 1133B.2.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
34 Sloped Walkway to the North of Olney Hall						
1870	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route. • <i>Proposed Solution:</i> Provide directional sign. 	PCODE SA20 ADAAG 35.163(b) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$170	\$170
1871	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	100	LF	\$95	\$9,500
1872	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 12.0% • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	500	SF	\$100	\$50,000
35 Entrance at West side of Administrative Center						
1873	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	40	LF	\$95	\$3,800
1874	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1875	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	25	LF	\$9	\$225
1876	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space(s) not located close to the nearest possible entrance on an accessible route. • <i>Proposed Solution:</i> Provide accessible path of travel to nearest accessible parking space(s). 	PCODE EA06NT ADAAG 4.6.2 CSAS 1129B.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1200	SF	\$6	\$7,200
36 Entrance at East side to Children's Center						
1877	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No signs at non-accessible entrances directing persons to an accessible entrance of the building. • <i>Proposed Solution:</i> Provide directional signage to indicate route to the nearest accessible entrance. 	PCODE SA14 ADAAG 4.1.2(7)(c) CSAS 1117B.5.7 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$230	\$230
1878	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	15	LF	\$75	\$1,125
1879	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06AREF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
37	Entrance at South of Harlan Center					
1880	<p>• <i>As-Built Description:</i> Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.</p> <p>• <i>As-is Measurement:</i> 3.1% - 7.3%</p> <p>• <i>Proposed Solution:</i> Modify walk/sidewalk slope to 1:20 or less.</p>	<p>PCODE EF01</p> <p>ADAAG 4.8.1</p> <p>CSAS 1133B.7.3</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i></p>	500	SF	\$45	\$22,500
1881	<p>• <i>As-Built Description:</i> Cross slope more than 1/4":12" (2%).</p> <p>• <i>As-is Measurement:</i> 5.4%</p> <p>• <i>Proposed Solution:</i> Modify cross slope.</p>	<p>PCODE EF07REF</p> <p>ADAAG 4.3.7</p> <p>CSAS 1133B.7.1.3</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i></p>		REF		
1882	<p>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</p>	<p>PCODE EC02</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i></p>	150	LF	\$9	\$1,350
1883	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01REF</p> <p>ADAAG 4.8.5 & 4.9.4</p> <p>CSAS 1133B.4.1 & B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i></p>		REF		
1884	<p>• <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06AREF</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i></p>		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1885	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrails not returned to wall or newel post. • <i>Proposed Solution:</i> Add handrail return. 	PCODE ED13REF ADAAG 4.9.4(6) CSAS 1133B.4.2.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
38 Courtyard Adjacent to Harlan Center						
1886	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Level change between accessible path of travel and adjacent surface greater than 4". • <i>Proposed Solution:</i> Provide cane-detectable warning. 	PCODE EG08NT CSAS 1133B.8.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	150	SF	\$45	\$6,750
1887	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible exterior furniture (benches, stools, tables) cracked, broken or in need of repair. • <i>Proposed Solution:</i> Repair furniture. 	PCODE EG07 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$250	\$250
1888	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wheelchair space (33" x 48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat). • <i>Proposed Solution:</i> Remove fixed seating and provide wheelchair space plus necessary maneuvering clearance. 	PCODE GB01A ADAAG 4.2.4 CSAS 1104.3.6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$450	\$450
1889	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sidewalk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. • <i>As-is Measurement:</i> 3" • <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03 ADAAG 4.5.2 CSAS 1133B.7.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	10	SF	\$21	\$210

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
39 Entrance at West side of Management Building						
1890	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). • <i>As-is Measurement:</i> 10.6% • <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 CSAS 1133B.2.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>	50	SF	\$12	\$600
1891	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Paved area has excessively rough, irregular surface. • <i>Proposed Solution:</i> Repave area to provide smooth surface for path of travel. 	PCODE EF10A ADAAG 4.5.2 CSAS 1133B.7.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>	600	SF	\$6	\$3,600
40 Entrance Ramp at Building #16						
1892	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		
1893	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Standard handrail: Gripping section narrower than 1-1/4" or wider than 1-1/2". • <i>Proposed Solution:</i> Provide new handrail. 	PCODE ED03REF ADAAG 4.26.2 CSAS 1133B.4.2.6.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		
1894	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCPCC Building and Site</i>		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1895	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	30	LF	\$95	\$2,850

41**Accessible Parking at the North end of Parking Lot #6**

1896	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own. • <i>Proposed Solution:</i> Provide accessible path of travel from accessible parking to Campus Police Building. 	PCODE EA03NT ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	3	JOB	\$730	\$2,190
------	---	---	---	-----	-------	---------

1897	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No van parking provided (one in every 8 accessible spaces, but not less than one, 8' wide access aisle to the right of the parking stall, 98" height clearance). • <i>Proposed Solution:</i> Provide van parking space(s) by restriping; provide van sign. 	PCODE EA07 ADAAG 4.1.2(5)(b) CSAS 1129B.4.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$350	\$350
------	--	---	---	-----	-------	-------

42**Accessible Parking at the Center of Parking Lot #6**

1898	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space(s) not located close to the nearest possible entrance on an accessible route. • <i>Proposed Solution:</i> Relocate accessible parking space(s). 	PCODE EA06 ADAAG 4.6.2 CSAS 1129B.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	5	JOB	\$350	\$1,750
------	--	---	---	-----	-------	---------

1899	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Parking-Ticket vending machine is not accessible. • <i>Proposed Solution:</i> Relocate or modify access to Parking-Ticket vending machine. 	PCODE EA02ANT ADAAG 4.6.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$2,500	\$2,500
------	--	--	---	-----	---------	---------

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
43 Ramp to the East of the Science Center						
1900	<ul style="list-style-type: none"> • <i>As-Built Description:</i> 72" level area not provided at bottom landing. • <i>Proposed Solution:</i> Modify ramp bottom landing to 72" length. Provide sloped walkway to compensate for level difference between ramp landing and surrounding area. 	PCODE EB08NT ADAAG 4.8.4(3) CSAS 1133B.5.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>	350	SF	\$45	\$15,750
1901	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Rise more than 30" between landings. • <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise. 	PCODE EB05REF ADAAG 4.8.2 CSAS 1133B.5.4.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>		REF		
1902	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Standard handrail: Gripping section narrower than 1-1/4" or wider than 1-1/2". • <i>Proposed Solution:</i> Provide new handrail. 	PCODE ED03 ADAAG 4.26.2 CSAS 1133B.4.2.6.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>	75	LF	\$75	\$5,625
1903	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>		REF		
44 Walkway to Lower Level Parking in Science Center						
1904	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. • <i>As-is Measurement:</i> 6.0% - 10.0% • <i>Proposed Solution:</i> Provide ramp with handrails on both (2) sides. 	PCODE EF01A ADAAG 4.8.1 CSAS 1133B.7.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolition of Site and Buildings to be Replaced by SMCP Building and Site</i>	75	LF	\$260	\$19,500

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1905	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Paved area has excessively rough, irregular surface. • <i>Proposed Solution:</i> Repave area to provide smooth surface for path of travel. 	PCODE EF10AREF ADAAG 4.5.2 CSAS 1133B.7.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		

45**Accessible Parking at East end of Parking Lot #7**

1906	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own. • <i>Proposed Solution:</i> Provide accessible path of travel in front of parked vehicles. 	PCODE EA03NT ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$730	\$730
1907	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cross slope more than 1/4":12" (2%) on account of swale near accessible path of travel. • <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07NT ADAAG 4.3.7 CSAS 1133B.7.1.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	100	JOB	\$300	\$30,000

46**Accessible Parking at Lower Level of Science Center**

1908	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space or aisle smaller than required size (8' wide with 5' wide access aisle, 8' for vans). • <i>As-is Measurement:</i> 16' • <i>Proposed Solution:</i> Modify parking space(s) or aisle(s) to create accessible space (CA only: 8' x 18' with 5' x 18' or 8' x 18' access aisle). 	PCODE EA02 ADAAG 4.6.3 CSAS 1129B.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	5	JOB	\$200	\$1,000
1909	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space does not have 5' x 18' access aisle (van accessible aisle 8' x 18' to the right of the parking stall). • <i>Proposed Solution:</i> Modify parking space(s) or aisle(s) to create accessible space by restriping. 	PCODE EA02B ADAAG 4.6.3 CSAS 1129B.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$200	\$200

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1910	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Overhead clearance less than 80" above finished floor. • <i>Proposed Solution:</i> Provide cane-detectable railing to mark area of low clearance. 	PCODE EG01AREF ADAAG 4.4.2 CSAS 1121B.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		

47**Accessible Parking at East end of Parking Lot #9**

1911	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign for accessible parking space is missing or non-compliant. • <i>Proposed Solution:</i> Provide compliant parking signage. 	PCODE EA04B ADAAG 4.6.4 CSAS 1129B.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	2	JOB	\$315	\$630
------	---	--	---	-----	-------	-------

48**Ramp and Stairs at the North of the Science Center**

1912	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign at inaccessible ramp directing persons to an accessible route. • <i>Proposed Solution:</i> Provide sign stating "Too Steep!" include a sign directing persons to an accessible route. 	PCODE SA22 ADAAG 35.163(b) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	1	JOB	\$250	\$250
1913	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%). • <i>As-is Measurement:</i> 7.7% - 9.1% • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02REF ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
1914	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Rise more than 30" between landings. • <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise. 	PCODE EB05REF ADAAG 4.8.2 CSAS 1133B.5.4.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1915	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	250	LF	\$9	\$2,250
1916	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	25	LF	\$75	\$1,875
1917	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06BREF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site		REF		
49 Stairs to the South of the Science Center						
1918	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only). • <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area. 	PCODE EC02 CSAS 1133B.4.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	250	LF	\$9	\$2,250
1919	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolition of Site and Buildings to be Replaced by SMCP Building and Site	25	LF	\$75	\$1,875

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1920	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	<ul style="list-style-type: none"> <i>PCODE</i> ED06BREF <i>ADAAG</i> 4.9.4(2) <i>CSAS</i> 1133B.4.2.2 <i>Year Mitigated</i> 2009-2010 <i>DSA App. #</i> 01-109358 <i>Funding</i> Bond Program <i>Mitigation Note</i> Demolition of Site and Buildings to be Replaced by SMCP Building and Site 		REF		
Total Costs for		Area/Floor: On-site		\$690,625.00		

Campus: **Kentfield Campus** Building/Part: **Exterior** Area/Floor: **On-site**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Exterior				\$690,625.00	

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Entrance door on west side						
2209	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area. 	PCODE ID06 CSAS 1133B.2.6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$90	\$90
2210	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$90	\$90
2211	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • <i>As-is Measurement:</i> 6" protrusion at 49" high • <i>Proposed Solution:</i> Remove/relocate protruding object (fire extinguisher) . Patch existing surface. 	PCODE EG04NT ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$100	\$100
2 Office Lobby (# 20)						
2212	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$75	\$75
2213	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2214	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$50	\$50
2215	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$90	\$90
3 Patio						
2216	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$250	\$250
2217	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$75	\$75
2218	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high. • <i>As-is Measurement:</i> 1-1/4" • <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed. 	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	?	SF	\$12	

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4 Private offices (#s 21-25)						
2219	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	5	JOB	\$250	\$1,250
2220	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	5	JOB	\$90	\$450
5 Custodian room (#11)						
2221	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$250	\$250
6 Ramp to restrooms						
2222	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	32	LF	\$95	\$3,040
2223	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail: Clearance to wall is not 1-1/2". • <i>Proposed Solution:</i> Remount existing handrail. 	PCODE ED04REF 4.9.4(3) CSAS 1133B4.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>		REF		

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2224	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05 ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$170	\$170
4973	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%) . • <i>As-is Measurement:</i> 7.6%-8.8% • <i>Proposed Solution:</i> Modify ramp slope. Demolish existing ramp and replace with new ramp. 	PCODE IJ03 ADAAG 4.8.2 CSAS 3307 (c.1) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	32	LF	\$35	\$1,120
7 Mechanical room (# 12)						
2225	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$250	\$250
2226	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$90	\$90
8 Storage room (# 13)						
2227	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2228	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$90	\$90
9 Women's restrooms						
2229	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$100	\$100
2230	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$90	\$90
2231	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 7" • <i>Proposed Solution:</i> Remove latch, if door closer is to remain. 	PCODE ID24ANT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$50	\$50
2232	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$2,000	\$2,000

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2233	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>		REF		
2234	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 95" from back wall to front wall of side entry toilet stall when door swings inward, or less than 92" if water closet is wall-hung (CA only: Less than 60" from front of water closet to opposite wall in side entry stall). • <i>As-is Measurement:</i> 44" in front of wc. • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB04REF ADAAG 4.17.3 CSAS 1115B.7.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>		REF		
2235	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type. 	PCODE WB10 ADAAG 4.16.5 & 4.27.4 CSAS 1502.0 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$500	\$500
2236	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>		REF		
2237	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2238	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Height of water closet seat less than 17" from floor. • <i>As-is Measurement:</i> 16" • <i>Proposed Solution:</i> Provide riser toilet seat (CA only: in alterations, riser seat may not be higher than 3"). 	PCODE WB08A ADAAG 4.16.3 CSAS 1502.0 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$80	\$80
2239	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	2	JOB	\$120	\$240
2240	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5.5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$150	\$150
2241	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> F.T.D: 50" A.F.F P.T.D: 49" A.F.F • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	2	JOB	\$100	\$200
2242	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 13 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2243	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Adequate wheelchair space between lockers and benches not provided (44" width needed)." • <i>Proposed Solution:</i> Remove and relocate bench and patch floor to provide adequate wheelchair space between locker and bench. 	PCODE GG01 - CSAS 3103(a)2D(5) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$150	\$150
2244	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 2 sec. • <i>Proposed Solution:</i> Adjust self-closing faucet at accessible lavatory. 	PCODE WD07 ADAAG 4.19.5 CSAS 1504.2.1 C.P.C. Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$50	\$50
10 Men's restrooms						
2245	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	2	JOB	\$100	\$200
2246	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	2	JOB	\$90	\$180
2247	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 13 lbs, 18 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	2	JOB	\$50	\$100

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2248	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 12"</p> <p>• <i>Proposed Solution:</i> Remove lavatory fixture to provide required clearance at door.</p>	<p>PCODE ID23ANT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$500	\$500
2249	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 52" A.F.F.</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE WG01A</p> <p>ADAAG 28 CFR 35.133(a)</p> <p>CSAS 1115B.9.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$100	\$100
2250	<p>• <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor.</p> <p>• <i>As-is Measurement:</i> 49"</p> <p>• <i>Proposed Solution:</i> Relocate or provide new accessible mirror.</p>	<p>PCODE WG03</p> <p>ADAAG 4.19.6</p> <p>CSAS 1115B.9.1.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$150	\$150
2251	<p>• <i>As-Built Description:</i> Wheelchair clearance under lavatory or lavatory counter front edge less than 29" high x 8" deep x 30" wide.</p> <p>• <i>As-is Measurement:</i> 26"</p> <p>• <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed.</p>	<p>PCODE WD03</p> <p>ADAAG 4.19.2</p> <p>CSAS 1504.2.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$3,400	\$3,400
2252	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE WD05</p> <p>ADAAG 4.19.4</p> <p>CSAS 1504.2.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	5	JOB	\$120	\$600

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2253	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 2 sec. • <i>Proposed Solution:</i> Adjust self-closing faucet at accessible lavatory. 	PCODE WD07 ADAAG 4.19.5 CSAS 1504.2.1 C.P.C. Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$50	\$50
2254	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall. • <i>As-is Measurement:</i> 11.5" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01REF CSAS 1503.2.1 C.P.C. Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>		REF		
2255	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02 ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$2,400	\$2,400
2256	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 52" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$500	\$500
2257	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$2,000	\$2,000
2258	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>		REF		

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2259	<p>• <i>As-Built Description:</i> Less than 95" from back wall to front wall of side entry toilet stall when door swings inward, or less than 92" if water closet is wall-hung (CA only: Less than 60" from front of water closet to opposite wall in side entry stall).</p> <p>• <i>As-is Measurement:</i> 44" in front of wc</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB04REF</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>		REF		
2260	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE WB10</p> <p>ADAAG 4.16.5 & 4.27.4</p> <p>CSAS 1502.0</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$500	\$500
2261	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE WB07</p> <p>ADAAG 4.17.6*</p> <p>CSAS 1115B.8</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$500	\$500
2262	<p>• <i>As-Built Description:</i> Height of water closet seat less than 17" from floor.</p> <p>• <i>As-is Measurement:</i> 15"</p> <p>• <i>Proposed Solution:</i> Provide riser toilet seat (CA only: in alterations, riser seat may not be higher than 3").</p>	<p>PCODE WB08A</p> <p>ADAAG 4.16.3</p> <p>CSAS 1502.0</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$80	\$80
2263	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B</p> <p>ADAAG Fig. 28</p> <p>CSAS DSA/AC # 99-07</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
11 Exit door on south side of building						
2264	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$90	\$90
2265	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 14 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$50	\$50
12 Lecture room (# 30)						
2266	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$90	\$90
2267	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	2	JOB	\$250	\$500
2268	<p>• <i>As-Built Description:</i> No directions posted at inaccessible entrance.</p> <p>• <i>Proposed Solution:</i> Provide sign directing people to accessible entrance.</p>	<p>PCODE SA18</p> <p>ADAAG 35.163(b)</p> <p>CSAS 1117B.5.7</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2269	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	2	JOB	\$50	\$100
4974	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	2	JOB	\$50	\$100
13 Staircase adjacent to room # 30						
2270	<p>• <i>As-Built Description:</i> Wall mounted handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>Proposed Solution:</i> Remount existing handrail.</p>	<p>PCODE ED02A</p> <p>ADAAG 4.8.4(5) & 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 & B.5.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	21	LF	\$40	\$840
2271	<p>• <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06B</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	2	JOB	\$300	\$600
Total Costs for					Area/Floor: Lower Level	\$26,060.00

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Entrance door on east side						
2272	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 12 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$50	\$50
2273	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$90	\$90
2 Health center (# 118)						
2274	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$75	\$75
2275	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 7 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$50	\$50
2276	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3 Classroom (# 113)						
2277	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$250	\$250
2278	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$50	\$50
2279	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$90	\$90
4 Mechanical room (# 112)						
2280	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$250	\$250
2281	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1		\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
5 Classroom # 111						
2282	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$250	\$250
2283	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$90	\$90
2284	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$50	\$50
6 Mechanical room (# 110)						
2285	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$250	\$250
4975	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
7 Drinking fountain						
2287	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in good condition. • <i>As-is Measurement:</i> 38" • <i>Proposed Solution:</i> Remount fountain at accessible height. 	PCODE IA03C ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$1,200	\$1,200
2288	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>As-is Measurement:</i> 38" • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$1,900	\$1,900
8 Social Science Department office lobby (#104)						
2289	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	2	JOB	\$90	\$180
2290	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 12 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	2	JOB	\$50	\$100
2291	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	2	JOB	\$250	\$500

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
9 Private offices (#105-109)						
2292	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	5		\$250	\$1,250
2293	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	5	JOB	\$90	\$450
10 Classroom #103						
2294	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$250	\$250
2295	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$90	\$90
2296	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
11 Exit door at south end of corridor						
2297	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$90	\$90
2298	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 12 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$50	\$50
12 Classroom # 102						
2299	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$250	\$250
2300	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$90	\$90
2301	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
13 Laboratory # 122						
2302	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1		\$50	\$50
2303	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$250	\$250
2304	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$90	\$90
14 Classroom # 101						
2305	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$250	\$250
2306	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex</i></p>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2307	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	<ul style="list-style-type: none"> PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex 	1	JOB	\$90	\$90
Total Costs for		Area/Floor: Upper level			\$9,095.00	

Campus: **Kentfield Campus** Building/Part: **Dickson Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Dickson Hall				\$35,155.00	

Campus: **Kentfield Campus** Building/Part: **D.S.P.S. Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Entrance door on east side						
2308	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$90	\$90
2309	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hinge approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 36" x 60" or door width plus 42" x 54" (CA only: door width plus 36" x 60"). • <i>Proposed Solution:</i> Provide automatic door operator as per clients request. 	PCODE ID25CNT ADAAG Fig. 25(b) CSAS 11B-26A(b) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$5,000	\$5,000
2 Private offices (#104-110)						
2310	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	7	JOB	\$90	\$630
3 Drinking fountain						
2311	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in good condition. • <i>As-is Measurement:</i> 3" • <i>Proposed Solution:</i> Adjust water flow. 	PCODE IA03D ADAAG 4.15.3 CSAS 1507.3.4 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$75	\$75
4976	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship. • <i>Proposed Solution:</i> Remount fountain to be 16" o.c. from alcove walls. 	PCODE IA04NT CSAS 1117B.1.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$1,200	\$1,200

Campus: **Kentfield Campus** Building/Part: **D.S.P.S. Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4	Women's restroom					
2312	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$90	\$90
2313	<p>• <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet.</p> <p>• <i>As-is Measurement:</i> 19-1/2"</p> <p>• <i>Proposed Solution:</i> Fur out sidewall with 60" x 60" panel to provide 18" dimension. Install grab bar and recess toilet paper dispenser.</p>	<p>PCODE WB02B</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.1.3</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$1,000	\$1,000
2314	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4-1/2"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02BREF</p> <p>ADAAG Fig. 28</p> <p>CSAS DSA/AC # 99-07</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>		REF		
2315	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 49" A.F.F.</p> <p>• <i>Proposed Solution:</i> Relocate to alternate location at accessible height.</p>	<p>PCODE WG01ANT</p> <p>ADAAG 28 CFR 35.133(a)</p> <p>CSAS 1115B.9.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$100	\$100
2316	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 27"</p> <p>• <i>Proposed Solution:</i> Relocate water closet. Remodel restroom as needed.</p>	<p>PCODE WB01REF</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>		REF		

Campus: **Kentfield Campus** Building/Part: **D.S.P.S. Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2317	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side. • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE WC03AREF CSAS Fig.No.31-1B Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex		REF		
2318	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory). • <i>Proposed Solution:</i> Relocate trash receptacle. 	PCODE WD01ANT ADAAG 4.19.3 CSAS 1504.2.1 C.P.C. Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$900	\$900
2319	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Rear grab bar less than 12" from C/L of wc. • <i>As-is Measurement:</i> 6" • <i>Proposed Solution:</i> Provide accessible rear grab bar. 	PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$300	\$300
5 Men's restrooms						
2320	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$90	\$90
2321	<ul style="list-style-type: none"> • <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet. • <i>Proposed Solution:</i> Fur out sidewall with 60" x 60" panel to provide 18" dimension. Install grab bar and recess toilet paper dispenser. 	PCODE WB02B ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex	1	JOB	\$1,000	\$1,000

Campus: **Kentfield Campus** Building/Part: **D.S.P.S. Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2322	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4-1/2"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02BREF</p> <p>ADAAG Fig. 28</p> <p>CSAS DSA/AC # 99-07</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>		REF		
2323	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 43" A.F.F.</p> <p>• <i>Proposed Solution:</i> Relocate to alternative location at accessible height.</p>	<p>PCODE WG01ANT</p> <p>ADAAG 28 CFR 35.133(a)</p> <p>CSAS 1115B.9.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$100	\$100
2324	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>Proposed Solution:</i> Relocate water closet. Remodel restroom as needed.</p>	<p>PCODE WB01REF</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>		REF		
2325	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</p>	<p>PCODE WC03AREF</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>		REF		
2326	<p>• <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).</p> <p>• <i>Proposed Solution:</i> Relocate trash receptacle.</p>	<p>PCODE WD01ANT</p> <p>ADAAG 4.19.3</p> <p>CSAS 1504.2.1 C.P.C.</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$900	\$900
2327	<p>• <i>As-Built Description:</i> Rear grab bar less than 12" from C/L of wc.</p> <p>• <i>As-is Measurement:</i> 6"</p> <p>• <i>Proposed Solution:</i> Provide accessible rear grab bar.</p>	<p>PCODE WB07BNT</p> <p>ADAAG 4.17.6</p> <p>CSAS 1115B.8.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex</p>	1	JOB	\$300	\$300

Campus: **Kentfield Campus** Building/Part: **D.S.P.S. Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4977	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Seat cover dispenser is less than 18" above the grab bar; as such impedes it's use. • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$100	\$100
6 Exit door on east side						
2328	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$90	\$90
2329	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 6" • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID24B ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex</i>	1	JOB	\$2,600	\$2,600

Total Costs for**Area/Floor:** Lower Level**\$14,565.00**

Campus: **Kentfield Campus** Building/Part: **D.S.P.S. Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: D.S.P.S. Center				\$14,565.00	

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Library/Office (# 13)						
2330	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$90	\$90
2331	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$50	\$50
2 Classroom # 12						
2332	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$90	\$90
2333	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$50	\$50
3 Laboratory # 11						
2334	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2335	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. Proposed Solution: Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$50	\$50
2336	<ul style="list-style-type: none"> As-Built Description: Hot or sharp-surfaced water/drain pipe not insulated or covered. Proposed Solution: Insulate or cover water/drain pipe. 	PCODE IN06C ADAAG 4.24.6 CSAS 1117B.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	2	JOB	\$120	\$240
2337	<ul style="list-style-type: none"> As-Built Description: Kitchenette sink rim higher than 34" above floor. As-is Measurement: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3		REF		
2338	<ul style="list-style-type: none"> As-Built Description: Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$1,850	\$1,850
4 Storage room # 10						
4978	<ul style="list-style-type: none"> As-Built Description: Sign designating a permanent room or space does not include Grade 2 Braille. Proposed Solution: Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4979	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cabinet or storage door / drawer does not have accessible hardware. 	PCODE ID07A ADAAG 4.25.4 CSAS 1125B.4	1	JOB	\$100	\$100
	<ul style="list-style-type: none"> • <i>Proposed Solution:</i> Provide accessible pull / latch (touch latches or U-pulls). 	<i>Year Mitigated</i> 2009-2010 <i>DSA App. #</i> 01-109358 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>				
Total Costs for		Area/Floor: Lower Level	\$2,700.00			

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1	Entrance lobby					
2339	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>	2	JOB	\$75	\$150
2340	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>	2	JOB	\$90	\$180
2341	<p>• <i>As-Built Description:</i> No directions posted at inaccessible entrance.</p> <p>• <i>Proposed Solution:</i> Provide sign directing people to accessible entrance.</p>	<p>PCODE SA18</p> <p>ADAAG 35.163(b)</p> <p>CSAS 1117B.5.7</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>	1	JOB	\$90	\$90
2342	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 4"</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE ID02A</p> <p>ADAAG 4.13.8</p> <p>CSAS 1133B.2.4.1</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>	60	SF	\$12	\$720
2343	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>	2	JOB	\$50	\$100

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4980	<p>• <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain it is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping.</p> <p>• <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain.</p>	PCODE IA01A ADAAG 4.1.3.(10)(a) CSAS 1117B.1.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$2,000	\$2,000
2 Storage room (# 110)						
2344	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$90	\$90
3 Dance studio (# 101)						
2345	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1		\$90	\$90
2346	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$50	\$50
2347	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	2	JOB	\$90	\$180

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2348	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible panic hardware. 	PCODE ID07NT ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>	1	JOB	\$250	\$250

4**Unisex restroom**

2350	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>	1	JOB	\$90	\$90
2351	<ul style="list-style-type: none"> • <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet. • <i>As-is Measurement:</i> 20" • <i>Proposed Solution:</i> Fur out sidewall with 60" x 60" panel to provide 18" dimension. Install grab bar and recess toilet paper dispenser. 	PCODE WB02B ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>	1	JOB	\$1,000	\$1,000
2352	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02BREF ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>		REF		
2353	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall. • <i>As-is Measurement:</i> 39" from side wall • <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar. 	PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding <i>Bond Program</i> Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>	1	JOB	\$300	\$300

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2354	<ul style="list-style-type: none"> • As-Built Description: Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet). • As-is Measurement: 46" from rear wall • Proposed Solution: Provide or relocate accessible side grab bar. 	PCODE WB07A ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>	1	JOB	\$300	\$300
2355	<ul style="list-style-type: none"> • As-Built Description: Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • As-is Measurement: P.T.D: 50" S.D: 43" • Proposed Solution: S.C.D: 44" over grab bar Relocate existing restroom accessories. 	PCODE WG01ANT ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>	3	JOB	\$100	\$300
2356	<ul style="list-style-type: none"> • As-Built Description: CA only: In single-accommodation restroom less than 48" in front of water closet provided. • Proposed Solution: Relocate trash receptacle. 	PCODE WB03ANT CSAS 1115B.7.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>	1	JOB	\$500	\$500
2357	<ul style="list-style-type: none"> • As-Built Description: Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • As-is Measurement: 13 lbs • Proposed Solution: Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>	1	JOB	\$50	\$50
5 Custodial room (# 107)						
2349	<ul style="list-style-type: none"> • As-Built Description: Sign designating a permanent room or space does not include Grade 2 Braille. • Proposed Solution: Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
6 Warm-up room (#102)						
2358	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1		\$90	\$90
2359	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$50	\$50
7 Private office (#104)						
2360	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$90	\$90
8 Men's locker room (#106)						
2361	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2009-2010 DSA App. # 01-109358 Funding Bond Program Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2362	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign mounted 5' high on center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing).</p>	<p>PCODE SA11AREF</p> <p>ADAAG 4.1.2(7)</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>		REF		
2363	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 16 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>	1	JOB	\$50	\$50
2364	<p>• <i>As-Built Description:</i> Lockers do not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide at least 1% of lockers with accessible locking hardware that does not require grasping, pinching or twisting.</p>	<p>PCODE GG02NT</p> <p>-</p> <p>CSAS 3103(a)2D(5)</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>	1	JOB	\$450	\$450
9 Women's locker room (#103)						
2365	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>	1	JOB	\$90	\$90
2366	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign mounted 5' high on center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing).</p>	<p>PCODE SA11AREF</p> <p>ADAAG 4.1.2(7)</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished and replaced with new SMCP Complex; Program moved to MS3</i></p>		REF		

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2367	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 16 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3</p>	1	JOB	\$50	\$50
2368	<p>• <i>As-Built Description:</i> Lockers do not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide at least 1% of lockers with accessible locking hardware that does not require grasping, pinching or twisting.</p>	<p>PCODE GG02NT</p> <p>-</p> <p>CSAS 3103(a)2D(5)</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3</p>	1	JOB	\$450	\$450
10 Private office (#105)						
2370	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3</p>	1	JOB	\$90	\$90
2371	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2009-2010</p> <p>DSA App. # 01-109358</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished and replaced with new SMCP Complex; Program moved to MS3</p>	1	JOB	\$50	\$50

Total Costs for**Area/Floor: Upper level****\$8,080.00**

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Dance/Landscape Buidling				\$10,780.00	

Campus: **Kentfield Campus** Building/Part: **Dance/Landscape Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Grand Total for	Campus: Kentfield Campus				\$751,125.00	

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Elevator						
2144	<p>• <i>As-Built Description:</i> Neither audible signal nor visual wall lantern provided.</p> <p>• <i>Proposed Solution:</i> "Provide audible signal, and wall lantern device."</p>	<p>PCODE IK10C</p> <p>ADAAG 4.10.4</p> <p>CSAS 5103 (d.1) 9</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$2,510	\$2,510
4955	<p>• <i>As-Built Description:</i> Braille symbols on floor indicators of each elevator entrance jamb not compliant.</p> <p>• <i>Proposed Solution:</i> Provide compliant floor numbering on elevator door jambs.</p>	<p>PCODE IK11NT</p> <p>CSAS 3003.4.16a</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		SET	\$50	
2 Jewelry classroom (# 15)						
2145	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	2	JOB	\$250	\$500
2146	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$90	\$90
3 Ceramic's classroom (# 10)						
2147	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2148	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$250	\$500
2149	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$50	\$100
2150	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$75	\$75
4 Green room (# 34)						
2151	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$90	\$90
2152	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4956	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided." • <i>As-is Measurement:</i> 24" height • <i>Proposed Solution:</i> Provide new fixed accessible table or desk. 	PCODE IN02 ADAAG 4.32.3 & .4 CSAS 1122B.3 & 4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$2,500	\$2,500

5 Control booth (# 33)

2153	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2		\$250	\$500
------	--	--	---	--	-------	--------------

6 Theater black box (# 32)

2154	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$90	\$90
2155	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$250	\$250
2156	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Proper amount of seating for disabled persons at public seating is not provided (>25=1; >50=2; >300=4; >500=6; +500=6=1%). • <i>Proposed Solution:</i> Modify seating to provide clear and level wheelchair space 33" x 48" or 33" x 60", including companion seat, as required. 	PCODE GE01 ADAAG 4.1.2(19)a CSAS 1104B.3.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	EA	\$600	\$600

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2157	<p>• <i>As-Built Description:</i> No permanently installed assistive listening system provided for smaller assembly area (accommodating 50 to 200 persons).</p> <p>• <i>Proposed Solution:</i> Provide permanent assistive listening system (FM type), including sign at entrance indicating availability to the public, for smaller assembly area.</p>	<p>PCODE GI01A</p> <p>ADAAG 4.1.3 (19) (b)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$1,700	\$1,700
4957	<p>• <i>As-Built Description:</i> Stage, enclosed and unenclosed platform, backstage areas or orchestra pit not accessible.</p> <p>• <i>Proposed Solution:</i> Chair lift to raised platform.</p>	<p>PCODE GC01A</p> <p>ADAAG 4.33.5</p> <p>CSAS 1104B.3.10</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$25,000	\$25,000
7 Steps on the other side of Black Box Theater entrance						
2158	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area.</p>	<p>PCODE I102B</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	30	LF	\$14	\$420
2159	<p>• <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" min. beyond top of stair.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top (cost for each extension piece).</p>	<p>PCODE ED06</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B4.2.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	4	JOB	\$170	\$680
2160	<p>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</p>	<p>PCODE ED07</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	4	JOB	\$170	\$680

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
8 Drinking fountain						
2161	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in good condition. • <i>As-is Measurement:</i> 38-1/2" • <i>Proposed Solution:</i> Remount fountain at accessible height. 	PCODE IA03CREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	REF		
2162	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	4	JOB	\$1,900	\$7,600
4958	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Where more than one drinking fountain is provided per floor, less than 50% comply with ADAAG 4.15. • <i>Proposed Solution:</i> Provide accessible fountain or remodel existing to compliance. 	PCODE IA01B ADAAG 4.1.3.(10)(b) CSAS 1117B.1.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$2,000	\$4,000
9 Men's restrooms						
2163	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$100	\$100
2164	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2165	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60"). • <i>As-is Measurement:</i> 41" fr face of door • <i>Proposed Solution:</i> Provide door operator. 	PCODE ID27C ADAAG Fig. 25(c) CSAS 11B-26A(c) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$5,000	\$5,000
2166	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$50	\$50
2167	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$2,000	\$2,000
2168	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$500	\$500
2169	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 4.5" • <i>Proposed Solution:</i> Provide recessed feminine disposal container. 	PCODE WG02BNT ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2170	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 26" • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>		REF		
2171	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	3	JOB	\$120	\$360
2172	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 25 lbs/3sec. • <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory. 	PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$600	\$600
2173	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 55" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$150	\$150
2174	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02 ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$2,400	\$2,400

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2175	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 47" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$500	\$500
2176	<ul style="list-style-type: none"> • <i>As-Built Description:</i> 30" x 48" clear floor space in front of accessible urinal not provided. • <i>Proposed Solution:</i> Provide clear floor space in front of accessible urinal. Remodel restroom as needed. 	PCODE WE04REF ADAAG 4.18.3 CSAS 1115B.9.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building		REF		
2177	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> S.C.D. < 18" over grab bar • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$100	\$100
10 Women's restrooms						
2178	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$100	\$100
2179	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2180	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 41" fr face of door</p> <p>• <i>Proposed Solution:</i> Provide door operator.</p>	<p>PCODE ID27C</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$5,000	\$5,000
2181	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$50	\$50
2182	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$2,000	\$2,000
2183	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE WB07</p> <p>ADAAG 4.17.6*</p> <p>CSAS 1115B.8</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$500	\$500
2184	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB03REF</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		REF		

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2185	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	3	JOB	\$120	\$360
2186	<p>• <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.</p> <p>• <i>As-is Measurement:</i> 25 lbs/ 3 sec.</p> <p>• <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory.</p>	<p>PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$600	\$600
2187	<p>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4.5"</p> <p>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</p>	<p>PCODE WG02BNT ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$150	\$150
2188	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$100	\$100
2189	<p>• <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor.</p> <p>• <i>As-is Measurement:</i> 48"</p> <p>• <i>Proposed Solution:</i> Relocate or provide new accessible mirror.</p>	<p>PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4959	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$150	\$150
11 Practice rooms						
2190	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	12	JOB	\$250	\$3,000
2191	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	12	JOB	\$90	\$1,080
2192	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible service location not designated with appropriate sign. • <i>Proposed Solution:</i> Provide signage designating accessible practice room. 	PCODE SA17NT ADAAG 35.163(a) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$110	\$110
12 W. Lefort Recital Hall (# 72)						
2193	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2194	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$250	\$500
2195	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$90	\$180
2196	<p>• <i>As-Built Description:</i> Proper amount of seating for disabled persons at public seating is not provided (>25=1; >50=2; >300=4; >500=6; +500=6=1%).</p> <p>• <i>Proposed Solution:</i> Modify seating to provide clear and level wheelchair space 33" x 48" or 33" x 60", including companion seat, as required.</p>	<p>PCODE GE01</p> <p>ADAAG 4.1.2(19)a</p> <p>CSAS 1104B.3.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	EA	\$600	\$1,200
2197	<p>• <i>As-Built Description:</i> No permanently installed assistive listening system provided for smaller assembly area (accommodating 50 to 200 persons).</p> <p>• <i>Proposed Solution:</i> Provide permanent assistive listening system (FM type), including sign at entrance indicating availability to the public, for smaller assembly area.</p>	<p>PCODE GI01A</p> <p>ADAAG 4.1.3 (19) (b)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$1,700	\$1,700
2198	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area.</p>	<p>PCODE H02B</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	60	LF	\$14	\$840

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
13 Ramp between recital halls						
2199	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:20 (5.0%) with no handrails. • <i>Proposed Solution:</i> Provide handrails for ramp. 	PCODE IJ02 ADAAG 4.8.1* CSAS 3307 (e.1) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	30	LF	\$90	\$2,700
4960	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%) . • <i>As-is Measurement:</i> 8.6%-10.9% • <i>Proposed Solution:</i> Modify ramp slope. Demolish existing ramp and replace with new ramp. 	PCODE IJ03 ADAAG 4.8.2 CSAS 3307 (c.1) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	30	LF	\$35	\$1,050
14 J. Myers rehearsal hall (# 75)						
2200	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$90	\$90
2201	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cabinet or storage door / drawer does not have accessible hardware. • <i>Proposed Solution:</i> Provide accessible pull / latch (touch latches or U-pulls). 	PCODE ID07A ADAAG 4.25.4 CSAS 1125B.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$100	\$200
2202	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$90	\$180

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2203	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only). • <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area. 	PCODE II02B CSAS 1133B.4.4 <i>Year Mitigated</i> 2011-2012 <i>DSA App. #</i> 01-110237 <i>Funding</i> Bond Program <i>Mitigation Note</i> Modernization of Fine Arts Building into Performing Arts Building	200	LF	\$14	\$2,800
15 Hallway adjacent to practice rooms						
2204	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • <i>As-is Measurement:</i> 7" protrusion @ 37" height • <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface. 	PCODE EG04 ADAAG 4.4.1 CSAS 1121B.1 <i>Year Mitigated</i> 2011-2012 <i>DSA App. #</i> 01-110237 <i>Funding</i> Bond Program <i>Mitigation Note</i> Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$100	\$100
4961	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lockers do not have accessible operating hardware. • <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching or twisting. 	PCODE GG02NT - CSAS 3103(a)2D(5) <i>Year Mitigated</i> 2011-2012 <i>DSA App. #</i> 01-110237 <i>Funding</i> Bond Program <i>Mitigation Note</i> Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$450	\$450
16 Sculpture classroom (# 51)						
2205	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 <i>Year Mitigated</i> 2011-2012 <i>DSA App. #</i> 01-110237 <i>Funding</i> Bond Program <i>Mitigation Note</i> Modernization of Fine Arts Building into Performing Arts Building	2	JOB	\$90	\$180
2206	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 <i>Year Mitigated</i> 2011-2012 <i>DSA App. #</i> 01-110237 <i>Funding</i> Bond Program <i>Mitigation Note</i> Modernization of Fine Arts Building into Performing Arts Building	2	JOB	\$50	\$100

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2207	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 28" • <i>Proposed Solution:</i> Provide sign directing persons to accessible entrance. 	PCODE ID08NT ADAAG 4.13.4 CSAS 1133B.2.3.1 <i>Year Mitigated</i> 2011-2012 <i>DSA App. #</i> 01-110237 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$100	\$100
2208	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 <i>Year Mitigated</i> 2011-2012 <i>DSA App. #</i> 01-110237 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$250	\$500
Total Costs for Area/Floor: Lower Level					\$86,625.00	

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Lobby/ art gallery						
1938	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	2	JOB	\$90	\$180
2 Elevator						
1939	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door reopening device does not remain effective for at least 20 seconds. • <i>Proposed Solution:</i> Adjust timing. 	PCODE IK14 ADAAG 4.10.6 CSAS 3003.4.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$50	\$50
1940	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Neither audible signal nor visual wall lantern provided. • <i>Proposed Solution:</i> "Provide audible signal, and wall lantern device." 	PCODE IK10C ADAAG 4.10.4 CSAS 5103 (d.1) 9 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$2,510	\$2,510
4962	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Floor numbers not provided at all elevator entrances with both raised characters 2" high and Braille numbers, on each entrance jamb." • <i>Proposed Solution:</i> Provide compliant floor numbering on elevator door jambs. 	PCODE IK11 ADAAG 4.10.5* CSAS 5103 (d.1) 10. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	SET	\$50	\$50
3 Ticket Booth						
1941	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 26" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4	Theater					
1942	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	6	JOB	\$90	\$540
1943	<p>• <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.</p> <p>• <i>Proposed Solution:</i> Provide new, unequal width door leafs in existing frame for pair of doors.</p>	<p>PCODE ID08A</p> <p>ADAAG 4.13.4</p> <p>CSAS 1133B.2.3.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$1,500	\$3,000
1944	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	4	JOB	\$250	\$1,000
1945	<p>• <i>As-Built Description:</i> Stage, enclosed and unenclosed platform, backstage areas or orchestra pit not accessible.</p> <p>• <i>Proposed Solution:</i> Chair lift to raised platform.</p>	<p>PCODE GC01A</p> <p>ADAAG 4.33.5</p> <p>CSAS 1104B.3.10</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$25,000	\$25,000
1946	<p>• <i>As-Built Description:</i> Proper amount of seating for disabled persons at public seating is not provided (>25=1; >50=2; >300=4; >500=6; +500=6=1%).</p> <p>• <i>Proposed Solution:</i> Modify seating to provide clear and level wheelchair space 33" x 48" or 33" x 60", including companion seat, as required.</p>	<p>PCODE GE01</p> <p>ADAAG 4.1.2(19)a</p> <p>CSAS 1104B.3.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	EA	\$600	\$600

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1947	<p>• <i>As-Built Description:</i> Less than one percent of total seating are aisle seats with removable armrest (at aisle side) that are identified by a sign.</p> <p>• <i>Proposed Solution:</i> Provide aisle seats with no or removable armrest and post availability at ticket office.</p>	<p>PCODE GE01A</p> <p>ADAAG 4.1.2(19)a</p> <p>CSAS 1104B.3.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	EA	\$350	\$350
1948	<p>• <i>As-Built Description:</i> At least one fixed companion seat next to each wheelchair seating area is not provided.</p> <p>• <i>Proposed Solution:</i> Provide one companion seat next to each accessible wheelchair space(s).</p>	<p>PCODE GE01B</p> <p>ADAAG 4.33.3</p> <p>CSAS 1104B.3.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	EA	\$350	\$350
1949	<p>• <i>As-Built Description:</i> CA only: Less than one percent of total seats have at least 24" clear leg space between the front of the seat and any obstruction to accommodate semi-ambulant individuals.</p> <p>• <i>Proposed Solution:</i> Relocate seats to provide 24" clear leg room for semi-ambulant individuals.</p>	<p>PCODE GE01D</p> <p>CSAS 1104B.3.8</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	EA	\$350	\$350
1950	<p>• <i>As-Built Description:</i> No permanently installed assistive listening system provided for larger assembly area (accommodating 200 or more persons).</p> <p>• <i>Proposed Solution:</i> Provide permanent assistive listening system (FM type), including sign at entrance indicating availability to the public, for larger assembly area.</p>	<p>PCODE GI01B</p> <p>ADAAG 4.1.3 (19) (b)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$4,700	\$4,700
1951	<p>• <i>As-Built Description:</i> No signs at the building or assembly area entrance to notify patrons that an assistive listening system is available.</p> <p>• <i>Proposed Solution:</i> Provide assistive listening signage.</p>	<p>PCODE GI02REF</p> <p>ADAAG 4.1.3 (19) (b)</p> <p>CSAS 1104B.2.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1952	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "An adequate number of receivers (4% of seating capacity, min. 2) is not available to patrons in theaters with more than 50 seats." • <i>Proposed Solution:</i> Provide additional receiving devices. 	PCODE GI03REF ADAAG 4.1.3(19)(b*) CSAS 3103(a)2G(1) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>		REF		
1953	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only). • <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area. 	PCODE II02B CSAS 1133B.4.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	272	LF	\$14	\$3,808
5 Drinking fountain						
1954	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Where more than one drinking fountain is provided per floor, less than 50% comply with ADAAG 4.15. • <i>Proposed Solution:</i> Provide accessible fountain or remodel existing to compliance. 	PCODE IA01B ADAAG 4.1.3.(10)(b) CSAS 1117B.1.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$2,000	\$4,000
1955	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). • <i>As-is Measurement:</i> 18"high • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02REF ADAAG 4.15.5(1) CSAS 1507.3.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>		REF		
1956	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition. • <i>As-is Measurement:</i> 41" high • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>		REF		

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1957	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	4	JOB	\$1,900	\$7,600

6 Public Telephone

1958	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Interior public text telephone (T.D.D.) not provided at type of facility required to have a public text telephone. • <i>Proposed Solution:</i> Provide text telephone. 	PCODE IB10 ADAAG 4.1.3(17)(c) CSAS 3105A(d)2I Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$1,150	\$1,150
1959	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Telephone mounting height greater than 48" to highest operable part (only front reach available). • <i>As-is Measurement:</i> 52.5" • <i>Proposed Solution:</i> Relocate telephone to within 48" reach. 	PCODE IB09 ADAAG 4.31.3 CSAS 1118B.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$250	\$250
1960	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Signs directing persons to the location of public text telephones not provided where required. • <i>Proposed Solution:</i> Provide compliant directional signage. 	PCODE IB12 ADAAG 4.30.7(3) CSAS 3105A(d)2I(iii) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$150	\$150

7 Men's Restrooms

1961	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$100	\$100
------	---	---	---	-----	-------	--------------

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1962	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
1963	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 48" from face of door</p> <p>• <i>Proposed Solution:</i> Change door swing.</p>	<p>PCODE ID27</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$500	\$500
1964	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$50	\$50
1965	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 8"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$2,000	\$2,000
1966	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE WB07</p> <p>ADAAG 4.17.6*</p> <p>CSAS 1115B.8</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1967	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4.5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B</p> <p>ADAAG Fig. 28</p> <p>CSAS DSA/AC # 99-07</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$150	\$150
1968	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06REF</p> <p>ADAAG 4.17.3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		REF		
1969	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 29" in front of wc</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB03REF</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		REF		
1970	<p>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</p> <p>• <i>As-is Measurement:</i> 23"</p> <p>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</p>	<p>PCODE WB05REF</p> <p>ADAAG 4.17.5</p> <p>CSAS 1115B.7.1.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		REF		
1971	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C</p> <p>ADAAG 4.17.5</p> <p>CSAS 1115B.7.1.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1972	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side. • <i>As-is Measurement:</i> 48" from face of door • <i>Proposed Solution:</i> Change door swing. 	PCODE WC03REF CSAS Fig.No.31-1B Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building		REF		
1973	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	3	JOB	\$120	\$360
1974	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 25 lbs/3 secs • <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory. 	PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$600	\$600
1975	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 55" A.F.F. • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$100	\$100
1976	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 55" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1977	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02 ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$2,400	\$2,400
1978	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall. • <i>As-is Measurement:</i> 10" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01REF CSAS 1503.2.1 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>		REF		
1979	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 51" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$500	\$500
8 Women's restrooms						
1980	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 49" S.D: 48" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$100	\$200
1981	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 49" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1982	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> T.P.D: 4.5" F.N.D: 4"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B</p> <p>ADAAG Fig. 28</p> <p>CSAS DSA/AC # 99-07</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$150	\$300
1983	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 6"</p> <p>• <i>Proposed Solution:</i> Remove intermediary door.</p>	<p>PCODE ID24NT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$500	\$500
1984	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$100	\$100
1985	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
1986	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 48" fr face of door</p> <p>• <i>Proposed Solution:</i> Change door swing.</p>	<p>PCODE ID27</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1987	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$50	\$50
1988	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 8"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$2,000	\$2,000
1989	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE WB07</p> <p>ADAAG 4.17.6*</p> <p>CSAS 1115B.8</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$500	\$500
1990	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06REF</p> <p>ADAAG 4.17.3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>		REF		
1991	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 29" in front of wc</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB03REF</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1992	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 23" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>		REF		
1993	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock). • <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides. 	PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$100	\$100
1994	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side. • <i>As-is Measurement:</i> 48" fr. face of door • <i>Proposed Solution:</i> Change door swing. 	PCODE WC03REF CSAS Fig.No.31-1B Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>		REF		
1995	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	3	JOB	\$120	\$360
1996	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 25 lbs/3 secs • <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory. 	PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$600	\$600

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
9	Room # 177					
1997	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
1998	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$250	\$500
1999	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$50	\$100
2000	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 6"</p> <p>• <i>Proposed Solution:</i> Remove closer or latch at vestibule door.</p>	<p>PCODE ID24ANT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$50	\$100
4964	<p>• <i>As-Built Description:</i> "12" clear width from strike side of door not provided in vestibule with door swinging out and with both latch & closer."</p> <p>• <i>Proposed Solution:</i> Remodel vestibule area.</p>	<p>PCODE IF04REF</p> <p>"4.13.7, 4.13.6"</p> <p>CSAS 3304 (i.1) 2D</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
10 Room # 178						
2001	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
2002	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$250	\$500
2003	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$50	\$100
2004	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 6"</p> <p>• <i>Proposed Solution:</i> Remove closer or latch at vestibule door.</p>	<p>PCODE ID24ANT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$50	\$100
4965	<p>• <i>As-Built Description:</i> "12" clear width from strike side of door not provided in vestibule with door swinging out and with both latch & closer."</p> <p>• <i>Proposed Solution:</i> Remodel vestibule area.</p>	<p>PCODE IF04REF</p> <p>"4.13.7, 4.13.6"</p> <p>CSAS 3304 (i.1) 2D</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
11	Music Library (# 179)					
2005	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
2006	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$250	\$250
2007	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$50	\$100
2008	<p>• <i>As-Built Description:</i> Open stacks (i.e. public use) do not have min 36" (44" preferred) wide aisles (CA only: 44" min. width at main aisles and 36" min. at end aisles).</p> <p>• <i>Proposed Solution:</i> Provide attendant when needed.</p>	<p>PCODE BB01A</p> <p>ADAAG 8.5</p> <p>CSAS 1106B.4.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$0	\$0
2009	<p>• <i>As-Built Description:</i> Information desk or circulation counter or section not 36" max. high and min. 36" wide (CA only: top 28" to 34" high, min. 36" counter length).</p> <p>• <i>As-is Measurement:</i> 40" height</p> <p>• <i>Proposed Solution:</i> Provide new accessible desk/counter section when remodeling area. Relocate or modify electrical outlets and equipment as needed. Interim: provide equivalent facilitation.</p>	<p>PCODE BE02</p> <p>ADAAG 8.3</p> <p>CSAS 1122B.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$4,000	\$4,000

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2010	<p>• <i>As-Built Description:</i> Accessible section or desk not provided for use of computer to browse library catalogue.</p> <p>• <i>Proposed Solution:</i> Provide desk with accessible dimensions when purchasing new furniture.</p>	<p>PCODE BE01ANT ADAAG 8.4 CSAS 1106B.4.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$1,600	\$1,600
12 Staff private offices (#s184-186)						
2011	<p>• <i>As-Built Description:</i> "Vestibule length in direction of travel less than width(es) of door(s) swinging into vestibule, plus 48""."</p> <p>• <i>Proposed Solution:</i> "At vestibule with standard single-leaf doors, remodel area to provide required length."</p>	<p>PCODE IF02BREF ADAAG 4.13.7 CSAS 3304 (i.1) 2D. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		REF		
2012	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	2	JOB	\$250	\$500
2013	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	2	JOB	\$50	\$100
2014	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>Proposed Solution:</i> Remove intermediary door.</p>	<p>PCODE ID23NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2015	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$90	\$90
13 Piano C.R. (room #188)						
2016	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1		\$90	\$90
2017	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	2	JOB	\$250	\$500
2018	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Vestibule length in direction of travel less than width(es) of door(s) swinging into vestibule, plus 48""." • <i>Proposed Solution:</i> "At vestibule with standard pairs of doors, remodel area to provide required length." 	PCODE IF02AREF ADAAG 4.13.7 CSAS 3304 (i.1) 2D. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building		REF		
2019	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>Proposed Solution:</i> Change door swing to open away from vestibule. 	PCODE ID23NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
14	Staircase at N.W. corner of Building.					
2020	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area.</p>	<p>PCODE II02B</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	30	LF	\$14	\$420
2021	<p>• <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" min. beyond top of stair.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top (cost for each extension piece).</p>	<p>PCODE ED06</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B4.2.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	3	JOB	\$170	\$510
2022	<p>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</p>	<p>PCODE ED07</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	3	JOB	\$170	\$510
2023	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 & B.5.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	30	LF	\$75	\$2,250
2024	<p>• <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route.</p> <p>• <i>Proposed Solution:</i> Provide directional sign.</p>	<p>PCODE SA20</p> <p>ADAAG 35.163(b)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	3	JOB	\$170	\$510

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4966	<p>• <i>As-Built Description:</i> In an existing building, which exceeds 100,000 sq ft. on any floor, an accessible means of vertical access is not provided within 200 ft. of each staircase.</p> <p>• <i>Proposed Solution:</i> Provide new elevator with two stops.</p>	<p>PCODE IK01NT ADAAG 4 CSAS 5103 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	?	\$200,000
15 Staircase at N.E. corner of Building.						
2025	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area.</p>	<p>PCODE II02B CSAS 1133B.4.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	30	LF	\$14	\$420
2026	<p>• <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" min. beyond top of stair.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top (cost for each extension piece).</p>	<p>PCODE ED06 ADAAG 4.9.4(2) CSAS 1133B4.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	3	JOB	\$170	\$510
2027	<p>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</p>	<p>PCODE ED07 ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	3	JOB	\$170	\$510
2028	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	30	LF	\$75	\$2,250

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2029	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route. • <i>Proposed Solution:</i> Provide directional sign. 	PCODE SA20 ADAAG 35.163(b) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	3	JOB	\$170	\$510
16 Staircase at S.E. corner of Building.						
2030	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route. • <i>Proposed Solution:</i> Provide directional sign. 	PCODE SA20 ADAAG 35.163(b) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	3		\$170	\$510
4967	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only). • <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area. 	PCODE II02B CSAS 1133B.4.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	30	LF	\$14	\$420
4968	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" min. beyond top of stair. • <i>Proposed Solution:</i> Extend stair handrail at top (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) CSAS 1133B4.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	3	JOB	\$170	\$510
4969	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser. • <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece). 	PCODE ED07 ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	3	JOB	\$170	\$510

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4970	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 & B.5.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	30	LF	\$75	\$2,250
17 Staircase at S.W. corner of Building.						
2031	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area.</p>	<p>PCODE II02B</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	30	LF	\$14	\$420
2032	<p>• <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" min. beyond top of stair.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top (cost for each extension piece).</p>	<p>PCODE ED06</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B4.2.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	3	JOB	\$170	\$510
2033	<p>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</p>	<p>PCODE ED07</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	3	JOB	\$170	\$510
2034	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 & B.5.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	30	LF	\$75	\$2,250

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2035	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route. • <i>Proposed Solution:</i> Provide directional sign. 	PCODE SA20 ADAAG 35.163(b) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	3	JOB	\$170	\$510
18 Department of theater arts						
2036	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 41" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$150	\$150
2037	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$90	\$90
2038	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	2	JOB	\$250	\$500
2039	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
19 Rooms #134-136						
2040	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$90	\$180
2041	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$50	\$100
2042	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 4.5"</p> <p>• <i>Proposed Solution:</i> Change door swing.</p>	<p>PCODE ID23</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	2	JOB	\$500	\$1,000
2043	<p>• <i>As-Built Description:</i> At room with 4-25 fixed seats, fewer than required number of wheelchair seating spaces provided; 1 space required.</p> <p>• <i>Proposed Solution:</i> Provide 33" x 60" wheelchair space and work surface.</p>	<p>PCODE CB02A</p> <p>ADAAG 4.1.3(19)a</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$760	\$760
2044	<p>• <i>As-Built Description:</i> Access to raised areas and platforms not provided.</p> <p>• <i>Proposed Solution:</i> Provide ramp and handrails.</p>	<p>PCODE CD02A</p> <p>ADAAG 4.5.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	15	LF	\$130	\$1,950

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
20 Room #137						
2045	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$90	\$90
2046	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$250	\$250
21 Room #138						
2047	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1		\$250	\$250
2048	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$90	\$90
2049	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 42" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2050	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 6" • <i>Proposed Solution:</i> Change door swing. 	PCODE ID23 ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$500	\$500
22 Room #142						
2051	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$90	\$90
2052	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$250	\$500
23 Hallway on southside of theater						
2053	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • <i>As-is Measurement:</i> 7" protrusion @ 37" height • <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface. 	PCODE EG04 ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$100	\$100
24 Art Dept. office (#102)						
2054	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2055	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$250	\$250
2056	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 41" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$150	\$150
25 Staff meeting (room #103)						
2057	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$50	\$50
2058	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$90	\$90
2059	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2060	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>Proposed Solution:</i> Remove closer if latch is required.</p>	<p>PCODE ID24ANT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$50	\$50
26 Lecture Hall (#120)						
2061	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
2062	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$250	\$250
2063	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$75	\$75
2064	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2065	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
2066	<p>• <i>As-Built Description:</i> Access to raised areas and platforms not provided.</p> <p>• <i>Proposed Solution:</i> Provide ramp and handrails.</p>	<p>PCODE CD02A</p> <p>ADAAG 4.5.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	12	LF	\$130	\$1,560
2067	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 7 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$50	\$50
27 Drinking fountain						
2068	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."Relocate drinking fountain, if required.</p>	<p>PCODE IA05CNT</p> <p>ADAAG 4.4.1</p> <p>CSAS Fig. 11B-3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$1,900	\$1,900
2069	<p>• <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.</p> <p>• <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.</p>	<p>PCODE IA04REF</p> <p>CSAS 1117B.1.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
28	Men's restrooms (# 122)					
2070	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$50	\$50
2071	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign mounted 5' high on center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing).</p>	<p>PCODE SA11AREF</p> <p>ADAAG 4.1.2(7)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		REF		
2072	<p>• <i>As-Built Description:</i> Otherwise compliant sign identifying permanent room or space not mounted 5' high to center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing).</p> <p>• <i>Proposed Solution:</i> Relocate existing sign.</p>	<p>PCODE SA07</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$50	\$50
2073	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2074	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 24"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB03NT</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$1,500	\$1,500
2075	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE WB07</p> <p>ADAAG 4.17.6*</p> <p>CSAS 1115B.8</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$500	\$500
2076	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B</p> <p>ADAAG Fig. 28</p> <p>CSAS DSA/AC # 99-07</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$150	\$150
2077	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C</p> <p>ADAAG 4.17.5</p> <p>CSAS 1115B.7.1.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$100	\$100
2078	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> S.C.D: 44" A.F.F.</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE WG01A</p> <p>ADAAG 28 CFR 35.133(a)</p> <p>CSAS 1115B.9.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2079	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	2	JOB	\$120	\$240
2080	<p>• <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.</p> <p>• <i>As-is Measurement:</i> 28 lbs/2sec.</p> <p>• <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory.</p>	<p>PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$600	\$600
2081	<p>• <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor.</p> <p>• <i>As-is Measurement:</i> 23"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE WE02 ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$2,400	\$2,400
2082	<p>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>As-is Measurement:</i> 55"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</p>	<p>PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$500	\$500
29 Women's restrooms (# 124)						
2083	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15 CSAS 1115B.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2084	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
2085	<p>• <i>As-Built Description:</i> No sign at non-accessible room or space directing persons to an accessible that provides the same or equivalent service.</p> <p>• <i>Proposed Solution:</i> Provide directional sign.</p>	<p>PCODE SA19</p> <p>ADAAG 35.163(b); 4.1.6(3)(e)(iii)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
30 Staircase adjacent to room #120						
2086	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area.</p>	<p>PCODE II02B</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	44	LF	\$14	\$616
2087	<p>• <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" min. beyond top of stair.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top (cost for each extension piece).</p>	<p>PCODE ED06</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B4.2.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	3	JOB	\$170	\$510
2088	<p>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</p>	<p>PCODE ED07</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	5	JOB	\$170	\$850

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2089	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-is Measurement:</i> 31" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	52	LF	\$75	\$3,900
2090	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route. • <i>Proposed Solution:</i> Provide directional sign. 	PCODE SA20 ADAAG 35.163(b) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	3	JOB	\$170	\$510
2091	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$250	\$250
31 Staircase adjacent to room #151						
2092	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only). • <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area. 	PCODE H02B CSAS 1133B.4.4 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	44	LF	\$14	\$616
2093	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" min. beyond top of stair. • <i>Proposed Solution:</i> Extend stair handrail at top (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) CSAS 1133B4.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	3	JOB	\$170	\$510

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2094	<p>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</p>	<p>PCODE ED07</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	5	JOB	\$170	\$850
2095	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 & B.5.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	52	LF	\$75	\$3,900
2096	<p>• <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route.</p> <p>• <i>Proposed Solution:</i> Provide directional sign.</p>	<p>PCODE SA20</p> <p>ADAAG 35.163(b)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	3	JOB	\$170	\$510
2097	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$250	\$250
32 Drinking fountain						
2098	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE IA05C</p> <p>ADAAG 4.4.1</p> <p>CSAS Fig. 11B-3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$1,900	\$1,900

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2099	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship. • <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls. 	PCODE IA04REF CSAS 1117B.1.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building		REF		
33 Women's restrooms (#157)						
2100	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Existing geometric symbol on door leaf sign has braille and raised text. • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15NT CSAS 1115B.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$100	\$100
2101	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$50	\$50
2102	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60"). • <i>As-is Measurement:</i> 45" • <i>Proposed Solution:</i> Remove intermediary door. 	PCODE ID27NT ADAAG Fig. 25(c) CSAS 11B-26A(c) Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$500	\$500
2103	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 25" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB03NT ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$1,500	\$1,500

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2104	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8</p> <p>Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$500	\$500
2105	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07</p> <p>Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$150	\$150
2106	<p>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4.5"</p> <p>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</p>	<p>PCODE WG02BNT ADAAG Fig. 28 CSAS DSA/AC # 99-07</p> <p>Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$150	\$150
2107	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4</p> <p>Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$100	\$100
2108	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> S.C.D located 18" over grab bar</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2</p> <p>Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2109	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	2	JOB	\$120	\$240
2110	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 25 lbs/2sec • <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory. 	PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$600	\$600
34 Design studio (# 153)						
2111	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$90	\$90
2112	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$250	\$250
2113	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2114	<p>• <i>As-Built Description:</i> "Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."</p> <p>• <i>Proposed Solution:</i> Provide accessible studio or shop fixed work station.</p>	<p>PCODE LB02 ADAAG 4.1.3(18) CSAS 3103A(d)2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$4,500	\$4,500
2115	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$75	\$75
35 Design studio (# 151)						
2116	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
2117	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$250	\$250
2118	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2119	<p>• <i>As-Built Description:</i> "Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."</p> <p>• <i>Proposed Solution:</i> Provide accessible studio or shop fixed work station.</p>	<p>PCODE LB02</p> <p>ADAAG 4.1.3(18)</p> <p>CSAS 3103A(d)2</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$4,500	\$4,500
2120	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$75	\$75
36 Women's restrooms (# 160)						
2121	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$100	\$100
2122	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90
2123	<p>• <i>As-Built Description:</i> No sign at non-accessible room or space directing persons to an accessible that provides the same or equivalent service.</p> <p>• <i>Proposed Solution:</i> Provide directional sign.</p>	<p>PCODE SA19</p> <p>ADAAG 35.163(b); 4.1.6(3)(e)(iii)</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding Bond Program</p> <p>Mitigation Note Modernization of Fine Arts Building into Performing Arts Building</p>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4971	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	<ul style="list-style-type: none"> PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building 	1	JOB	\$90	\$90
Total Costs for		Area/Floor: Upper level	\$345,855.00			

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Roof level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Elevator						
2124	<p>• <i>As-Built Description:</i> Neither audible signal nor visual wall lantern provided.</p> <p>• <i>Proposed Solution:</i> "Provide audible signal, and wall lantern device."</p>	<p>PCODE IK10C ADAAG 4.10.4 CSAS 5103 (d.1) 9 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$2,510	\$2,510
4972	<p>• <i>As-Built Description:</i> "Floor numbers not provided at all elevator entrances with both raised characters 2" high and Braille numbers, on each entrance jamb."</p> <p>• <i>Proposed Solution:</i> Provide compliant floor numbering on elevator door jambs.</p>	<p>PCODE IK11 ADAAG 4.10.5* CSAS 5103 (d.1) 10. Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	SET	\$50	\$50
2 Studio # 201						
2125	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$90	\$90
2126	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$250	\$250
2127	<p>• <i>As-Built Description:</i> "Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."</p> <p>• <i>Proposed Solution:</i> Provide accessible studio or shop fixed work station.</p>	<p>PCODE LB02 ADAAG 4.1.3(18) CSAS 3103A(d)2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding <i>Bond Program</i> Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$4,500	\$4,500

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Roof level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2128	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$50	\$50
3 Studio # 202						
2129	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$90	\$90
2130	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$250	\$250
2131	<p>• <i>As-Built Description:</i> "Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."</p> <p>• <i>Proposed Solution:</i> Provide accessible studio or shop fixed work station.</p>	<p>PCODE LB02 ADAAG 4.1.3(18) CSAS 3103A(d)2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$4,500	\$4,500
2132	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Roof level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4	Drinking fountain					
2133	<p>• <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain it is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping.</p> <p>• <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain.</p>	<p>PCODE IA01A</p> <p>ADAAG 4.1.3.(10)(a)</p> <p>CSAS 1117B.1.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$2,000	\$2,000
2134	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE IA05C</p> <p>ADAAG 4.4.1</p> <p>CSAS Fig. 11B-3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>	1	JOB	\$1,900	\$1,900
2135	<p>• <i>As-Built Description:</i> Fountain bubbler not easily activated by lever, push bar, or other accessible control.</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA03REF</p> <p>ADAAG 4.27.4</p> <p>CSAS 1507.3.3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		REF		
2136	<p>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</p> <p>• <i>As-is Measurement:</i> 37.5"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA03BREF</p> <p>ADAAG 4.15.2</p> <p>CSAS 1507.3.3</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		REF		
2137	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</p> <p>• <i>As-is Measurement:</i> 25" high</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02REF</p> <p>ADAAG 4.15.5(1)</p> <p>CSAS 1507.3.1</p> <p>Year Mitigated 2011-2012</p> <p>DSA App. # 01-110237</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Modernization of Fine Arts Building into Performing Arts Building</i></p>		REF		

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Roof level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
5 Digital arts (# 225)						
2138	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$90	\$90
2139	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$250	\$250
2140	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$50	\$50
6 Painting studio (# 226)						
2141	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$90	\$90
2142	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2011-2012 DSA App. # 01-110237 Funding Bond Program Mitigation Note Modernization of Fine Arts Building into Performing Arts Building	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Roof level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2143	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	<ul style="list-style-type: none"> <i>PCODE</i> ID03 <i>ADAAG</i> 4.13.10 & 11 <i>CSAS</i> 1133B.2.5 <i>Year Mitigated</i> 2011-2012 <i>DSA App. #</i> 01-110237 <i>Funding</i> Bond Program <i>Mitigation Note</i> Modernization of Fine Arts Building into Performing Arts Building 	1	JOB	\$50	\$50
Total Costs for		Area/Floor: Roof level	\$17,020.00			

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Roof level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Fine Arts Building				\$449,500.00	

Campus: **Kentfield Campus** Building/Part: **Fine Arts Building** Area/Floor: **Roof level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Grand Total for		Campus: Kentfield Campus			\$449,500.00	

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Main entrance vestibule						
2706	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
2707	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs, 12 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	4	JOB	\$50	\$200
4981	<p>• <i>As-Built Description:</i> "Vestibule length in direction of travel less than width(es) of door(s) swinging into vestibule, plus 48""."</p> <p>• <i>As-is Measurement:</i> 40"</p> <p>• <i>Proposed Solution:</i> "Install automatic, delayed-closing door operators on existing vestibule doors."</p>	<p>PCODE 1F02D</p> <p>ADAAG 4.13.7</p> <p>CSAS 3304 (i.1) 2D.</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	50	SF	\$4,000	\$200,000
2 Switch board cabin (#139)						
2708	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 28"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$2,600	\$2,600
2709	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07REF</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2710	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 40" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$150	\$150
3 Office counter (#101)						
2711	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide). • <i>As-is Measurement:</i> 40" • <i>Proposed Solution:</i> Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table. 	PCODE IN03A ADAAG 4.32.3 & 4 CSAS 1122B.3 & 4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$1,200	\$1,200
2712	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 27-5", 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$2,600	\$5,200
2713	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07REF ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	REF		
2714	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Special Transactions Counter, minimum length of 36"', is not between 28"' and 34"' high." • <i>As-is Measurement:</i> 50" • <i>Proposed Solution:</i> Implement policy to conduct special transactions for disabled customers at a nearby accessible station. 	PCODE AB03C ADAAG 7.2(2) CSAS 3105A.(1)3 & Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1			

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2715	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 12 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$50	\$50
4 Spiral stairs						
2716	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only). • <i>Proposed Solution:</i> Provide new guardrail, including handrail at ramp. 	PCODE ED08 CSAS CBC 509 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	16	LF	\$120	\$1,920
2717	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06B ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$300	\$300
2718	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Elevator not provided in multistory building. • <i>Proposed Solution:</i> Provide new elevator with two stops. 	PCODE IK01 ADAAG 4 CSAS 5103 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	?	\$200,000
5 Storage room (#102)						
2719	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2720	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
2721	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide. • <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$1,850	\$1,850
2722	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep. • <i>As-is Measurement:</i> 8" • <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
6 Private offices (#105-112)						
2723	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	8	JOB	\$250	\$2,000
2724	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	8	JOB	\$90	\$720

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2725	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$250	\$500
2726	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$75	\$75
2727	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$375	\$750
7 Electrical room (#103)						
2728	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2729	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
8 Custodian room (#104)						
2730	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$250	\$250
2731	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$90	\$90
9 Private offices (#114-121)						
2732	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	8	JOB	\$250	\$2,000
2733	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	8	JOB	\$90	\$720
2734	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	2	JOB	\$250	\$500

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
10 Exit door adjacent to staircase (#136)						
2735	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2736	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 13 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$50	\$100
11 Staircase (#136)						
2737	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06B ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$300	\$300
2738	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2739	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
12 Storage room (#130)						
2740	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$250	\$250
2741	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$90	\$90
13 Room (#142)						
2742	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$90	\$90
2743	<p>• <i>As-Built Description:</i> Floor-mounted closer (internal). Excessive force required to open door and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 14 lbs</p> <p>• <i>Proposed Solution:</i> Disable floor-mounted closing mechanism and install new, door-mounted closer.</p>	<p>PCODE ID03B ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$450	\$450
2744	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$75	\$75

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
14 Exit door adjacent to classroom #129						
2745	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.13 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2746	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$50	\$50
15 Classroom #129						
2747	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
2748	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
16 Classroom #128						
2749	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1		\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2750	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
17 Classroom #127						
2751	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
2752	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
18 Drinking fountain						
2753	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in good condition. • <i>As-is Measurement:</i> 39" • <i>Proposed Solution:</i> Remount fountain at accessible height. 	PCODE IA03C ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$1,200	\$1,200
19 Communications room (#125)						
2754	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2755	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90

20 Film Laboratory (#122)

2756	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
------	--	--	---	-----	-------	-------

2757	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
------	--	---	---	-----	------	------

21 Classroom (#126)

2758	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1		\$90	\$90
------	--	---	---	--	------	------

2759	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
------	--	--	---	-----	-------	-------

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
22 Communication classroom (#124)						
2760	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2761	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
23 E.S.L. classroom (#123)						
2762	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2763	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
24 Exit door from east corridor to inner courtyard						
2764	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Repair or replace existing automatic door operator. 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$1,500	\$1,500

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2765	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
25 Dental Operation Theater (#150)						
2766	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$2,600	\$2,600
2767	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2768	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	4	JOB	\$250	\$1,000
26 Supply room (#157)						
2769	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2770	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
27 Dental Lab						
2771	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	3	JOB	\$250	\$750
2772	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$2,600	\$2,600
2773	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
28 Locker room						
2774	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Adequate wheelchair space between lockers and benches not provided (44" width needed)." • <i>Proposed Solution:</i> Remove and relocate bench and patch floor to provide adequate wheelchair space between locker and bench. 	PCODE GG01 - CSAS 3103(a)2D(5) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2775	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Lockers not at proper height for disabled persons (maximum height 54" to hooks, shelves, etc.)." • <i>Proposed Solution:</i> Provide accessible locker at an accessible location for wheelchair users. 	PCODE GG02NT - CSAS 3103(a)2D(5) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$450	\$450
2776	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$50	\$50
2777	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2778	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
29 Dental assisting office						
2779	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$250	\$500

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2780	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
2781	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	2	JOB	\$90	\$180
2782	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 29"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$2,600	\$2,600
30 Men's restrooms (#175)						
2783	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$100	\$100
2784	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2785	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 13 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	2	JOB	\$50	\$100
2786	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID23B</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$2,600	\$2,600
2787	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>Proposed Solution:</i> Remove inner vestibule door.</p>	<p>PCODE ID23NT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$500	\$500
2788	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 12"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$2,000	\$2,000
2789	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 35"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06REF</p> <p>ADAAG 4.17.3</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>		REF		

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2790	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 28" • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 <i>Year Mitigated</i> 2013-2014 DSA App. # 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>				REF
2791	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 <i>Year Mitigated</i> 2013-2014 DSA App. # 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>				REF
2792	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type. 	PCODE WB10 ADAAG 4.16.5 & 4.27.4 CSAS 1502.0 <i>Year Mitigated</i> 2013-2014 DSA App. # 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$500	\$500
2793	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 <i>Year Mitigated</i> 2013-2014 DSA App. # 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$150	\$150
2794	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 <i>Year Mitigated</i> 2013-2014 DSA App. # 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2795	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock). • <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides. 	PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$100	\$100
2796	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	6	JOB	\$120	\$720
2797	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	54	JOB	\$150	\$8,100
2798	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 46" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$100	\$100
2799	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 25 lbs/1 sec • <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory. 	PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$600	\$600

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2800	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 CSAS 1503.2.1 C.P.C. Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$4,000	\$4,000
2801	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center		REF		
2802	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 53" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$500	\$500
2803	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • <i>As-is Measurement:</i> 12 protrusion at 30" A.F.F. • <i>Proposed Solution:</i> Provide cane-detectable railing to mark area of low clearance. 	PCODE EG04A ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	4	LF	\$100	\$400
31 Mechanical room (#177)						
2804	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2805	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$250	\$250
32 Women's restrooms (#178)						
2806	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15 CSAS 1115B.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$100	\$100
2807	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$90	\$90
2808	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 12 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	2	JOB	\$50	\$100
2809	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 9"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID23B ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2810	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID24B ADAAG Fig. 25(a) CSAS 11B-26A(a) <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> Bond Program <i>Mitigation Note</i> Demolished And Replaced With New Academic Center</p>	1	JOB	\$2,600	\$2,600
2811	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 12"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A CSAS 1115B.7.3 <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> Bond Program <i>Mitigation Note</i> Demolished And Replaced With New Academic Center</p>	1	JOB	\$2,000	\$2,000
2812	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06REF ADAAG 4.17.3 <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> Bond Program <i>Mitigation Note</i> Demolished And Replaced With New Academic Center</p>		REF		
2813	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 28"</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> Bond Program <i>Mitigation Note</i> Demolished And Replaced With New Academic Center</p>		REF		
2814	<p>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</p> <p>• <i>As-is Measurement:</i> 30"</p> <p>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</p>	<p>PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> Bond Program <i>Mitigation Note</i> Demolished And Replaced With New Academic Center</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2815	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$150	\$150
2816	<p>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4"</p> <p>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</p>	<p>PCODE WG02BNT ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$150	\$150
2817	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$500	\$500
2818	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$100	\$100
2819	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center</p>	6	JOB	\$120	\$720

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2820	<ul style="list-style-type: none"> • As-Built Description: Bottom of flat, not tilted mirror more than 40" above floor. • As-is Measurement: 54" • Proposed Solution: Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$150	\$150
2821	<ul style="list-style-type: none"> • As-Built Description: Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • As-is Measurement: P.T.D: 48" A.F.F. • Proposed Solution: Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$100	\$100
2822	<ul style="list-style-type: none"> • As-Built Description: Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • As-is Measurement: 24 lbs/ 1 sec • Proposed Solution: Replace self-closing faucet at accessible lavatory. 	PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$600	\$600
2823	<ul style="list-style-type: none"> • As-Built Description: Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • As-is Measurement: 12" protrusion at 30" high • Proposed Solution: Provide cane-detectable railing to mark area of low clearance. 	PCODE EG04A ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	4	LF	\$100	\$400
33 Exit door from west corridor to inner courtyard						
2824	<ul style="list-style-type: none"> • As-Built Description: Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • Proposed Solution: Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$50	\$100

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2825	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
34 Women's staff restrooms (#179)						
2826	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$100	\$100
2827	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
2828	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 29"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$2,600	\$2,600
2829	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07REF</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2830	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 12" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01ANT CSAS 1115B.7.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$2,000	\$2,000
2831	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$150	\$150
2832	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$500	\$500
2833	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$120	\$120
2834	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 20 lbs/1 sec • <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory. 	PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$600	\$600
2835	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 52" A.F.F. • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2836	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 49" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$150	\$150
2837	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Restroom entry/exit door swings into clear floor space, 30" X 48" in front of fixture.(CA only: less than 18" from side wall to centerline of lavatory) • <i>Proposed Solution:</i> Relocate existing lavatory. 	PCODE WD01ANT ADAAG 4.19.3 CSAS 1504.2.1 C.P.C. Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$900	\$900
35 Nursing Ed. and study (#163)						
2838	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
2839	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2840	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide door operator. 	PCODE ID23C ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$5,000	\$5,000

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2841	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
2842	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide. • <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$1,850	\$1,850
2843	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep. • <i>As-is Measurement:</i> 8" • <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
36 Supply room (#167)						
2844	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	3	JOB	\$250	\$750
2845	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2846	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
2847	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide. • <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$1,850	\$1,850
2848	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep. • <i>As-is Measurement:</i> 8" • <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
37 Custodian room (#168)						
2849	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
2850	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
38 Nursing lab (#174)						
2851	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2852	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
2853	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 9" • <i>Proposed Solution:</i> Change hinge/latch side. 	PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$500	\$500
39 Classroom #173						
2854	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2855	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
40 Classroom #172						
2856	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2857	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
2858	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$50	\$50
41 Classroom #171						
2859	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2860	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2861	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
42 Classroom #170						
2862	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
2863	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$250	\$250
43 Classroom #169						
2864	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
2865	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
44 Exit door adjacent to classroom #170						
2866	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2867	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$250	\$500
45 Drinking fountain						
2868	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). • <i>As-is Measurement:</i> 15" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02 ADAAG 4.15.5(1) CSAS 1507.3.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$1,850	\$1,850
2869	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition. • <i>As-is Measurement:</i> 43" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center		REF		
46 Classroom #166						
2870	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2871	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2872	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 7" • <i>Proposed Solution:</i> Change hinge/latch side. 	PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$500	\$500
47 Classroom #165						
2873	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
2874	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2875	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 9" • <i>Proposed Solution:</i> Provide door operator. 	PCODE ID23C ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$5,000	\$5,000

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
48 Storage/copy room #164						
2876	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2877	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
49 Classroom #161						
2878	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2879	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
2880	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 6" • <i>Proposed Solution:</i> Change latch/hinge side. 	PCODE ID23NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$500	\$500
Total Costs for Area/Floor: Lower Level					\$502,980.00	

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Private offices						
2881	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	20	JOB	\$90	\$1,800
2882	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	20	JOB	\$250	\$5,000
2 Custodian room #215						
2883	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$250	\$250
2884	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
3 Mechanical room #217						
2885	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2886	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90

4 Door to fire exit doors

2887	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
------	--	--	---	-----	-------	-------

2888	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "TO EXIT" sign at door. 	PCODE SA10E ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
------	---	---	---	-----	------	------

5 Drinking fountain

2889	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). • <i>As-is Measurement:</i> 15" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02 ADAAG 4.15.5(1) CSAS 1507.3.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$1,850	\$1,850
------	---	--	---	-----	---------	---------

2890	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition. • <i>As-is Measurement:</i> 40" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center		REF		
------	---	---	--	-----	--	--

Total Costs for**Area/Floor: Upper Level****\$9,670.00**

Campus: **Kentfield Campus** Building/Part: **Harlan Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Harlan Center				\$512,650.00	

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1	Main entrance					
3464	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$250	\$500
3465	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, wider door pair and frame with new accessible hardware. 	PCODE ID08 ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$2,400	\$2,400
3466	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$375	\$750
3467	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only). • <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area. 	PCODE II02B CSAS 1133B.4.4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	12	LF	\$14	\$168
3468	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	4	LF	\$95	\$380

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3469	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06B ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$300	\$600
4982	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp needed to provide disabled access at steps or change of level along path of travel. • <i>Proposed Solution:</i> Provide new concrete ramp with handrails [slope more than 1:20 (5.0%) needed]. 	PCODE EB01A ADAAG 4.1.1 CSAS 1127B.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	420	SF	\$100	\$42,000
2 Child Care Center (#40)						
3470	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
3471	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 24 lbs • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$375	\$375
3472	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3473	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 27" • <i>Proposed Solution:</i> Provide new, wider door pair and frame with new accessible hardware. 	PCODE ID08 ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$2,400	\$2,400
3474	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area. 	PCODE ID06 CSAS 1133B.2.6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
3 Store Rooms (#44-45)						
3475	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$250	\$500
3476	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$90	\$180
4 Restrooms (#43)						
3477	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. • <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 CSAS 1115B.7.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$23,000	\$23,000

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3478	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
5 Classrooms (#40)						
3479	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
3480	<p>• <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03A</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$375	\$375

Total Costs for**Area/Floor:** Lower Level**\$74,238.00**

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1	Human Resources Room (#124)					
3359	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$250	\$500
3360	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 7" • <i>Proposed Solution:</i> Change hinge/latch side. 	PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$500	\$500
3361	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
3362	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 13 lbs • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$375	\$375
3363	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide). • <i>As-is Measurement:</i> 42" • <i>Proposed Solution:</i> Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table. 	PCODE IN03A ADAAG 4.32.3 & 4 CSAS 1122B.3 & 4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$1,200	\$1,200

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2 Private offices (#s111-112)						
3364	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$90	\$180
3365	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$250	\$500
3366	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 3" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$50	\$100
3 Exit door adjacent to Presiden't office						
3367	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
3368	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$375	\$375

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3369	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 9.5" • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID24B ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$2,600	\$2,600
3370	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled. • <i>As-is Measurement:</i> 60" • <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$450	\$450
4 President's office (#121)						
3371	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$250	\$500
3372	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$90	\$180
5 Private office (#123)						
3373	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3374	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
6 Private room (#120)						
3375	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
3376	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
7 Private room (#119)						
3377	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
3378	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3379	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$50	\$50
8 Private room (#118)						
3380	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
3381	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
9 Room (#116)						
3382	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
3383	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3384	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$50	\$50
10 Records room (#115)						
3385	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
3386	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
11 Private room (#114)						
3387	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
3388	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
12 Private office (#109)						
3389	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1		\$250	\$250
3390	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
13 Private office (#107)						
3391	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
3392	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
3393	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 4" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
14 Private office (#106)						
3394	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
3395	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
3396	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 1" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$50	\$50
15 Private office (#105)						
3397	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
3398	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
16 Private office (#104)						
3399	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1		\$250	\$250
3400	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
3401	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 5.5" • <i>Proposed Solution:</i> Change door swing. 	PCODE ID23BNT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$2,600	\$2,600
17 Private office (#103)						
3402	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
3403	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
18 Private office (#102)						
3404	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1		\$90	\$90
3405	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
19 Private office (#101)						
3406	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1		\$250	\$250
3407	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
3408	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 9" • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID24B ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3409	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 42" deep • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$50	\$50
20 Exit door adjacent to room (#101)						
3410	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled. • <i>As-is Measurement:</i> 60" • <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$450	\$450
3411	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
3412	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 6" • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID24BREF ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
3413	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 15" • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID23B ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3414	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$50	\$50
3415	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$250	\$250
21 Pantry/copy room (#110)						
3416	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
3417	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$250	\$250
3418	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 4.5"</p> <p>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</p>	<p>PCODE ID23A</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3419	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
3420	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide. • <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$1,850	\$1,850
3421	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink faucet controls not accessible. • <i>Proposed Solution:</i> Provide accessible sink faucet controls. 	PCODE IN07 ADAAG 4.24.7 CSAS 1508.0 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$600	\$600
3422	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 58" S.D: 52" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$100	\$200
22 Board conference room						
3423	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$250	\$500

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3424	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$90	\$180
3425	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$375	\$375
23 Staircase						
3426	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled. • <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$450	\$450
3427	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	2	JOB	\$250	\$500
3428	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 27" • <i>Proposed Solution:</i> Provide new, wider door pair and frame with new accessible hardware. 	PCODE ID08 ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$2,400	\$2,400

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3429	<p>• <i>As-Built Description:</i> Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).</p> <p>• <i>Proposed Solution:</i> Provide new guardrail, including handrail at ramp.</p>	<p>PCODE ED08</p> <p>CSAS CBC 509</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	12	LF	\$120	\$1,440
3430	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01</p> <p>ADAAG 4.8.5 & 4.9.4</p> <p>CSAS 1133B.4.1 & B.5.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	25	LF	\$95	\$2,375
3431	<p>• <i>As-Built Description:</i> Elevator not provided in multistory building.</p> <p>• <i>Proposed Solution:</i> Provide new elevator with two stops.</p>	<p>PCODE IK01</p> <p>ADAAG 4</p> <p>CSAS 5103</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	?	\$200,000
3432	<p>• <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06A</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$320	\$320
3433	<p>• <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06B</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$300	\$300

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3434	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area.</p>	<p>PCODE II02B</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	16	LF	\$14	\$224
3435	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$90	\$90
24 Unisex restrooms						
3436	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$90	\$90
3437	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not to be provided with braile/tactile information.</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15NT</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$100	\$100
3438	<p>• <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03A</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$375	\$375

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3439	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible coat hook not within reach range. • <i>As-is Measurement:</i> 64" • <i>Proposed Solution:</i> Recommended: Adjust existing or provide new coat hook at 48" height. 	PCODE WG03A ADAAG 4.2.5 (1110B.1.7) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$75	\$75
3440	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type. 	PCODE WB10 ADAAG 4.16.5 & 4.27.4 CSAS 1502.0 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$500	\$500
3441	<ul style="list-style-type: none"> • <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet. • <i>As-is Measurement:</i> 19.5" • <i>Proposed Solution:</i> Fur out sidewall with 60" x 60" panel to provide 18" dimension. Install grab bar and recess toilet paper dispenser. 	PCODE WB02B ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$1,000	\$1,000
3442	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5.5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$150	\$150
3443	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Side grab bar located more than 12" from rear wall. • <i>As-is Measurement:</i> 17.5" • <i>Proposed Solution:</i> Relocate accessible side grab bar. 	PCODE WB07ANT ADAAG Fig. 29 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
3444	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Rear grab bar extends less than 42" from side wall. • <i>As-is Measurement:</i> 40" from side wall • <i>Proposed Solution:</i> Relocate accessible rear grab bar. 	PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3446	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 20" • <i>Proposed Solution:</i> Relocate adjacent lavatory to opposite wall. Re-route plumbing and patch finishes as needed. 	PCODE WB01NT CSAS 1115B.7.3 <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$4,600	\$4,600
3447	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 47" F.T.D: 50" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$100	\$200
3448	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory). • <i>Proposed Solution:</i> Relocate existing lavatory. 	PCODE WD01AREF ADAAG 4.19.3 CSAS 1504.2.1 C.P.C. <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>		REF		
3449	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. • <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 CSAS 1504.1.3 <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$600	\$600
25 Unisex restrooms						
3450	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 <i>Year Mitigated</i> 2013-2014 <i>DSA App. #</i> 01-112613 <i>Funding</i> <i>Bond Program</i> <i>Mitigation Note</i> <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3451	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not to be provided with braille/tactile information.</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15NT</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$100	\$100
3452	<p>• <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03A</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$375	\$375
3453	<p>• <i>As-Built Description:</i> Accessible coat hook not within reach range.</p> <p>• <i>As-is Measurement:</i> 64"</p> <p>• <i>Proposed Solution:</i> Recommended: Adjust existing or provide new coat hook at 48" height.</p>	<p>PCODE WG03A</p> <p>ADAAG 4.2.5</p> <p>(1110B.1.7)</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$75	\$75
3455	<p>• <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet.</p> <p>• <i>As-is Measurement:</i> 19.5"</p> <p>• <i>Proposed Solution:</i> Fur out sidewall with 60" x 60" panel to provide 18" dimension. Install grab bar and recess toilet paper dispenser.</p>	<p>PCODE WB02B</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.1.3</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$1,000	\$1,000
3456	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5.5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B</p> <p>ADAAG Fig. 28</p> <p>CSAS DSA/AC # 99-07</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3457	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Side grab bar located more than 12" from rear wall. • <i>As-is Measurement:</i> 17.5" • <i>Proposed Solution:</i> Relocate accessible side grab bar. 	PCODE WB07ANT ADAAG Fig. 29 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
3458	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Rear grab bar extends less than 42" from side wall. • <i>As-is Measurement:</i> 40" from side wall • <i>Proposed Solution:</i> Relocate accessible rear grab bar. 	PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
3460	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>Proposed Solution:</i> Relocate adjacent lavatory to opposite wall. Re-route plumbing and patch finishes as needed. 	PCODE WB01NT CSAS 1115B.7.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$4,600	\$4,600
3462	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory). • <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD01REF ADAAG 4.19.3 CSAS 1504.2.1 C.P.C. Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center		REF		
3463	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. • <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 CSAS 1504.1.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$600	\$600

Total Costs for**Area/Floor:** Upper Level**\$249,504.00**

Campus: **Kentfield Campus** Building/Part: **Administrative Services** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Administrative Services				\$323,742.00	

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Main entrance doors at south side						
2621	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 <i>Year Mitigated 2013-2014</i> DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	6	JOB	\$375	\$2,250
2622	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high. • <i>As-is Measurement:</i> 2" • <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed. 	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 <i>Year Mitigated 2013-2014</i> DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	250	SF	\$12	\$3,000
2 Main hall						
2623	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 <i>Year Mitigated 2013-2014</i> DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	3	JOB	\$90	\$270
2624	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stage, enclosed and unenclosed platform, backstage areas or orchestra pit not accessible. • <i>Proposed Solution:</i> Provide ramp to raised platforms. 	PCODE GC01B ADAAG 4.33.5 CSAS 1104B.3.10 <i>Year Mitigated 2013-2014</i> DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	12	LF	\$400	\$4,800
2625	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Proper amount of seating for disabled persons at public seating is not provided (>25=1; >50=2; >300=4; >500=6; +500=6=1%). • <i>Proposed Solution:</i> Modify seating to provide clear and level wheelchair space 33" x 48" or 33" x 60", including companion seat, as required. 	PCODE GE01 ADAAG 4.1.2(19)a CSAS 1104B.3.4 <i>Year Mitigated 2013-2014</i> DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	EA	\$600	\$600

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2626	<p>• <i>As-Built Description:</i> Less than one percent of total seating are aisle seats with removable armrest (at aisle side) that are identified by a sign.</p> <p>• <i>Proposed Solution:</i> Provide aisle seats with no or removable armrest and post availability at ticket office.</p>	<p>PCODE GE01A ADAAG 4.1.2(19)a CSAS 1104B.3.4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	EA	\$350	\$350
2627	<p>• <i>As-Built Description:</i> At least one fixed companion seat next to each wheelchair seating area is not provided.</p> <p>• <i>Proposed Solution:</i> Provide one companion seat next to each accessible wheelchair space(s).</p>	<p>PCODE GE01B ADAAG 4.33.3 CSAS 1104B.3.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	EA	\$350	\$350
2628	<p>• <i>As-Built Description:</i> CA only: Less than one percent of total seats have at least 24" clear leg space between the front of the seat and any obstruction to accommodate semi-ambulant individuals.</p> <p>• <i>Proposed Solution:</i> Relocate seats to provide 24" clear leg room for semi-ambulant individuals.</p>	<p>PCODE GE01D CSAS 1104B.3.8 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	EA	\$350	\$350
2630	<p>• <i>As-Built Description:</i> No signs at the building or assembly area entrance to notify patrons that an assistive listening system is available.</p> <p>• <i>Proposed Solution:</i> Provide assistive listening signage.</p>	<p>PCODE GI02REF ADAAG 4.1.3 (19) (b) CSAS 1104B.2.4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>		REF		
2631	<p>• <i>As-Built Description:</i> "An adequate number of receivers (4% of seating capacity, min. 2) is not available to patrons in theaters with more than 50 seats."</p> <p>• <i>Proposed Solution:</i> Provide additional receiving devices.</p>	<p>PCODE GI03REF ADAAG 4.1.3(19)(b*) CSAS 3103(a)2G(1) Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>		REF		

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4983	<p>• <i>As-Built Description:</i> No permanently installed assistive listening system provided for smaller assembly area (accommodating 50 to 200 persons).</p> <p>• <i>Proposed Solution:</i> Provide permanent assistive listening system (FM type), including sign at entrance indicating availability to the public, for smaller assembly area.</p>	<p>PCODE GI01A</p> <p>ADAAG 4.1.3 (19) (b)</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$1,700	\$1,700
3 Entrance lobby						
2632	<p>• <i>As-Built Description:</i> Ticket Booth: Auditorium, theater, stadium, or gymnasium counter is not accessible (with min. 36" counter length and max. 36" high), or auxiliary counter in close proximity not provided.</p> <p>• <i>As-is Measurement:</i> 40"</p> <p>• <i>Proposed Solution:</i> Make ticket booth accessible or provide auxiliary counter in close proximity. Equivalent facilitation (foldable writing shelf) possible.</p>	<p>PCODE GD01</p> <p>ADAAG 7.2.(2)</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$3,000	\$3,000
2633	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</p> <p>• <i>As-is Measurement:</i> 12"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02B</p> <p>ADAAG 4.15.5(1) & Fig.27(a)</p> <p>CSAS 1507.3.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$2,000	\$2,000
2634	<p>• <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.</p> <p>• <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.</p>	<p>PCODE IA04REF</p> <p>CSAS 1117B.1.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>		REF		
2635	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE IA05C</p> <p>ADAAG 4.4.1</p> <p>CSAS Fig. 11B-3</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$1,900	\$1,900

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2636	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition. • <i>As-is Measurement:</i> 39" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
4 Women's restrooms						
2637	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$100	\$100
2638	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
2639	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. • <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 CSAS 1115B.7.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$23,000	\$23,000
2640	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 27" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
5 Staircase in south east corner						
2641	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area.</p>	<p>PCODE II02B</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	32	LF	\$14	\$448
2642	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01</p> <p>ADAAG 4.8.5 & 4.9.4</p> <p>CSAS 1133B.4.1 & B.5.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	30	LF	\$95	\$2,850
4985	<p>• <i>As-Built Description:</i> Elevator not provided in multistory building.</p> <p>• <i>Proposed Solution:</i> Provide new elevator with two stops.</p>	<p>PCODE IK01</p> <p>ADAAG 4</p> <p>CSAS 5103</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	?	\$200,000
6 Men's restrooms						
4987	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$100	\$100
4988	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4989	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. • <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 CSAS 1115B.7.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$23,000	\$23,000
4990	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$2,600	\$2,600
Total Costs for					Area/Floor: Lower Level	\$275,448.00

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1	Central corridor					
2644	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	2	JOB	\$90	\$180
2645	<p>• <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03A</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	4	JOB	\$375	\$1,500
2646	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</p> <p>• <i>As-is Measurement:</i> 12"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02B</p> <p>ADAAG 4.15.5(1) & Fig.27(a)</p> <p>CSAS 1507.3.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$2,000	\$2,000
2647	<p>• <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.</p> <p>• <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.</p>	<p>PCODE IA04REF</p> <p>CSAS 1117B.1.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>		REF		
2648	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE IA05C</p> <p>ADAAG 4.4.1</p> <p>CSAS Fig. 11B-3</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$1,900	\$1,900

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2649	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition. • <i>As-is Measurement:</i> 38" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>		REF		
4994	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in poor condition. • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03E ADAAG 4.15.3 CSAS 1507.3.4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	REF	\$0	
2 Classroom #101						
2650	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
2651	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2652	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$375	\$375

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3 Classroom #102						
2653	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
2654	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
2655	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$375	\$375
4993	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in poor condition. • <i>As-is Measurement:</i> 2" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03E ADAAG 4.15.3 CSAS 1507.3.4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	REF		
4 Classroom #103						
2656	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2657	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2658	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$375	\$375
5 Classroom #104						
2659	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
2660	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2661	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$375	\$375

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
6 Classroom #105						
2662	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	2	JOB	\$90	\$180
2663	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	2	JOB	\$250	\$500
2664	<p>• <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03A</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	2	JOB	\$375	\$750
7 Classroom #106						
2665	<p>• <i>As-Built Description:</i> Access to raised areas and platforms not provided.</p> <p>• <i>Proposed Solution:</i> Provide wheelchair lift.</p>	<p>PCODE CD02B</p> <p>ADAAG 4.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$25,000	\$25,000
2666	<p>• <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03A</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$375	\$375

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2667	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$250	\$250
2668	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$90	\$90
8 Storage room #111						
2669	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$250	\$250
2670	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$90	\$90
2671	<p>• <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i></p>	1	JOB	\$375	\$375

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
9 Classroom #107						
2672	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
2673	<p>• <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03A</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$375	\$375
2674	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$250	\$250
10 Classroom #108						
2675	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	2	JOB	\$90	\$180
2676	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	2	JOB	\$250	\$500

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2677	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$375	\$750
2678	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Access to raised areas and platforms not provided. • <i>Proposed Solution:</i> Provide wheelchair lift. 	PCODE CD02B ADAAG 4.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$25,000	\$25,000
11 Classroom #109						
2679	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
2680	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Provide new door closer adjusted to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03A ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$375	\$375
2681	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250

Total Costs for**Area/Floor:** Upper level**\$64,160.00**

Campus: **Kentfield Campus** Building/Part: **Olney Hall** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Olney Hall				\$339,608.00	

Campus: **Kentfield Campus** Building/Part: **Business Management Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1	Central corridor					
2682	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	2	JOB	\$90	\$180
2683	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	4	JOB	\$50	\$200
2684	<p>• <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.</p> <p>• <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.</p>	<p>PCODE IA04REF</p> <p>CSAS 1117B.1.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>		REF		
2685	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE IA05C</p> <p>ADAAG 4.4.1</p> <p>CSAS Fig. 11B-3</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$1,900	\$1,900
2686	<p>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</p> <p>• <i>As-is Measurement:</i> 39"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA03B</p> <p>ADAAG 4.15.2</p> <p>CSAS 1507.3.3</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$2,000	\$2,000

Campus: **Kentfield Campus** Building/Part: **Business Management Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2687	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in poor condition. • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03E ADAAG 4.15.3 CSAS 1507.3.4 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	REF	\$0	
2 Classroom #101						
2688	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$250	\$500
2689	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
3 Classroom #102						
2690	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1		\$90	\$90
2691	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$250	\$500

Campus: **Kentfield Campus** Building/Part: **Business Management Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4 Classroom #104						
2692	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2		\$250	\$500
2693	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
5 Room #103						
2694	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$250	\$250
2695	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	1	JOB	\$90	\$90
6 Classroom #105						
2696	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding <i>Bond Program</i> Mitigation Note <i>Demolished And Replaced With New Academic Center</i>	2	JOB	\$250	\$500

Campus: **Kentfield Campus** Building/Part: **Business Management Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2697	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90
7 Room #106						
2698	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1		\$90	\$90
2699	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
8 Custodian's room #107						
2700	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$250	\$250
2701	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2013-2014 DSA App. # 01-112613 Funding Bond Program Mitigation Note Demolished And Replaced With New Academic Center	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Business Management Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
9	Unisex restroom					
2702	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$100	\$100
2703	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$90	\$90
2704	<p>• <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations.</p> <p>• <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom.</p>	<p>PCODE WA01</p> <p>ADAAG 4.22</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	1	JOB	\$17,000	\$17,000
2705	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 25"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated 2013-2014</p> <p>DSA App. # 01-112613</p> <p>Funding Bond Program</p> <p>Mitigation Note Demolished And Replaced With New Academic Center</p>	2	JOB	\$2,600	\$5,200

Total Costs for**Area/Floor:** Lower Level**\$30,050.00**

Campus: **Kentfield Campus** Building/Part: **Business Management Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Business Management Building				\$30,050.00	

Campus: **Kentfield Campus** Building/Part: **Business Management Building** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Grand Total for	Campus: Kentfield Campus				\$1,206,050.00	

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Entrance door at S.W. end.						
2511	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2512	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
2513	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area. 	PCODE ID06 CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2 Private office (# 15)						
2514	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2515	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3 Storage room (# 14)						
2516	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2517	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
4 Private office (# 13)						
2518	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2519	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
5 Photography -Dry lab (# 16)						
2520	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2521	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
2522	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 8 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
2523	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible dry lab fixed work station(s) not provided (5% of stations; not less than one). • <i>Proposed Solution:</i> Provide accessible dry lab fixed work station(s). 	PCODE LB01NT ADAAG 4.1.3 (18) CSAS 3103A(d)1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$9,200	\$9,200
2524	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Fixed desk, counter, etc. less than 28"" or more than 34"" in height, or knee space 27"" high x 19"" deep x 30"" wide not provided." • <i>As-is Measurement:</i> 36" counter top • <i>Proposed Solution:</i> Provide or modify accessible desk/work space for instructor. 	PCODE LDREF ADAAG 4.32.3 & 4.32.4 CSAS 3105(n) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
6 Photography -Dark room (# 12)						
2525	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2526	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	2	JOB	\$250	\$500
2527	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	2	JOB	\$50	\$100
2528	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 3"</p> <p>• <i>Proposed Solution:</i> Remove closer; if latch is required.</p>	<p>PCODE ID24ANT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
2529	<p>• <i>As-Built Description:</i> Hinge approach: At push side, door does not have clear and level maneuvering space measuring 54" width (starting at latch) x 42" deep (48" deep if door has both, latch and closer) (CA only: 54" x 44").</p> <p>• <i>As-is Measurement:</i> 39" deep</p> <p>• <i>Proposed Solution:</i> Provide door operator.</p>	<p>PCODE ID26C</p> <p>ADAAG Fig. 25(b)</p> <p>CSAS 11B-26A(b)</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$5,000	\$5,000
2530	<p>• <i>As-Built Description:</i> "Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."</p> <p>• <i>Proposed Solution:</i> Provide one more accessible fixed work station.</p>	<p>PCODE LB02NT</p> <p>ADAAG 4.1.3(18)</p> <p>CSAS 3103A(d)2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$4,500	\$4,500

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
7 Room # 18						
2531	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2532	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$250	\$250
8 Room # 19						
2533	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2534	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$250	\$250
9 Men's restrooms						
2535	<p>• <i>As-Built Description:</i> Otherwise compliant sign identifying permanent room or space not mounted 5' high to center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing).</p> <p>• <i>Proposed Solution:</i> Relocate existing sign.</p>	<p>PCODE SA07 ADAAG 4.30.6 CSAS 1117B.5.9 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2536	<ul style="list-style-type: none"> • As-Built Description: Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • Proposed Solution: Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
2537	<ul style="list-style-type: none"> • As-Built Description: Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • As-is Measurement: 10 lbs • Proposed Solution: Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
2538	<ul style="list-style-type: none"> • As-Built Description: CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • As-is Measurement: 13" • Proposed Solution: Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,000	\$2,000
2539	<ul style="list-style-type: none"> • As-Built Description: Toilet stall less than 60" wide. • As-is Measurement: 38" • Proposed Solution: Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2540	<ul style="list-style-type: none"> • As-Built Description: Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • As-is Measurement: 46" from face of wc • Proposed Solution: Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2541	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
2542	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type. 	PCODE WB10 ADAAG 4.16.5 & 4.27.4 CSAS 1502.0 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
2543	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
2544	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 58" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
2545	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 52" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2546	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
2547	<p>• <i>As-Built Description:</i> CA only: Urinal floor-mounted, stall type or trough.</p> <p>• <i>Proposed Solution:</i> Provide new accessible urinal. Remodel restroom as needed.</p>	<p>PCODE WE05 CSAS 1503.2.1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$4,000	\$4,000
2548	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	2	JOB	\$120	\$240
10 Film room (#10-11)						
2549	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2550	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2551	<p>• <i>As-Built Description:</i> "Fixed desk, counter, etc. less than 28"" or more than 34"" in height, or knee space 27"" high x 19"" deep x 30"" wide not provided."</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Provide or modify accessible desk/work space for instructor.</p>	<p>PCODE LD</p> <p>ADAAG 4.32.3 & 4.32.4</p> <p>CSAS 3105(n)</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$2,876	\$2,876
11 Women's restrooms						
2552	<p>• <i>As-Built Description:</i> Otherwise compliant sign identifying permanent room or space not mounted 5' high to center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing).</p> <p>• <i>Proposed Solution:</i> Relocate existing sign.</p>	<p>PCODE SA07</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
2553	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
2554	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	2	JOB	\$50	\$100
2555	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C</p> <p>ADAAG 4.17.5</p> <p>CSAS 1115B.7.1.4</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2556	<ul style="list-style-type: none"> • As-Built Description: Grab bar clearance not 1-1/2" from wall. • As-is Measurement: 3" • Proposed Solution: Provide accessible grab bars. 	PCODE WB07E ADAAG 4.26.2 CSAS 1115B.8.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
2557	<ul style="list-style-type: none"> • As-Built Description: Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • As-is Measurement: 5" • Proposed Solution: Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
2558	<ul style="list-style-type: none"> • As-Built Description: Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • As-is Measurement: Tampon disp: 51" S.C.D < 18" above grab bar • Proposed Solution: Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$100	\$200
2559	<ul style="list-style-type: none"> • As-Built Description: Hot or sharp-surfaced water/drain pipe not insulated or covered. • Proposed Solution: Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	4	JOB	\$120	\$480
12 Exit door to stairs						
2560	<ul style="list-style-type: none"> • As-Built Description: At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • Proposed Solution: Provide raised letter/Braille "TO EXIT" sign at door. 	PCODE SA10E ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2561	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
13 Rooms #13-15						
2562	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	3	JOB	\$90	\$270
2563	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	3	JOB	\$250	\$750
Total Costs for					Area/Floor: Level 1	\$36,386.00

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Rear entrance doors on west side						
2564	<ul style="list-style-type: none"> As-Built Description: At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. Proposed Solution: Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2565	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. As-is Measurement: 11 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$50	\$100
2 Staircase at east entrance						
2566	<ul style="list-style-type: none"> As-Built Description: Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser. Proposed Solution: Extend stair handrail at bottom (cost for each extension piece). 	PCODE ED07 ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	4	JOB	\$170	\$680
2567	<ul style="list-style-type: none"> As-Built Description: Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only). Proposed Solution: Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area. 	PCODE H02B CSAS 1133B.4.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	25	LF	\$14	\$350
3 Main entrance doors on east side						
2568	<ul style="list-style-type: none"> As-Built Description: At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. Proposed Solution: Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2569	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 13 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$50	\$100
4 Private office (#122)						
2570	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2571	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
5 Store room (#121)						
2572	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2573	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2574	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$75	\$75
6 Lecture hall (#120)						
2575	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2576	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$75	\$75
2577	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	3	JOB	\$90	\$270
2578	<p>• <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room.</p> <p>• <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility.</p>	<p>PCODE GI01E</p> <p>ADAAG 4.1.3 (19) (b)</p> <p>CSAS 1104B.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1			

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
7 Com. foundation office (#112)						
2579	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
2580	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2581	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75
2582	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
8 Lobby						
2583	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,900	\$1,900

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2584	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in good condition. • <i>Proposed Solution:</i> Adjust water flow. 	PCODE IA03D ADAAG 4.15.3 CSAS 1507.3.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75
2585	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • <i>As-is Measurement:</i> 8" protrusion at 35" height • <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface. 	PCODE EG04 ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
9 Room #100						
2586	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2587	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
10 Photo studio (#111)						
2588	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2589	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
2590	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
11 Exit doors leading to room (#111) from lobby						
2591	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "TO EXIT" sign at door. 	PCODE SA10E ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2592	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$50	\$100
12 Classroom (#110)						
2593	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2594	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
2595	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 13 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
2596	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75
13 Private offices (#101-106)						
2597	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	6	JOB	\$90	\$540
2598	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	6	JOB	\$250	\$1,500

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
14 Exit door at south end						
2599	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2600	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 12 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
15 Elevator						
2601	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Interior controls top row more than 48"" from floor (front approach) or more than 54"" high (side approach)." • <i>As-is Measurement:</i> 54" • <i>Proposed Solution:</i> "Lower elevator controls to 48"" from floor." 	PCODE IK05 ADAAG 4.10.12(3)* CSAS 5103 (d.1) 6A Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,970	\$1,970
2602	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Elevator control panel buttons not illuminated. • <i>Proposed Solution:</i> Provide illuminated elevator control panel buttons . 	PCODE IK07B ADAAG 4.10.12 (2) CSAS 5103 (d.1) 6B. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$980	\$980
2603	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Braille or tactile symbols at numerals not provided on elevator control panel. • <i>Proposed Solution:</i> Provide Braille and tactile symbols on elevator control panel. 	PCODE IK07D ADAAG 4.10.12(2) CSAS 5103 (d.1) 6B. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$110	\$110

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2604	<p>• <i>As-Built Description:</i> Neither audible signal nor visual wall lantern provided.</p> <p>• <i>Proposed Solution:</i> "Provide audible signal, and wall lantern device."</p>	<p>PCODE 1K10C ADAAG 4.10.4 CSAS 5103 (d.1) 9</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$2,510	\$2,510
2605	<p>• <i>As-Built Description:</i> "Floor numbers not provided at all elevator entrances with both raised characters 2"" high and Braille numbers, on each entrance jamb."</p> <p>• <i>Proposed Solution:</i> Provide compliant floor numbering on elevator door jambs.</p>	<p>PCODE 1K11 ADAAG 4.10.5* CSAS 5103 (d.1) 10.</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	SET	\$50	\$50
2606	<p>• <i>As-Built Description:</i> Door reopening device does not remain effective for at least 20 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust timing.</p>	<p>PCODE 1K14 ADAAG 4.10.6 CSAS 3003.4.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
16 Interior stairs at south side						
2607	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	15	LF	\$95	\$1,425
2608	<p>• <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06B ADAAG 4.9.4(2) CSAS 1133B.4.2.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$300	\$300

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2609	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only). • <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area. 	PCODE II02B CSAS 1133B.4.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	7	LF	\$14	\$98
Total Costs for Area/Floor: Level 2					\$16,538.00	

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 3**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Exit door near elevator						
2610	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2611	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
2 Private offices (#202-207)						
2612	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	6	JOB	\$90	\$540
2613	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	6	JOB	\$250	\$1,500
3 Staircase adjacent to room (#201)						
2614	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser. • <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece). 	PCODE ED07 ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$170	\$340

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 3**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2615	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area.</p>	<p>PCODE II02B</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	18	LF	\$14	\$252
2616	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01</p> <p>ADAAG 4.8.5 & 4.9.4</p> <p>CSAS 1133B.4.1 & B.5.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	15	LF	\$95	\$1,425
2617	<p>• <i>As-Built Description:</i> At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "TO EXIT" sign at door.</p>	<p>PCODE SA10E</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2618	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
4 Storage room						
2619	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 3**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2620	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note <i>Pending - Client Approval Of Scope</i>	1	JOB	\$90	\$90
Total Costs for		Area/Floor: Level 3			\$4,677.00	

Campus: **Kentfield Campus** Building/Part: **Fusselman Hall** Area/Floor: **Level 3**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Fusselman Hall				\$57,601.00	

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Main entrance at north side						
2891	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
2 Book store (#10)						
2892	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
2893	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Book shelves are more than 54" maximum height. • <i>Proposed Solution:</i> Provide attendant when needed. 	PCODE BD01A CSAS 1106B.4.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$0	
2894	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
2895	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Signage identifying accessible check-out aisle not provided above the aisle (CA only: sign should display the international symbol and state "This checkstand to be open at all times for customers with disabilities"). • <i>Proposed Solution:</i> Provide signage above accessible check-out counter. 	PCODE RB03 ADAAG 7.3(3) CSAS 1110B.1.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,000	\$1,000

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2896	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3 Reprographics (#20)						
2897	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2898	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 1" • <i>Proposed Solution:</i> Change door swing. 	PCODE ID23 ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
2899	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). • <i>As-is Measurement:</i> 19" height • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02 ADAAG 4.15.5(1) CSAS 1507.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,850	\$1,850
2900	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition. • <i>As-is Measurement:</i> 40" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2901	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 19 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
4 Mail room (#70)						
2902	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2903	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
2904	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 14 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
5 Instructional Media Services (#66)						
2905	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2906	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250

6 Preview/Conference Room (#65)

2907	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
------	--	--	---	-----	------	-------

2908	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
------	--	---	---	-----	-------	-------

7 Teleconference Room (#53)

2909	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75
------	---	--	---	-----	------	------

2910	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At room with 26-50 fixed seats, fewer than required number of wheelchair seating spaces provided; 2 spaces required. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Recommendation (CA only): Lower existing accessible fixed tables to between 28" and 30" for all task requiring motor skills (writing, drafting , etc.) 	PCODE CB02BNT ADAAG 4.1.3(19)a Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$760	\$760
------	--	--	---	-----	-------	-------

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2912	<ul style="list-style-type: none"> • As-Built Description: Sign designating a permanent room or space does not include Grade 2 Braille. • Proposed Solution: Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

8 Atrium Display Units

2911	<ul style="list-style-type: none"> • As-Built Description: Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • As-is Measurement: 6" projection above 27" • Proposed Solution: Remove/relocate protruding object. Patch existing surface. 	PCODE EG04 ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	8	JOB	\$100	\$800
------	---	--	---	-----	-------	--------------

2913	<ul style="list-style-type: none"> • As-Built Description: Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser. • Proposed Solution: Extend stair handrail at bottom (cost for each extension piece). 	PCODE ED07 ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$170	\$340
------	--	---	---	-----	-------	--------------

9 Exit door at south-end

2914	<ul style="list-style-type: none"> • As-Built Description: At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • Proposed Solution: Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
------	--	--	---	-----	------	-------------

2915	<ul style="list-style-type: none"> • As-Built Description: Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • As-is Measurement: 11 lbs • Proposed Solution: Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$50	\$100
------	--	---	---	-----	------	--------------

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
10 Echo Times (#32)						
2916	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
2917	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2918	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 10" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
11 Classroom #36						
2919	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2920	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
12	Elevator					
2921	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Door opening has less than 36"" clear opening width. " • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> "Enlarge elevator door opening to 36"" width." 	PCODE IK03 ADAAG 4.10.9 CSAS 5103 (d.1) 3. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$19,600	\$19,600
2922	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Small size of car makes elevator difficult to use or unusable by persons in wheelchairs. • <i>Proposed Solution:</i> Provide new elevator with two stops. 	PCODE IK04 ADAAG 4.10.9 CSAS 5103 (d.1) 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	?	\$120,000
2923	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Call buttons in lobby / hall not centered 3'-6" above floor. • <i>As-is Measurement:</i> 48" • <i>Proposed Solution:</i> Provide new or relocate elevator call buttons to 3'-6" above floor at exterior landing. 	PCODE IK09 ADAAG 4.10.3 CSAS 3003.4.9b Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	FLR	\$450	\$450
2924	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Neither audible signal nor visual wall lantern provided. • <i>Proposed Solution:</i> "Provide audible signal, and wall lantern device." 	PCODE IK10C ADAAG 4.10.4 CSAS 5103 (d.1) 9 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,510	\$2,510
2925	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Floor numbers not provided at all elevator entrances with both raised characters 2"" high and Braille numbers, on each entrance jamb." • <i>Proposed Solution:</i> Provide compliant floor numbering on elevator door jambs. 	PCODE IK11 ADAAG 4.10.5* CSAS 5103 (d.1) 10. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	SET	\$50	\$100

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2926	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Interior controls top row more than 48"" from floor (front approach) or more than 54"" high (side approach)." • <i>As-is Measurement:</i> 57" • <i>Proposed Solution:</i> "Lower elevator controls to 48"" from floor." 	PCODE IK05 ADAAG 4.10.12(3)* CSAS 5103 (d.1) 6A Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,970	\$1,970
2927	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Elevator car lacks emergency communication device that is not dependent on speaking/hearing ability of elevator passenger. • <i>Proposed Solution:</i> Provide elevator communication device that has combination voice and light signal communications. 	PCODE IK06A ADAAG 4.10.14 CSAS 5103 (d.1) 6A Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$700	\$700
2928	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided on at least one wall of car. • <i>Proposed Solution:</i> Provide handrail on one elevator car wall. 	PCODE IK08 - CSAS 5103 (d.1) 7. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$400	\$400
2929	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Braille or tactile symbols at numerals not provided on elevator control panel. • <i>Proposed Solution:</i> Provide Braille and tactile symbols on elevator control panel. 	PCODE IK07D ADAAG 4.10.12(2) CSAS 5103 (d.1) 6B. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$110	\$110
13 Lecture room (#38)						
2930	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2931	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
2932	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Recommended only: Non-fixed desk not at proper height and does not provide proper knee space. • <i>As-is Measurement:</i> 12" deep knee clearance • <i>Proposed Solution:</i> Provide new accessible desk. 	PCODE CD01A ADAAG 4.32.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,200	\$1,200
14 Parking permits counter						
2933	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 42" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
2934	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
15 Classroom #39						
2935	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2936	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250

16**Classroom #20**

2937	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
------	--	--	---	-----	------	-------------

2938	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
------	--	---	---	-----	-------	--------------

17**C.I.S. Computer Lab. (#35)**

2939	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
------	--	--	---	-----	------	-------------

2940	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$75	\$150
------	---	--	---	-----	------	--------------

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2941	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 45" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
18 C.I.S. Faculty Offices (#23-28)						
2942	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	6	JOB	\$90	\$540
2943	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	6	JOB	\$250	\$1,500
2944	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 1" • <i>Proposed Solution:</i> Change hinge/latch side. 	PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$500	\$1,000
19 Storage/Assembly rooms (#29-31)						
2945	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	3	JOB	\$250	\$750

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2946	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	3	JOB	\$90	\$270
20 Men's restrooms (#15)						
2947	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
2948	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2949	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07REF</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		
2950	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2951	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 6-1/2" • <i>Proposed Solution:</i> Change door swing and latch/hinge side. 	PCODE ID23REF ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2952	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	3	JOB	\$120	\$360
2953	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Remount compliant fixture at accessible height. 	PCODE WD02A ADAAG 4.19.2 CSAS 1504.2.1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$900	\$900
2954	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. • <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 CSAS 1504.1.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$600	\$600
2955	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 CSAS 1503.2.1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$4,000	\$4,000
2956	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2957	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 52" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
2958	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type. 	PCODE WB10 ADAAG 4.16.5 & 4.27.4 CSAS 1502.0 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
2959	<ul style="list-style-type: none"> • <i>As-Built Description:</i> The location of the stall door is not in front of the clear space (next to the water closet), with a maximum stile width of 4 ". • <i>Proposed Solution:</i> Remodel compartment. 	PCODE WB05D ADAAG 4.17.3 & Fig. 30(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
2960	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock). • <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides. 	PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
2961	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall. • <i>As-is Measurement:</i> 37" from side wall • <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar. 	PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$300	\$300

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2962	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B</p> <p>ADAAG Fig. 28</p> <p>CSAS DSA/AC # 99-07</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$150	\$150
2963	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 52" A.F.F.</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE WG01A</p> <p>ADAAG 28 CFR 35.133(a)</p> <p>CSAS 1115B.9.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
21 Women's restrooms (#17)						
2964	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
2965	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2966	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2967	<ul style="list-style-type: none"> • As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • As-is Measurement: 7" • Proposed Solution: Change door swing and latch/hinge side. 	PCODE ID23REF ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2968	<ul style="list-style-type: none"> • As-Built Description: Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • As-is Measurement: 30.5" • Proposed Solution: Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,600	\$2,600
2969	<ul style="list-style-type: none"> • As-Built Description: Hot or sharp-surfaced water/drain pipe not insulated or covered. • Proposed Solution: Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	3	JOB	\$120	\$360
2970	<ul style="list-style-type: none"> • As-Built Description: Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory). • As-is Measurement: 11" o.c. from wall • Proposed Solution: Relocate existing lavatory. 	PCODE WD01A ADAAG 4.19.3 CSAS 1504.2.1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$900	\$900
2971	<ul style="list-style-type: none"> • As-Built Description: Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. • Proposed Solution: Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 CSAS 1504.1.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$600	\$600

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2972	<ul style="list-style-type: none"> • As-Built Description: Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide). • As-is Measurement: 35" • Proposed Solution: Modify facility passage to be min. 44" wide. Demolish existing partition and replace. 	PCODE WC02A ADAAG 4.3.3 CSAS 1115B.7.1.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	5	LF	\$170	\$850
2973	<ul style="list-style-type: none"> • As-Built Description: Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • As-is Measurement: F.T.D: 52" • Proposed Solution: Relocate existing restroom accessories. 	PCODE WG01AREF ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2974	<ul style="list-style-type: none"> • As-Built Description: Feminine Tampon Dispenser mounted with control higher than 40" above floor. • As-is Measurement: 6" at 50" A.F.F. • Proposed Solution: Remount feminine tampon dispenser at accessible height. 	PCODE WG04NT ADAAG 28 CFR 35.133(a) CSAS 1115.B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$200	\$200
2975	<ul style="list-style-type: none"> • As-Built Description: Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • As-is Measurement: 26" from front edge of wc. • Proposed Solution: Remove adjacent fixture, rotate existing fixture and provide new enclosure as required. 	PCODE WB03NT ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$4,600	\$4,600
2976	<ul style="list-style-type: none"> • As-Built Description: Feminine Napkin Disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • As-is Measurement: 5" • Proposed Solution: Provide recessed Feminine Napkin Disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2977	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02BNT ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$150	\$150
2978	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE WB10REF ADAAG 4.16.5 & 4.27.4 CSAS 1502.0 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>		REF		
2979	<p>• <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall.</p> <p>• <i>As-is Measurement:</i> 40" from side wall</p> <p>• <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar.</p>	<p>PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$300	\$300
2980	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
22 Drinking fountain						
2981	<p>• <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in good condition.</p> <p>• <i>As-is Measurement:</i> 0.5"</p> <p>• <i>Proposed Solution:</i> Adjust water flow.</p>	<p>PCODE IA03D ADAAG 4.15.3 CSAS 1507.3.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$75	\$75

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
23 Exit door at east end of building						
2982	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2983	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
24 Exit door adjacent to room #55						
2984	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2985	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 2" • <i>Proposed Solution:</i> Provide door operator. 	PCODE ID24C ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$5,000	\$5,000
2986	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
25 Film editing rooms (#55-59)						
2987	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	5	JOB	\$90	\$450
26 Sound editing rooms (#82-86)						
2988	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	5		\$90	\$450
2989	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No signs at non-accessible entrances directing persons to an accessible entrance of the building. • <i>Proposed Solution:</i> Provide directional signage to indicate route to the nearest accessible entrance. 	PCODE SA14 ADAAG 4.1.2(7)(c) CSAS 1117B.5.7 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$230	\$230
27 Television studio (#72)						
2990	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
2991	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No signs at non-accessible entrances directing persons to an accessible entrance of the building. • <i>Proposed Solution:</i> Provide directional signage to indicate route to the nearest accessible entrance. 	PCODE SA14REF ADAAG 4.1.2(7)(c) CSAS 1117B.5.7 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
28	Edit rooms (#74-76)					
2992	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	3	JOB	\$90	\$270
Total Costs for					Area/Floor: Lower Level	\$191,185.00

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1	Library (#100)					
2993	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2994	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	2	JOB	\$90	\$180
2995	<p>• <i>As-Built Description:</i> CA only: Book shelves are more than 54" maximum height.</p> <p>• <i>As-is Measurement:</i> 80"</p> <p>• <i>Proposed Solution:</i> Provide attendant when needed.</p>	<p>PCODE BD01A CSAS 1106B.4.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$0	
2996	<p>• <i>As-Built Description:</i> Information desk or circulation counter or section not 36" max. high and min. 36" wide (CA only: top 28" to 34" high, min. 36" counter length).</p> <p>• <i>As-is Measurement:</i> 39"</p> <p>• <i>Proposed Solution:</i> Provide new accessible desk/counter section when remodeling area. Relocate or modify electrical outlets and equipment as needed. Interim: provide equivalent facilitation.</p>	<p>PCODE BE02 ADAAG 8.3 CSAS 1122B.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$4,000	\$4,000
2997	<p>• <i>As-Built Description:</i> Open stacks (i.e. public use) do not have min 36" (44" preferred) wide aisles (CA only: 44" min. width at main aisles and 36" min. at end aisles).</p> <p>• <i>As-is Measurement:</i> 33"</p> <p>• <i>Proposed Solution:</i> Enlarge open stack aisles to 44" wide and/or end of aisles to 36".</p>	<p>PCODE BB01 ADAAG 8.5 CSAS 1106B.4.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1119	LF	\$60	\$67,140

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2 Room #134						
2998	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3 Dean's office #133						
2999	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3000	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
3001	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, unequal width door leafs in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,500	\$1,500
4 Faculty study #109						
3002	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3003	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3004	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, unequal width door leaves in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,500	\$1,500
5 Room #136						
3005	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, unequal width door leaves in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1		\$1,500	\$1,500
3006	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
3007	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 6-1/2" • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID23B ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
6 Room #108						
3008	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
7 Room #111						
3009	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2		\$250	\$500
3010	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
3011	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3012	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide. • <i>As-is Measurement:</i> No knee clearance • <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,850	\$1,850

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3013	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep. • <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3014	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE IN06C ADAAG 4.24.6 CSAS 1117B.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$120	\$120
3015	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 6" • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID23B ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,600	\$2,600
8 Reference office #107						
3016	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3017	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new, unequal width door leaves in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,500	\$1,500

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
9 Group study rooms #101-106						
3018	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	8	JOB	\$90	\$720
3019	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	8	JOB	\$250	\$2,000
3020	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>Proposed Solution:</i> Provide new, unequal width door leafs in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	8	JOB	\$1,500	\$12,000
10 Writing Lab #110						
3021	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
3022	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3023	<ul style="list-style-type: none"> • As-Built Description: Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • As-is Measurement: 13 lbs • Proposed Solution: Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$50	\$100
3024	<ul style="list-style-type: none"> • As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • As-is Measurement: 2" • Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
11 Teaching Resource Center #115						
3025	<ul style="list-style-type: none"> • As-Built Description: Door does not have accessible operating hardware. • Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3026	<ul style="list-style-type: none"> • As-Built Description: Sign designating a permanent room or space does not include Grade 2 Braille. • Proposed Solution: Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
3027	<ul style="list-style-type: none"> • As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • As-is Measurement: 7" • Proposed Solution: Remove closer, if latch is to remain. 	PCODE ID24ANT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
12 Media Center #120						
3028	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
3029	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Recommended only: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. • <i>As-is Measurement:</i> 26" high knee space • <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,600	\$1,600
13 Private Office #121						
3030	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
3031	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3032	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, unequal width door leaves in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,500	\$1,500

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
14 Foreign Language Lab #127						
3033	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
3034	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
15 Computer Lab #150						
3035	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
3036	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
16 Private office #126						
3037	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3038	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3039	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new, unequal width door leaves in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,500	\$1,500
17 English skills labs #125-126						
3040	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
3041	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
3042	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, unequal width door leaves in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$1,500	\$3,000

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
18 Private offices #122-123						
3043	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
3044	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
3045	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new, unequal width door leafs in existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$1,500	\$3,000
19 Meeting Room #140						
3046	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
20 Staff Break Room #170						
3047	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3048	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 8 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
3049	<p>• <i>As-Built Description:</i> Food waste disposal at kitchen sink protrudes into kneespace (recommended: remove equipment if requested as a reasonable accommodation by an employee).</p> <p>• <i>Proposed Solution:</i> Efficiency kitchen to be replaced with new counter, sink and electric stove.</p>	<p>PCODE IN06ANT</p> <p>ADAAG 4.24.3</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$3,000	\$3,000
21 Staff Restroom #194						
3050	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
3051	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
3052	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	2	JOB	\$250	\$500

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3053	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 8 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
3054	<p>• <i>As-Built Description:</i> No sign at non-accessible room or space directing persons to an accessible that provides the same or equivalent service.</p> <p>• <i>Proposed Solution:</i> Provide directional sign.</p>	<p>PCODE SA19</p> <p>ADAAG 35.163(b); 4.1.6(3)(e)(iii)</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
22 Unisex Restroom #191						
3055	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
3056	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
3057	<p>• <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations.</p> <p>• <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom.</p>	<p>PCODE WA01</p> <p>ADAAG 4.22</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$17,000	\$17,000

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3058	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: In existing buildings a single accommodation restroom has less than 36" wide x 48" long space in front of a water closet or less than 32" in front when 32" from side wall to water closet are provided. • <i>As-is Measurement:</i> 26" from front edge of wc • <i>Proposed Solution:</i> Provide accessible water closet, remodel walls, reroute plumbing and HVAC systems, repair tiled surfaces, patch finishes to match and repaint as needed. Provide accessible accessories and grab bars. 	PCODE WB01BREF CSAS Fig. 11B-1C Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3059	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18"). • <i>As-is Measurement:</i> 13" • <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02REF ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3060	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Back grab bar not at 33" from floor (36" allowed at tank toilet). • <i>Proposed Solution:</i> Relocate grab bars. 	PCODE WB07GREF CSAS 1115B.8.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3061	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory). • <i>As-is Measurement:</i> 11.5" • <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD01REF ADAAG 4.19.3 CSAS 1504.2.1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3062	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 28.5" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3063	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wheelchair clearance under lavatory or lavatory counter front edge less than 29" high x 8" deep x 30" wide. • <i>As-is Measurement:</i> 26" high • <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD03REF ADAAG 4.19.2 CSAS 1504.2.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
4991	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D. & T.P.D. < 18" over grab bar. • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$100	\$200
23 Men's Restroom						
3064	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3065	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
3066	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3067	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 8 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
3068	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 7.5"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID23B</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$2,600	\$2,600
3069	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01REF</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		
3070	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE WD05</p> <p>ADAAG 4.19.4</p> <p>CSAS 1504.2.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	3	JOB	\$120	\$360
3071	<p>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE WE01</p> <p>CSAS 1503.2.1 C.P.C.</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$4,000	\$4,000

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3072	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 23" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3073	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 51" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
3074	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 44" A.F.F. • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
3075	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 9.5" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,000	\$2,000
3076	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18"). • <i>As-is Measurement:</i> 21" • <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02 ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$4,600	\$4,600

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3077	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 26" • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3078	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3079	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock). • <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides. 	PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
3080	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3081	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3082	<ul style="list-style-type: none"> • As-Built Description: Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • As-is Measurement: 5.5" • Proposed Solution: Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
3083	<ul style="list-style-type: none"> • As-Built Description: Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide). • As-is Measurement: 36" • Proposed Solution: Modify facility passage to be min. 44" wide. Demolish existing partition and replace. 	PCODE WC02A ADAAG 4.3.3 CSAS 1115B.7.1.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	8	LF	\$170	\$1,360
24 Women's Restroom						
3084	<ul style="list-style-type: none"> • As-Built Description: Door does not have accessible operating hardware. • Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
3085	<ul style="list-style-type: none"> • As-Built Description: Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). • Proposed Solution: Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. 	PCODE SA15 CSAS 1115B.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
3086	<ul style="list-style-type: none"> • As-Built Description: Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • Proposed Solution: Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3087	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
3088	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 7.5"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID23B</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$2,600	\$2,600
3089	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01REF</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		
3090	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE WD05</p> <p>ADAAG 4.19.4</p> <p>CSAS 1504.2.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	3	JOB	\$120	\$360
3091	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 44" A.F.F.</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE WG01A</p> <p>ADAAG 28 CFR 35.133(a)</p> <p>CSAS 1115B.9.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3092	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 9.5" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,000	\$2,000
3093	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18"). • <i>As-is Measurement:</i> 21" • <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02 ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$4,600	\$4,600
3094	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 26" • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3095	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
3096	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock). • <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides. 	PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
3097	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3098	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
3099	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5.5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
3100	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide). • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Modify facility passage to be min. 44" wide. Demolish existing partition and replace. 	PCODE WC02A ADAAG 4.3.3 CSAS 1115B.7.1.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	17	LF	\$170	\$2,890
4992	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 4.5" • <i>Proposed Solution:</i> Replace toilet paper dispenser with feminine napkin disposal. 	PCODE WG02BNT ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
25 Drinking fountain						
3101	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in good condition. • <i>As-is Measurement:</i> 39" • <i>Proposed Solution:</i> Remount fountain at accessible height. 	PCODE IA03C ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,200	\$1,200

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3102	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,900	\$1,900

26 Exit doors at east side

3103	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
------	--	---	---	-----	------	-------------

3104	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
------	--	--	---	-----	------	-------------

27 E.O.P.S./Tutoring Center (#160)

3105	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
------	--	---	---	-----	------	-------------

28 Counselor's offices (#161-163)

3106	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
------	--	---	---	-----	------	-------------

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3107	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 31" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	3	JOB	\$2,600	\$7,800
29 E.O.P.S. Room (#180)						
3108	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$250	\$500
3109	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
30 Room #30						
3110	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1		\$90	\$90
3111	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
Total Costs for Area/Floor: Upper Level					\$183,560.00	

Campus: **Kentfield Campus** Building/Part: **Learning Resources Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Learning Resources Center				\$374,745.00	

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Entrance doors at south side						
2456	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	2	JOB	\$90	\$180
2 Men's restrooms (#139-140)						
2457	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2458	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
2459	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 13 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
2460	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 2" fr latch</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</p>	<p>PCODE WC03B</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$2,050	\$2,050

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2461	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 2" • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID23B ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,600	\$2,600
2462	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 12" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,000	\$2,000
2463	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 29" from front edge • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03 ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,500	\$1,500
2464	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 22" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05 ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,500	\$1,500
2465	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06 ADAAG 4.17.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,500	\$1,500

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2466	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
2467	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$120	\$120
2468	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 1 sec • <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory. 	PCODE WD07A ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$600	\$600
2469	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 CSAS 1503.2.1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$4,000	\$4,000
2470	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02 ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,400	\$2,400
2471	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 63" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2472	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07</p> <p>Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$150	\$150
3 Women's restrooms (#144)						
2473	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9</p> <p>Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2474	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door is provided with braille text.</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. (women: 12" diam. circle, men: 12" triangle, unisex: combined symbol).</p>	<p>PCODE SA15NT CSAS 1115B.5</p> <p>Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
2475	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5</p> <p>Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
2477	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 56"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06 ADAAG 4.17.3</p> <p>Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1		\$1,500	\$1,500

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2478	<ul style="list-style-type: none"> • As-Built Description: Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet). • As-is Measurement: 50" from rear wall • Proposed Solution: Provide or relocate accessible side grab bar. 	PCODE WB07A ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$300	\$300
2479	<ul style="list-style-type: none"> • As-Built Description: Rear grab bar less than 36" long, or starting less than 42" from side wall. • As-is Measurement: 39" from side wall • Proposed Solution: Provide or relocate accessible rear grab bar. 	PCODE WB07B ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$300	\$300
2480	<ul style="list-style-type: none"> • As-Built Description: Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • As-is Measurement: 5" • Proposed Solution: Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
2481	<ul style="list-style-type: none"> • As-Built Description: Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • As-is Measurement: 4" • Proposed Solution: Provide recessed feminine napkin disposal container. 	PCODE WG02BNT ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
2482	<ul style="list-style-type: none"> • As-Built Description: Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock). • Proposed Solution: Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides. 	PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2483	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 63" S.C.D < 18" over grab bar • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$100	\$200
4 Unisex restrooms (# 142)						
2484	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2485	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door is provided with braile or raised text. • <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign. (women: 12" ø circle, men: 12" triangle, unisex: combined symbol). 	PCODE SA15NT CSAS 1115B.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
2486	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
2487	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>Proposed Solution:</i> Relocate or remove furniture or storage items. 	PCODE WB01NT CSAS 1115B.7.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2488	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet). • <i>As-is Measurement:</i> 48" from rear wall • <i>Proposed Solution:</i> Provide or relocate accessible side grab bar. 	P CODE WB07A ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$300	\$300
2489	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall. • <i>Proposed Solution:</i> Relocate existing grab bar 3" from C/L of wc. 	P CODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$300	\$300
2490	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Back grab bar not at 33" from floor (36" allowed at tank toilet). • <i>Proposed Solution:</i> Relocate grab bars. 	P CODE WB07GREF CSAS 1115B.8.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2491	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> T.P.D: 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	P CODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
2492	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> S.C.D: located < 18" above grab bar • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	P CODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
2493	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles not accessible or more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 53" • <i>Proposed Solution:</i> Provide specific restroom accessories. 	P CODE WG01 ADAAG 28 CFR 35.133(a) CSAS 1115.B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$200	\$200

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
5 Entrance lobby at south side						
2494	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Telephone: Clear floor space, 30" wide x 48" out from wall, not provided. • <i>As-is Measurement:</i> 28" wide • <i>Proposed Solution:</i> Provide clear space in front of telephone, 30" wide x 48" out from wall. 	PCODE IB01 ADAAG 4.31.2 CSAS 1117B.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,220	\$2,220
2495	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Telephone mounting height greater than 48" to highest operable part (only front reach available). • <i>As-is Measurement:</i> 60" • <i>Proposed Solution:</i> Relocate telephone to within 48" reach. 	PCODE IB09 ADAAG 4.31.3 CSAS 1118B.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
2496	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Signs directing persons to the location of public text telephones not provided where required. • <i>Proposed Solution:</i> Provide compliant directional signage. 	PCODE IB12 ADAAG 4.30.7(3) CSAS 3105A(d)2I(iii) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
2497	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • <i>As-is Measurement:</i> 20" protrusion at 31" high • <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface. 	PCODE EG04 ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$100	\$100
6 Associated students of emeritus college (# 146)						
2498	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2499	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 8 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
7 Private office (# 145)						
2500	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
8 Underside of stairs at central atrium						
2501	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • <i>Proposed Solution:</i> Provide cane-detectable railing to mark area of low clearance. 	PCODE EG04A ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	30	LF	\$100	\$3,000
9 Cafeteria						
2502	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route. • <i>Proposed Solution:</i> Provide directional sign. 	PCODE SA20 ADAAG 35.163(b) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$170	\$170
4995	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Alternate entry for disabled individuals not provided within 30' of turnstile or revolving door. • <i>Proposed Solution:</i> Provide accessible entry within 30' of revolving door/turnstile. 	PCODE IG01 ADAAG 4.13.2 CSAS 3304 (i.4) 2. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,628	\$1,628

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
10	Staff lounge					
2503	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 10" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
2504	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
2505	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 13 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$50	\$100
2506	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75
2507	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
11 Student club offices (# 112-115)						
2508	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	4		\$90	\$360
12 Student club offices (# 117-120)						
2509	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	4		\$90	\$360
13 Ascom (# 124)						
2510	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
Total Costs for					Area/Floor: Lower Level	\$32,893.00

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Main entrance at north end of the building						
2372	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
2373	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No directions posted at inaccessible entrance. • <i>Proposed Solution:</i> Provide sign directing people to accessible entrance. 	PCODE SA18 ADAAG 35.163(b) CSAS 1117B.5.7 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2 Transfer and career center (#202)						
2374	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 48" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
2375	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
2376	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Book shelves are more than 54" maximum height. • <i>As-is Measurement:</i> 68" • <i>Proposed Solution:</i> Provide attendant when needed. 	PCODE BD01A CSAS 1106B.4.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$0	

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2377	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
3 Meeting room a (# 203)						
2378	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2		\$90	\$180
2379	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 7 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$50	\$100
4 Drinking fountain at north side						
2380	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in good condition. • <i>As-is Measurement:</i> 38" • <i>Proposed Solution:</i> Remount fountain at accessible height. 	PCODE IA03CREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	REF		
2381	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in good condition. • <i>As-is Measurement:</i> 3" • <i>Proposed Solution:</i> Adjust water flow. 	PCODE IA03D ADAAG 4.15.3 CSAS 1507.3.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4996	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Oval and round drinking fountains: bubbler outlet more than 3" from front edge of fountain (CA only: all drinking fountain bubbler out lets more than 6" from front edge). • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03A ADAAG 4.15.3 CSAS 1507.3.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$2,000	\$2,000
5 Re-entry counseling (# 206)						
2382	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2383	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 7 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
6 Counseling rooms						
2385	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150
2386	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	14	JOB	\$90	\$1,260

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
7 Copy room (# 259)						
2387	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2388	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 8 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
8 Private office (# 258)						
2389	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2390	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 7 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
2391	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
9 Elevator						
2392	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Braille symbols on floor indicators of each elevator entrance jamb not compliant. • <i>Proposed Solution:</i> Provide compliant floor numbering on elevator door jambs. 	PCODE IK11NT CSAS 3003.4.16a Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	SET	\$50	\$100
10 Staircase on northside of atrium						
2393	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only). • <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area. 	PCODE II02B CSAS 1133B.4.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	22	LF	\$14	\$308
2394	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06A ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$320	\$640
11 Admissions and records (# 255)						
2395	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible service location not designated with appropriate sign. • <i>Proposed Solution:</i> Recommended: Provide permanent type signage designating accessible service counter. 	PCODE SA17NT ADAAG 35.163(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$110	\$110
2397	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
12 Admissions and records (# 254)						
2396	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2398	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Enrollment drop-box mounted with deposit slot higher than 48" • <i>Proposed Solution:</i> Remount drop box at accessible heigh. 	PCODE AB03CNT ADAAG 7.2(2) CSAS 3105A.(1)3 & Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,500	\$1,500
13 Private office (# 249)						
2399	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
2400	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75
2401	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 38" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
14 Storage room (# 250)						
2402	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$250	\$250
15 Private office (# 251)						
2403	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
16 Assoc. student office						
2404	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1		\$90	\$90
17 Student affair P.O.Box						
2405	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. • <i>As-is Measurement:</i> 13" protrusion at 36" high • <i>Proposed Solution:</i> Provide cane-detectable railing to mark area of low clearance. 	PCODE EG04A ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	6	LF	\$100	\$600
18 Non-fixed table at student affair office						
2406	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Recommended only: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. • <i>As-is Measurement:</i> 37" • <i>Proposed Solution:</i> Provide table or desk with accessible dimesiones when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$1,600	\$1,600

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
19 Drinking fountain at south side						
2407	<p>• <i>As-Built Description:</i> No sign at non-accessible room or space directing persons to an accessible that provides the same or equivalent service.</p> <p>• <i>Proposed Solution:</i> Provide directional sign.</p>	<p>PCODE SA19</p> <p>ADAAG 35.163(b); 4.1.6(3)(e)(iii)</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2408	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02BREF</p> <p>ADAAG 4.15.5(1) & Fig.27(a)</p> <p>CSAS 1507.3.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		
20 Electrical room (# 242)						
2409	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE ID07C</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$250	\$250
21 Testing room (# 238)						
2410	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2411	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2412	<ul style="list-style-type: none"> • As-Built Description: At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • Proposed Solution: Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$75	\$75
2413	<ul style="list-style-type: none"> • As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • Proposed Solution: Change door latch/hinge side. 	PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$500	\$500
22 Main entrance at south end of the building						
2414	<ul style="list-style-type: none"> • As-Built Description: At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • Proposed Solution: Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$90	\$180
23 Staircase at south side of atrium						
2415	<ul style="list-style-type: none"> • As-Built Description: Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only). • Proposed Solution: Provide 2" wide contrasting color strip 1" from nosing on top & bottom treads when altering area. 	PCODE H02B CSAS 1133B.4.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	22	LF	\$14	\$308
2416	<ul style="list-style-type: none"> • As-Built Description: Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser. • Proposed Solution: Extend stair handrail at top and bottom (cost for both extensions). 	PCODE ED06A ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	2	JOB	\$320	\$640

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
24 Office (# 235)						
2417	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90
25 Financial Aid Office(# 236)						
2418	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1		\$90	\$90
2419	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$50	\$50
2420	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible service location not designated with appropriate sign. • <i>Proposed Solution:</i> Provide signage designating accessible service counter. 	PCODE SA17 ADAAG 35.163(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$110	\$110
26 Private Office (# 234)						
2421	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
27 Job placement office (# 234)						
2422	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2423	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$50	\$50
2424	<p>• <i>As-Built Description:</i> Accessible service location not designated with appropriate sign.</p> <p>• <i>Proposed Solution:</i> Provide signage designating accessible service counter.</p>	<p>PCODE SA17 ADAAG 35.163(a) Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$110	\$110
28 Private office (# 230)						
2425	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
29 Private office (# 231)						
2426	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope</p>	1		\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
30	Men's restrooms (# 245)					
2427	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$90	\$90
2429	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1		\$100	\$100
2430	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 39" fr face of door</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</p>	<p>PCODE WC03BREF</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		
2431	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01AREF</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		
2432	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 30" from front edge of wc</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB03REF</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2433	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2434	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2435	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07REF ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2436	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05REF ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2437	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 1 sec. • <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory. 	PCODE WD07AREF ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2438	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01REF CSAS 1503.2.1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2439	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2440	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 65" S.D: 49" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01AREF ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2441	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02BREF ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
4997	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. • <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 CSAS 1115B.7.1 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$23,000	\$23,000
31 Women's restrooms (# 243)						
2442	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage. • <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille. 	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2443	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>	1	JOB	\$100	\$100
2444	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 39" from face of door</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</p>	<p>PCODE WC03BREF</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		
2445	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01AREF</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		
2446	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 30" from edge of wc</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB03REF</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		
2447	<p>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</p> <p>• <i>As-is Measurement:</i> 24"</p> <p>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</p>	<p>PCODE WB05REF</p> <p>ADAAG 4.17.5</p> <p>CSAS 1115B.7.1.4</p> <p>Year Mitigated TBD</p> <p>DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013</p> <p>Funding TBD</p> <p>Mitigation Note Pending - Client Approval Of Scope</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2448	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2449	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07REF ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2450	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05REF ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2451	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds. • <i>As-is Measurement:</i> 1 sec • <i>Proposed Solution:</i> Replace self-closing faucet at accessible lavatory. 	PCODE WD07AREF ADAAG 4.19.5 CSAS 1504.2..1 C.P.C. Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2454	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 65" S.D: 49" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01AREF ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		
2455	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02BREF ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013 Funding TBD Mitigation Note Pending - Client Approval Of Scope		REF		

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4998	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. • <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 CSAS 1115B.7.1	1	JOB	\$23,000	\$23,000
		Year Mitigated TBD				
		DSA App. # Pending - To Be Submitted By Ssa On 12/1/2013				
		Funding TBD				
		Mitigation Note <i>Pending - Client Approval Of Scope</i>				
Total Costs for		Area/Floor: Upper level		\$60,226.00		

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Student Services Buidling				\$93,119.00	

Campus: **Kentfield Campus** Building/Part: **Student Services Buidling** Area/Floor: **Upper level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Grand Total for	Campus: Kentfield Campus				\$525,465.00	

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1 Main entrance door						
3112	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$50	\$100
3113	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high. • <i>As-is Measurement:</i> 2" • <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed. 	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated TBD DSA App. # TBD Funding TBD	50	SF	\$12	\$600
3114	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible building entrance when not all are accessible not identified with a sign showing the International Symbol of Accessibility. • <i>As-is Measurement:</i> 2" • <i>Proposed Solution:</i> Provide building entrance sign that shows international symbol at accessible entrance. 	PCODE SA12 ADAAG 4.1.2(7)(c) CSAS 1117B.5.7 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$50	\$50
2 Campus Police Counter						
3115	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-is Measurement:</i> 40" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$150	\$150
3116	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3 Classroom #101						
3117	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1		\$250	\$250
3118	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
3119	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,600	\$2,600
4 Classroom #102						
3120	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3121	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
3122	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
5 Classroom #103						
3123	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$250	\$500
3124	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
3125	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$2,600	\$5,200
3126	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>As-is Measurement:</i> 7.5" • <i>Proposed Solution:</i> Change hinge/latch side. 	PCODE ID23NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$500	\$500
6 Classroom #119						
3127	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 31" • <i>Proposed Solution:</i> Install off-set hinges to increase door opening to clear frame width (32" min.). 	PCODE ID01A ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$500	\$1,000

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3128	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
3129	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$250	\$500
3130	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$50	\$100
7 Private office #142						
3131	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3132	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$50	\$50
3133	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
8 Room #120						
3134	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1		\$90	\$90
3135	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3136	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$50	\$50
3137	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 31" • <i>Proposed Solution:</i> Install off-set hinges to increase door opening to clear frame width (32" min.). 	PCODE ID01A ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$500	\$500
9 Private office (#121)						
3138	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3139	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$50	\$50
3140	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$90	\$90
3141	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Install off-set hinges to increase door opening to clear frame width (32" min.).</p>	<p>PCODE ID01A</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$500	\$500
10 Open office space (#124)						
3142	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	2	JOB	\$250	\$500
3143	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$90	\$90
3144	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Install off-set hinges to increase door opening to clear frame width (32" min.).</p>	<p>PCODE ID01A</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	2	JOB	\$500	\$1,000

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
11 Room #s 127-128						
3145	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$250	\$500
3146	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 31" • <i>Proposed Solution:</i> Install off-set hinges to increase door opening to clear frame width (32" min.). 	PCODE ID01A ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$500	\$1,000
3147	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$50	\$100
3148	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
12 Classroom #129						
3149	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$250	\$1,000
3150	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3151	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	4	JOB	\$50	\$200
3152	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Install off-set hinges to increase door opening to clear frame width (32" min.).</p>	<p>PCODE ID01A</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	4	JOB	\$500	\$2,000
13 Fire exit doors						
3153	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 & 6</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	2	JOB	\$90	\$180
3154	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>Proposed Solution:</i> Provide panic hardware.</p>	<p>PCODE ID24NT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	2	JOB	\$500	\$1,000
14 Drinking fountain						
3155	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02</p> <p>ADAAG 4.15.5(1)</p> <p>CSAS 1507.3.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$1,850	\$1,850

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3156	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$1,900	\$1,900
15 Men's restrooms						
3157	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15 CSAS 1115B.5 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$100	\$100
3158	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$90	\$90
3159	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 29"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$2,600	\$2,600
3160	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 42" deep</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID27BREF ADAAG Fig. 25(c) CSAS 11B-26A(c) Year Mitigated TBD DSA App. # TBD Funding TBD</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3161	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side. • <i>As-is Measurement:</i> 42" deep • <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed. 	PCODE WC03B CSAS Fig.No.31-1B Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,050	\$2,050
3162	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$120	\$120
3163	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 52" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$150	\$150
3164	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 58" A.F.F. • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$100	\$100
3165	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 CSAS 1503.2.1 C.P.C. Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$4,000	\$4,000
3166	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-is Measurement:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 CSAS 1503.2 C.P.C. Year Mitigated TBD DSA App. # TBD Funding TBD		REF		

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3167	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 50" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$500	\$500
3168	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,000	\$2,000
3169	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3170	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3171	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 26" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3172	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5-1/2" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3173	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$500	\$500
3174	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$100	\$100
3175	<p>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</p> <p>• <i>As-is Measurement:</i> 16.5"</p> <p>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</p>	<p>PCODE WB02 ADAAG 4.17.3 CSAS 1115B.7.1.3</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$4,600	\$4,600
16 Women's restrooms						
3176	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15 CSAS 1115B.5</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$100	\$100
3177	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3178	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,600	\$2,600
3179	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60"). • <i>As-is Measurement:</i> 42" deep • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID27BREF ADAAG Fig. 25(c) CSAS 11B-26A(c) Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3180	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side. • <i>As-is Measurement:</i> 42" deep • <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed. 	PCODE WC03B CSAS Fig.No.31-1B Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,050	\$2,050
3181	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered. • <i>Proposed Solution:</i> Insulate or cover water/drain pipe. 	PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$120	\$120
3182	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor. • <i>As-is Measurement:</i> 52" • <i>Proposed Solution:</i> Relocate or provide new accessible mirror. 	PCODE WG03 ADAAG 4.19.6 CSAS 1115B.9.1.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$150	\$150
3183	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. • <i>As-is Measurement:</i> P.T.D: 58" A.F.F. • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$100	\$100

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3187	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 11" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,000	\$2,000
3188	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 32" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3189	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 30" • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3190	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). • <i>As-is Measurement:</i> 26" • <i>Proposed Solution:</i> Provide new partition and stall door with compliant width. 	PCODE WB05REF ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3191	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5-1/2" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$150	\$150
3192	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6* CSAS 1115B.8 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$500	\$500

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3193	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE WB05C ADAAG 4.17.5 CSAS 1115B.7.1.4 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$100	\$100
3194	<p>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</p> <p>• <i>As-is Measurement:</i> 16.5"</p> <p>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</p>	<p>PCODE WB02 ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$4,600	\$4,600
17 Reception room #105						
3195	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$90	\$90
3196	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$250	\$250
3197	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 29"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$2,600	\$2,600

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
18 Patrol office #107						
3198	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
3199	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3200	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,600	\$2,600
19 Women's locker room #106						
3201	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,600	\$2,600
3202	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3203	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3204	<p>• <i>As-Built Description:</i> "Adequate wheelchair space between lockers and benches not provided (44" width needed)."</p> <p>• <i>Proposed Solution:</i> Remove and relocate bench and patch floor to provide adequate wheelchair space between locker and bench.</p>	<p>PCODE GG01</p> <p>-</p> <p>CSAS 3103(a)2D(5)</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$150	\$150
3205	<p>• <i>As-Built Description:</i> "Lockers not at proper height for disabled persons (maximum height 54" to hooks, shelves, etc.)."</p> <p>• <i>Proposed Solution:</i> "Make hook/shelf height comply with 54" maximum."</p>	<p>PCODE GG02</p> <p>-</p> <p>CSAS 3103(a)2D(5)</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$450	\$450
20 Interview room #108						
3206	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$90	\$90
3207	<p>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</p> <p>• <i>As-is Measurement:</i> 29"</p> <p>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</p>	<p>PCODE ID01</p> <p>ADAAG 4.13.5</p> <p>CSAS 1003.3.1.3a</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$2,600	\$2,600
21 Chief's room #110						
3208	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$90	\$90
3209	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$250	\$250

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3210	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,600	\$2,600
22 Men's locker room #113						
3211	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
3212	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3213	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,600	\$2,600
3214	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Adequate wheelchair space between lockers and benches not provided (44" width needed)." • <i>Proposed Solution:</i> Remove and relocate bench and patch floor to provide adequate wheelchair space between locker and bench. 	PCODE GG01 - CSAS 3103(a)2D(5) Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$150	\$150
3215	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Lockers not at proper height for disabled persons (maximum height 54" to hooks, shelves, etc.)." • <i>Proposed Solution:</i> "Make hook/shelf height comply with 54" maximum." 	PCODE GG02 - CSAS 3103(a)2D(5) Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$450	\$450

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
23 Room #s114-117						
3216	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$90	\$360
3217	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$250	\$1,000
3218	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high). • <i>As-is Measurement:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 CSAS 1003.3.1.3a Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$2,600	\$10,400
24 Exit doors						
3219	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
Total Costs for					Area/Floor: Lower Level	\$89,010.00

Campus: **Kentfield Campus** Building/Part: **Temporary Building-1** Area/Floor: **Lower Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Temporary Building-1				\$89,010.00	

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1	Lecture room (#101)					
3220	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	3	JOB	\$90	\$270
3221	<p>• <i>As-Built Description:</i> At room with 51-300 fixed seats, fewer than required number of wheelchair seating spaces provided; 4 spaces required.</p> <p>• <i>Proposed Solution:</i> Provide 33" x 60" wheelchair spaces and work surfaces.</p>	<p>PCODE CB02C ADAAG 4.1.3(19)a Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$760	\$760
3222	<p>• <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06B ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	4	JOB	\$300	\$1,200
3223	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	3	JOB	\$50	\$150
3224	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD</p>	3	JOB	\$90	\$270

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3225	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$250	\$500
2 Classroom (#102)						
3226	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$50	\$100
3227	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
3228	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3229	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24"). • <i>Proposed Solution:</i> Change hinge/latch side. 	PCODE ID23NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$500	\$500
3 Classroom (#104)						
3230	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4 Facility offices(#107-110)						
3231	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	4		\$90	\$360
3232	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$250	\$1,000
5 Engineering Materials Lab (#111)						
3233	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
3234	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$50	\$50
3235	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Fixed desk, counter, etc. less than 28"" or more than 34"" in height, or knee space 27"" high x 19"" deep x 30"" wide not provided." • <i>As-is Measurement:</i> 37" high • <i>Proposed Solution:</i> Provide or modify accessible desk/work space for instructor. 	PCODE LD ADAAG 4.32.3 & 4.32.4 CSAS 3105(n) Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,876	\$2,876

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
6 Classroom #115						
3236	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
3237	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$50	\$100
7 Faculty offices #118-119						
3238	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
3239	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$250	\$500
8 Drinking fountain adjacent to room #120						
3240	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back). • <i>As-is Measurement:</i> 12" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,000	\$2,000

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3241	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition. • <i>As-is Measurement:</i> 39" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3242	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$1,900	\$1,900
9 Physics Laboratory #120						
3243	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$90	\$270
3244	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$50	\$150
3245	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Recommended only: Non-fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided. • <i>Proposed Solution:</i> Provide accessible desk/work space for instructor. 	PCODE LD01 ADAAG 4.32.3 & 4.32.4 CSAS 3105(n) Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$1,197	\$1,197

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3246	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only). • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A CSAS 1133B.2.6 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$75	\$75
3247	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Sink has more than 34"" rim height from floor." • <i>As-is Measurement:</i> 37" • <i>Proposed Solution:</i> "Modify, or provide new accessible sink." 	PCODE LF01B ADAAG 4.19.2 CSAS 1504(a) C.P.C. Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,000	\$2,000
10 Classroom #124						
3248	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
11 Classroom #125						
3249	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
3250	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 11 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
12 Faculty offices (#127-129)						
3251	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$90	\$270
3252	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$250	\$750
13 Faculty offices (#147-150)						
3253	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$90	\$360
3254	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$250	\$1,000
14 Rooms (#s151-153, 156-157)						
3255	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	5	JOB	\$90	\$450
3256	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	5	JOB	\$250	\$1,250

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
15	Chemestry Laboratories (#s154,155-158)					
3257	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Fixed desk, counter, etc. less than 28"" or more than 34"" in height, or knee space 27"" high x 19"" deep x 30"" wide not provided." • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> Provide or modify accessible desk/work space for instructor. 	PPCODE LD ADAAG 4.32.3 & 4.32.4 CSAS 3105(n) Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$2,876	\$8,628
3258	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Sink has more than 34"" rim height from floor." • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> "Modify, or provide new accessible sink." 	PPCODE LF01B ADAAG 4.19.2 CSAS 1504(a) C.P.C. Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$2,000	\$6,000
3259	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors). 	PPCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$50	\$150
3260	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PPCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$90	\$270
3261	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-is Measurement:</i> 27" • <i>Proposed Solution:</i> Provide new, unequal width door leafs in existing frame for pair of doors. 	PPCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$1,500	\$1,500

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
16 Faculty rooms (#s160, 161)						
3262	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
3263	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$250	\$500
17 Geology Labs (#s159 and 166)						
3264	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	2		\$250	\$500
3265	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$90	\$270
3266	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$50	\$150
3267	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Fixed desk, counter, etc. less than 28"" or more than 34"" in height, or knee space 27"" high x 19"" deep x 30"" wide not provided." • <i>As-is Measurement:</i> 25" high knee space • <i>Proposed Solution:</i> Provide or modify accessible desk/work space for instructor. 	PCODE LD ADAAG 4.32.3 & 4.32.4 CSAS 3105(n) Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$2,876	\$5,752

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3268	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Sink has more than 34"" rim height from floor." • <i>As-is Measurement:</i> 36" • <i>Proposed Solution:</i> "Modify, or provide new accessible sink." 	PCODE LF01B ADAAG 4.19.2 CSAS 1504(a) C.P.C. Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,000	\$2,000
18 Faculty rooms (#s162-165)						
3269	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$90	\$360
3270	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$250	\$1,000
19 Drinking fountain adjacent to room #167						
3271	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back). • <i>As-is Measurement:</i> 12" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,000	\$2,000
3272	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$1,900	\$1,900
3273	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition. • <i>As-is Measurement:</i> 39" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
20 Geology museum						
3274	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$250	\$500
3275	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
21 Faculty rooms (#172-175)						
3276	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2		\$90	\$180
3277	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$250	\$1,000
22 Anatomy/Physiology Lab						
3278	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3279	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 12 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$50	\$50
3280	<p>• <i>As-Built Description:</i> "Fixed desk, counter, etc. less than 28"" or more than 34"" in height, or knee space 27"" high x 19"" deep x 30"" wide not provided."</p> <p>• <i>As-is Measurement:</i> 37"</p> <p>• <i>Proposed Solution:</i> Provide or modify accessible desk/work space for instructor.</p>	<p>PCODE LD</p> <p>ADAAG 4.32.3 & 4.32.4</p> <p>CSAS 3105(n)</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$2,876	\$2,876
3281	<p>• <i>As-Built Description:</i> "Sink has more than 34"" rim height from floor."</p> <p>• <i>As-is Measurement:</i> 37"</p> <p>• <i>Proposed Solution:</i> "Modify, or provide new accessible sink."</p>	<p>PCODE LF01B</p> <p>ADAAG 4.19.2</p> <p>CSAS 1504(a) C.P.C.</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$2,000	\$2,000
23 Classroom #177						
3282	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$90	\$90
3283	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
24 Room #178						
3284	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area. 	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3285	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
25 Life Science Museum (#179)						
3286	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1		\$90	\$90
3287	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3288	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$50	\$100

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3289	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-is Measurement:</i> 1" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$50	\$50
26 Faculty offices (#180-183)						
3290	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$90	\$360
3291	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$250	\$1,000
27 Biology Laboratories (#184-185)						
3292	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
3293	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds. • <i>As-is Measurement:</i> 8 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors). 	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$50	\$100

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3294	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Sink has more than 34"" rim height from floor." • <i>As-is Measurement:</i> 37" • <i>Proposed Solution:</i> "Modify, or provide new accessible sink." 	PCODE LF01B ADAAG 4.19.2 CSAS 1504(a) C.P.C. Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$2,000	\$4,000
3295	<ul style="list-style-type: none"> • <i>As-Built Description:</i> "Fixed desk, counter, etc. less than 28"" or more than 34"" in height, or knee space 27"" high x 19"" deep x 30"" wide not provided." • <i>As-is Measurement:</i> 37" • <i>Proposed Solution:</i> Provide or modify accessible desk/work space for instructor. 	PCODE LD ADAAG 4.32.3 & 4.32.4 CSAS 3105(n) Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$2,876	\$5,752
28 Faculty offices (#186-189)						
3296	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$90	\$360
3297	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	4	JOB	\$250	\$1,000
29 Biology Laboratories (#190-191)						
3298	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3299	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 8 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	2	JOB	\$50	\$100
3300	<p>• <i>As-Built Description:</i> "Sink has more than 34"" rim height from floor."</p> <p>• <i>As-is Measurement:</i> 37"</p> <p>• <i>Proposed Solution:</i> "Modify, or provide new accessible sink."</p>	<p>PCODE LF01B</p> <p>ADAAG 4.19.2</p> <p>CSAS 1504(a) C.P.C.</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	2	JOB	\$2,000	\$4,000
3301	<p>• <i>As-Built Description:</i> "Fixed desk, counter, etc. less than 28"" or more than 34"" in height, or knee space 27"" high x 19"" deep x 30"" wide not provided."</p> <p>• <i>As-is Measurement:</i> 37"</p> <p>• <i>Proposed Solution:</i> Provide or modify accessible desk/work space for instructor.</p>	<p>PCODE LD</p> <p>ADAAG 4.32.3 & 4.32.4</p> <p>CSAS 3105(n)</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	2	JOB	\$2,876	\$5,752
30 Faculty offices (#192-195)						
3302	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	4	JOB	\$90	\$360
3303	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	4	JOB	\$250	\$1,000

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
31 Drinking fountain adjacent to room #191						
3304	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back). • <i>As-is Measurement:</i> 12" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,000	\$2,000
3305	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition. • <i>As-is Measurement:</i> 39" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3306	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$1,900	\$1,900
32 Rooms #196-197						
3307	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
3308	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$250	\$500
33 Preparations and projections (#134-135)						
3309	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$90	\$270

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3310	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	3	JOB	\$250	\$750
34 Faculty Mail Room #137						
3311	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
3312	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
35 Classroom #133						
3313	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1		\$250	\$250
3314	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180
3315	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
36 Classroom #105						
3316	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3317	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90
37 Classroom #130						
3318	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1		\$90	\$90
38 Computer room #144-146						
3319	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	2		\$90	\$180
39 Private office #140						
3320	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$250	\$250
3321	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. • <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille. 	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$90	\$90

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
40	Men's restrooms					
3322	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$100	\$100
3323	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$90	\$90
3324	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 44"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</p>	<p>PCODE WC03B</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$2,050	\$2,050
3325	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 44"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID27BREF</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>		REF		
3326	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$50	\$50

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3327	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE WD05 ADAAG 4.19.4 CSAS 1504.2.2</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	6	JOB	\$120	\$720
3328	<p>• <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.</p> <p>• <i>As-is Measurement:</i> 12" projection at 28"</p> <p>• <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface.</p>	<p>PCODE EG04 ADAAG 4.4.1 CSAS 1121B.1</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$100	\$100
3329	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 48" S.D: 44"</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	2	JOB	\$100	\$200
3330	<p>• <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.</p> <p>• <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory.</p>	<p>PCODE WD06 ADAAG 4.19.5 CSAS 1504.1.3</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$600	\$600
3331	<p>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE WE01 CSAS 1503.2.1 C.P.C.</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$4,000	\$4,000
3332	<p>• <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor.</p> <p>• <i>As-is Measurement:</i> 24"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE WE02REF ADAAG 4.18.2 CSAS 1503.2 C.P.C.</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3333	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate. • <i>As-is Measurement:</i> 52" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$500	\$500
3334	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture. • <i>As-is Measurement:</i> 14" • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A CSAS 1115B.7.3 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,000	\$2,000
3335	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 42" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3336	<ul style="list-style-type: none"> • <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet. • <i>As-is Measurement:</i> 20.5" • <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02A ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$4,600	\$4,600
3337	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 44" from front edge of wc. • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated TBD DSA App. # TBD Funding TBD		REF		
3338	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall. • <i>As-is Measurement:</i> 39" from side wall • <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar. 	PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$300	\$300

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3339	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$150	\$150
41 Women's restrooms						
3340	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15 CSAS 1115B.5</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$100	\$100
3341	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$90	\$90
3342	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 44"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</p>	<p>PCODE WC03B CSAS Fig.No.31-1B</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>	1	JOB	\$2,050	\$2,050
3343	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 44"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID27BREF ADAAG Fig. 25(c) CSAS 11B-26A(c)</p> <p>Year Mitigated TBD DSA App. # TBD Funding TBD</p>		REF		

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3344	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 & 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$50	\$50
3345	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE WD05</p> <p>ADAAG 4.19.4</p> <p>CSAS 1504.2.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	6	JOB	\$120	\$720
3346	<p>• <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.</p> <p>• <i>As-is Measurement:</i> 12" projection at 28"</p> <p>• <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface.</p>	<p>PCODE EG04</p> <p>ADAAG 4.4.1</p> <p>CSAS 1121B.1</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$100	\$100
3347	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 48" S.D: 44"</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE WG01A</p> <p>ADAAG 28 CFR 35.133(a)</p> <p>CSAS 1115B.9.2</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	2	JOB	\$100	\$200
3348	<p>• <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.</p> <p>• <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory.</p>	<p>PCODE WD06</p> <p>ADAAG 4.19.5</p> <p>CSAS 1504.1.3</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$600	\$600
3349	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 14"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated TBD</p> <p>DSA App. # TBD</p> <p>Funding TBD</p>	1	JOB	\$2,000	\$2,000

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3350	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-is Measurement:</i> 42" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 Year Mitigated TBD DSA App. # TBD Funding TBD				
3351	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall). • <i>As-is Measurement:</i> 44" from front edge of wc • <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB03REF ADAAG 4.17.3 CSAS 1115B.7.2 Year Mitigated TBD DSA App. # TBD Funding TBD				
3352	<ul style="list-style-type: none"> • <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet. • <i>As-is Measurement:</i> 20.5" • <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02A ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$4,600	\$4,600
3353	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall. • <i>As-is Measurement:</i> 39" from side wall • <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar. 	PCODE WB07BNT ADAAG 4.17.6 CSAS 1115B.8.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$300	\$300
3354	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 5" • <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container. 	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$150	\$150
4999	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet. • <i>As-is Measurement:</i> 4" • <i>Proposed Solution:</i> Replace with feminine napkin disposal container. 	PCODE WG02BNT ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$150	\$150

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total	
42 Drinking fountain adjacent to restrooms							
3355	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back). • <i>As-is Measurement:</i> 12" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$2,000	\$2,000	
3356	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fountain bubbler not easily activated by lever, push bar, or other accessible control. • <i>As-is Measurement:</i> 39" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03REF ADAAG 4.27.4 CSAS 1507.3.3 Year Mitigated TBD DSA App. # TBD Funding TBD		REF			
3357	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons. • <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor." 	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated TBD DSA App. # TBD Funding TBD	1	JOB	\$1,900	\$1,900	
43 Main entrance/exit doors to central court							
3358	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated TBD DSA App. # TBD Funding TBD	2	JOB	\$90	\$180	
Total Costs for					Area/Floor: Upper Level	\$122,898.00	

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for	Building/Part: Science Center				\$122,898.00	

Campus: **Kentfield Campus** Building/Part: **Science Center** Area/Floor: **Upper Level**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Grand Total for	Campus: Kentfield Campus				\$211,908.00	