

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Building/Location	Floor/Area	Item #	Item Name	Specific Item	Problem Description	Solution Cost	1994 ADA	2001 CBC	RESOLVED	PENDING	NOTES ON ESTIMATE	SOURCE DOCUMENT		
Exterior	On-site	1	Accessible Parking at Parking Lot #3	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	\$5,000.00	Fig.9	1129B.4.3	\$5,000.00		completed as part of FA			
Exterior	On-site	1	Accessible Parking at Parking Lot #3	Parking	Accessible parking space has slope greater than 1/4":12" (2%).	\$10,800.00	4.6.3	1129B.4.4	\$10,800.00			2004 Access Compliance Survey Report Sally Swanson Architects		
Exterior	On-site	2	P.O.T. from Intersection of St. Francis & Elm to Parking Lot #3	Sidewalk	Cross slope more than 1/4":12" (2%).	\$4,200.00	4.3.7	1133B.7.1.3	?	\$4,200.00		2004 Access Compliance Survey Report Sally Swanson Architects		
Exterior	On-site	3	Box Office Counter at Fine Arts Building	Counter	Counter top exceeds 36". Complex code issue: Provision of auxiliary counter per ADAAG triggers California requirement for 34" high full counter.	\$2,500.00	7.2(1)	1122B.4	\$2,500.00		Completed in PA project		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	4	Grove to the East of Dickson Hall	Disabled Seating	Wheelchair space (33" x 48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat).	\$450.00	4.2.4	1104.3.6	\$450.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	4	Grove to the East of Dickson Hall	Sidewalk	Paved area has excessively rough, irregular surface.	\$3,600.00	4.5.2	1133B.7.1	\$3,600.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas)	\$19,000.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$19,000.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.		4.9.4(5)	1133B.4.2.1 & B.5.5.1			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Handrail	Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).	\$18,000.00		CBC 509	\$18,000.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Ramp	Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60).		Fig. 25	Tbl. 11B-38(a)			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Ramp	Ramp: Slope greater than 1:12 (8.3%).	\$75,000.00	4.8.2	1133.B.5.3	\$75,000.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Ramp	Ramp: Pavement dislocation creates abrupt change in level exceeding 1/2" in ramp.		4.5.2	1133B.7.1			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Ramp	Ramp: Rise more than 30" between landings.		4.8.2	1133B.5.4.1			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Ramp	Landing at change of direction not at least 60" x 60" (CA only: 72" x width of ramp runs).		4.8.4(3)	1133B.5.4			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	5	Ramp/Stairs to the North of Dickson Hall	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$900.00		1133B.4.4	\$900.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	6	Accessible Entrance to Fine Arts Building from Parking Lot #4	Ramp	CA only: Top landing less than 60" x 60".	\$600.00		1133B.5.4.2	\$600.00		Completed in PA project		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	6	Accessible Entrance to Fine Arts Building from Parking Lot #4	Ramp	Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60).		Fig. 25	Tbl. 11B-38(a)			Completed in PA project		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	6	Accessible Entrance to Fine Arts Building from Parking Lot #4	Ramp	CA only: Ramp landing does not extend 24" (at exterior ramp) or 18" (at interior ramp) past the strike edge of door or gate.			1133B.5.4.4			Completed in PA project		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	7	Accessible Parking at Parking Lot #4	Parking	Accessible parking space has slope greater than 1/4":12" (2%).	\$480.00	4.6.3	1129B.4.4	\$480.00		Completed in SMN lot		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	7	Accessible Parking at Parking Lot #4	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	\$12,000.00	Fig.9	1129B.4.3	\$12,000.00		Completed in SMN lot		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	7	Accessible Parking at Parking Lot #4	Parking	Parking-ticket vending machine is not accessible.	\$2,500.00	4.6.1		\$2,500.00		Completed in SMN lot		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	7	Accessible Parking at Parking Lot #4	Parking Signage	Sign for accessible parking space is missing or non-compliant.	\$315.00	4.6.4	1129B.5	\$315.00		Completed in SMN lot		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	7	Accessible Parking at Parking Lot #4	Ramp	Ramp: Slope greater than 1:12 (8.3%).	\$100.00	4.8.2	1133.B.5.3	\$100.00		Completed in SMN lot		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	8	Accessible Entrance to Dickson Hall from Parking Lot #4	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas)	\$4,750.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$4,750.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	8	Accessible Entrance to Dickson Hall from Parking Lot #4	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.		4.9.4(5)	1133B.4.2.1 & B.5.5.1			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	8	Accessible Entrance to Dickson Hall from Parking Lot #4	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	8	Accessible Entrance to Dickson Hall from Parking Lot #4	Ramp	Ramp: Slope greater than 1:12 (8.3%).	\$20,000.00	4.8.2	1133.B.5.3	\$20,000.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	8	Accessible Entrance to Dickson Hall from Parking Lot #4	Ramp	Ramp: Rise more than 30" between landings.		4.8.2	1133B.5.4.1			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	8	Accessible Entrance to Dickson Hall from Parking Lot #4	Ramp	CA only: Top landing less than 60" x 60".			1133B.5.4.2			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	8	Accessible Entrance to Dickson Hall from Parking Lot #4	Signage	No sign at inaccessible ramp directing persons to an accessible route.	\$250.00	35.163(b)		\$250.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	9	Staircase to Upper Level of Dance/Landscape Building	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$340.00	4.9.4(2)	1133B.4.2.2	\$340.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	9	Staircase to Upper Level of Dance/Landscape Building	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$1,350.00		1133B.4.4	\$1,350.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	10	Ramp to the East end of Dance/Landscape Building	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$2,625.00	4.9.4(5)	1133B.4.2.1 & B.5.5.	\$2,625.00		Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	10	Ramp to the East end of Dance/Landscape Building	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1			Demolished		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	11	Steps to the West of Fusselman Hall	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$375.00	4.9.4(5)	1133B.4.2.1 & B.5.5.1		\$375.00		2004 Access Compliance Survey Report Sally Swanson Architects		
Exterior	On-site	11	Steps to the West of Fusselman Hall	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2				2004 Access Compliance Survey Report Sally Swanson Architects		
Exterior	On-site	11	Steps to the West of Fusselman Hall	Signage	No signs at non-accessible entrances directing persons to an accessible entrance of the building.	\$230.00	4.1.2(7)(c)	1117B.5.7		\$230.00		2004 Access Compliance Survey Report Sally Swanson Architects		
Exterior	On-site	11	Steps to the West of Fusselman Hall	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$450.00		1133B.4.4	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects		
Exterior	On-site	12	Lower-Level Ramp to Elevator in Fusselman Hall	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas)	\$3,800.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$3,800.00		Completed in SMN proje		2004 Access Compliance Survey Report Sally Swanson Architects	
Exterior	On-site	12	Lower-Level Ramp to Elevator in Fusselman Hall	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.		4.9.4(5)	1133B.4.2.1 & B.5.5.1			Completed in SMN proje		2004 Access Compliance Survey Report Sally Swanson Architects	

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Exterior	On-site	12	Lower-Level Ramp to Elevator in Fusselman Hall	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1			Completed in SMN proje	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	12	Lower-Level Ramp to Elevator in Fusselman Hall	Ramp	Ramp: Slope greater than 1:12 (8.3%).	\$15,000.00	4.8.2	1133.B.5.3	\$15,000.00		Completed in SMN proje	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	12	Lower-Level Ramp to Elevator in Fusselman Hall	Ramp	Ramp: Rise more than 30" between landings.		4.8.2	1133B.5.4.1			Completed in SMN proje	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	12	Lower-Level Ramp to Elevator in Fusselman Hall	Ramp	Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60).		Fig. 25	Ibl. 11B-38(a)			Completed in SMN proje	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	13	Accessible P.O.T. to the South of Fusselman Hall	Sidewalk	Cross slope more than 1/4":12" (2%).	\$1,800.00	4.3.7	1133B.7.1.3		\$1,800.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	13	Accessible P.O.T. to the South of Fusselman Hall	Signage	No sign at inaccessible ramp directing persons to an accessible route.	\$250.00	35.163(b)			\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	14	Steps to the North of the Student Services Building	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$1,900.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1		\$1,900.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	14	Steps to the North of the Student Services Building	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$2,700.00		1133B.4.4		\$2,700.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	15	Accessible Ramp on the North side of the Student Services Building	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$4,500.00	4.9.4(5)	1133B.4.2.1 & B.5.5.1		\$4,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	15	Accessible Ramp on the North side of the Student Services Building	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	15	Accessible Ramp on the North side of the Student Services Building	Ramp	Ramp: Slope greater than 1:12 (8.3%).	\$25,000.00	4.8.2	1133.B.5.3		\$25,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	15	Accessible Ramp on the North of the Student Services Building	Ramp	Landing at change of direction not at least 60"x60" (CA only; 72"x width of ramp runs).		4.8.4(3)	1133B.5.4				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	16	Steps leading up to the Campus Greens from Student Services	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$2,375.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1		\$2,375.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	16	Steps leading up to the Campus Greens from Student Services	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.		4.9.4(5)	1133B.4.2.1 & B.5.5.1				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	16	Steps leading up to the Campus Greens from Student Services	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	16	Steps leading up to the Campus Greens from Student Services	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$2,250.00		1133B.4.4		\$2,250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	17	Upper-Level Ramp to Elevator in Fusselman Hall	Handrail	Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).	\$600.00		CBC 509		\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	17	Upper-Level Ramp to Elevator in Fusselman Hall	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$2,850.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1		\$2,850.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	17	Upper-Level Ramp to Elevator in Fusselman Hall	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.		4.9.4(5)	1133B.4.2.1 & B.5.5.1				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	17	Upper-Level Ramp to Elevator in Fusselman Hall	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	17	Upper-Level Ramp to Elevator in Fusselman Hall	Ramp	Ramp: Rise more than 30" between landings.	\$4,500.00	4.8.2	1133B.5.4.1		\$4,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	17	Upper-Level Ramp to Elevator in Fusselman Hall	Ramp	Ramp: Pavement dislocation creates abrupt change in level exceeding 1/2" in ramp.		4.3.2	1133B.7.1				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	17	Upper-Level Ramp to Elevator in Fusselman Hall	Ramp	Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60).		Fig. 25	Ibl. 11B-38(a)				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	18	Accessible Entrance to Fusselman Hall from Campus Green	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$3,800.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1		\$3,800.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	18	Accessible Entrance to Fusselman Hall from Campus Green	Ramp	Ramp: Rise more than 30" between landings.	\$6,750.00	4.8.2	1133B.5.4.1		\$6,750.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	18	Accessible Entrance to Fusselman Hall from Campus Green	Ramp	Ramp: Pavement dislocation creates abrupt change in level exceeding 1/2" in ramp.		4.5.2	1133B.7.1				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	18	Accessible Entrance to Fusselman Hall from Campus Green	Ramp	Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.		4.8.7	1133B.5.6				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	19	Ramp to the West of the Learning Resources Building	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$9,500.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1		\$9,500.00		to be completed in ADA
Exterior	On-site	19	Ramp to the West of the Learning Resources Building	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.		4.9.4(5)	1133B.4.2.1 & B.5.5.1				to be completed in ADA
Exterior	On-site	19	Ramp to the West of the Learning Resources Building	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1				to be completed in ADA
Exterior	On-site	19	Ramp to the West of the Learning Resources Building	Ramp	Ramp: Slope greater than 1:12 (8.3%).	\$35,000.00	4.8.2	1133.B.5.3		\$35,000.00		to be completed in ADA
Exterior	On-site	19	Ramp to the West of the Learning Resources Building	Ramp	Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.		4.8.7	1133B.5.6				to be completed in ADA
Exterior	On-site	20	Steps leading up to Campus Green from Learning Resources Building	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$1,200.00	4.9.4(5)	1133B.4.2.1 & B.5.5.1		\$1,200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	20	Steps leading up to Campus Green from Learning Resources Building	Handrail	Bottom extension of handrail does not return creating a hazard for blind individuals.		4.4.1	1133B.4.2.3				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	20	Steps leading up to Campus Green from Learning Resources Building	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	20	Steps leading up to Campus Green from Learning Resources Building	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$900.00		1133B.4.4		\$900.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	21	Steps to the West of the Learning Resources Building	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$2,625.00	4.9.4(5)	1133B.4.2.1 & B.5.5.1		\$2,625.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	21	Steps to the West of the Learning Resources Building	Handrail	Bottom extension of handrail does not return creating a hazard for blind individuals.		4.4.1	1133B.4.2.3				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	21	Steps to the West of the Learning Resources Building	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	21	Steps to the West of the Learning Resources Building	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$1,350.00		1133B.4.4		\$1,350.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	22	Sloped Walkway leading up to the Learning Resources Building	Disabled Seating	Wheelchair space (33" x 48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat).	\$450.00	4.2.4	1104.3.6		\$450.00		2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	22	Sloped Walkway leading up to the Learning Resources Building	Sidewalk	Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.	\$40,500.00	4.8.1	1133B.7.3		\$40,500.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Exterior	On-site	22	Sloped Walkway leading up to the Learning Resources Building	Signage	No sign at inaccessible ramp directing persons to an accessible route.	\$500.00	35.163(b)		\$500.00			
Exterior	On-site	23	Stairs to the East of Student Services	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$3,750.00	4.9.4(5)	1133B.4.2.1 & B.5.5.1	\$3,750.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	23	Stairs to the East of Student Services	Handrail	Bottom extension of handrail does not return creating a hazard for blind individuals.		4.4.1	1133B.4.2.3				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	23	Stairs to the East of Student Services	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	23	Stairs to the East of Student Services	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$4,050.00		1133B.4.4	\$4,050.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	24	East-side Entrance to Student Services	Sign	Public text telephone not identified with a sign that includes the international T.D.D. symbol.	\$95.00	4.30.7(3)	3105A(d)2(iii)	\$95.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	24	East-side Entrance to Student Services	T.D.D.	T.D.D. service not provided in administration, constituent or student service area that communicates by telephone.		35.161	-				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	25	Studio Entrance at South end of Learning Resources Building	Ramp	Ramp: Slope greater than 1:12 (8.3%).		4.8.2	1133.B.5.3				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	25	Studio Entrance at South end of Learning Resources Building	Signage	No sign at inaccessible ramp directing persons to an accessible route.	\$250.00	35.163(b)		\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	26	Parking Lot #5	Night Deposit	Night deposit box mounted with handle or deposit slot higher than 48" above sidewalk.	\$3,200.00	4.2.5	3105A(h)4c	\$3,200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	26	Parking Lot #5	Parking	Accessible parking space(s) not located close to the nearest possible entrance on an accessible route.	\$700.00	4.6.2	1129B.1	\$700.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	26	Parking Lot #5	Parking Signage	Sign for accessible parking space is missing or non-compliant.	\$630.00	4.6.4	1129B.5	\$630.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	27	Stairs to Library Entrance from Parking Lot #5	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$170.00	4.9.4(2)	1133B.4.2.2	\$170.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	27	Stairs to Library Entrance from Parking Lot #5	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$450.00		1133B.4.4	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	28	Ramp to Library Entrance from Parking Lot #5	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$4,750.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$4,750.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	28	Ramp to Library Entrance from Parking Lot #5	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.		4.9.4(5)	1133B.4.2.1 & B.5.5.1				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	28	Ramp to Library Entrance from Parking Lot #5	Ramp	Ramp: Slope greater than 1:12 (8.3%).	\$25,000.00	4.8.2	1133.B.5.3	\$25,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	28	Ramp to Library Entrance from Parking Lot #5	Ramp	Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60).		Fig. 25	Tbl. 11B-38(a)				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	28	Ramp to Library Entrance from Parking Lot #5	Ramp	Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.		4.8.7	1133B.5.6				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	29	Accessible Ramp at North side of Learning Resources Building	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$4,750.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$4,750.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	29	Accessible Ramp at North side of Learning Resources Building	Ramp	Ramp: Slope greater than 1:12 (8.3%).	\$45,000.00	4.8.2	1133.B.5.3	\$45,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	29	Accessible Ramp at North side of Learning Resources Building	Ramp	Ramp: Rise more than 30" between landings.		4.8.2	1133B.5.4.1				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	29	Accessible Ramp at North side of Learning Resources Building	Ramp	Landing less than 60" long.		4.8.4(2)	1133B.5.4.2				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	29	Accessible Ramp at North side of Learning Resources Building	Ramp	Ramp: Door in any position encroaches on ramp landing and reduces clear dimension of landing to less than those shown in ADAAG Fig. 25 (ranges from 42x48 to 60x60).		Fig. 25	Tbl. 11B-38(a)				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	30	Staircase at North side of Learning Resources Building	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$3,750.00	4.9.4(5)	1133B.4.2.1 & B.5.5.1	\$3,750.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	30	Staircase at North side of Learning Resources Building	Handrail	Bottom extension of handrail does not return creating a hazard for blind individuals.		4.4.1	1133B.4.2.3				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	30	Staircase at North side of Learning Resources Building	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2				2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	30	Staircase at North side of Learning Resources Building	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$2,700.00		1133B.4.4	\$2,700.00			2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	31	Steps at South side of Olney Hall	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$3,000.00	4.9.4(5)	1133B.4.2.1 & B.5.5.1	\$3,000.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	31	Steps at South side of Olney Hall	Handrail	Bottom extension of handrail does not return creating a hazard for blind individuals.		4.4.1	1133B.4.2.3			To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	31	Steps at South side of Olney Hall	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2			To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	31	Steps at South side of Olney Hall	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$5,850.00		1133B.4.4	\$5,850.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	32	Information Board at South Entrance of Olney Hall	Signage	No level area for wheelchair users is provided at Information Board.	\$80.00			\$80.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	33	Accessible Entrance at West side of Olney Hall	Door	Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).		4.13.6	1133B.2.4			To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	33	Accessible Entrance at West side of Olney Hall	Sidewalk	Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.	\$27,000.00	4.8.1	1133B.7.3	\$27,000.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	34	Sloped Walkway to the North of Olney Hall	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$9,500.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$9,500.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	34	Sloped Walkway to the North of Olney Hall	Ramp	Ramp: Slope greater than 1:12 (8.3%).	\$50,000.00	4.8.2	1133.B.5.3	\$50,000.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	34	Sloped Walkway to the North of Olney Hall	Route Sign	No sign by inaccessible route directing persons to an accessible route.	\$170.00	35.163(b)		\$170.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	35	Entrance at West side of Administrative Center	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$3,800.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$3,800.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	35	Entrance at West side of Administrative Center	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.		4.9.4(5)	1133B.4.2.1 & B.5.5.1			To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	35	Entrance at West side of Administrative Center	Parking	Accessible parking space(s) not located close to the nearest possible entrance on an accessible route.	\$7,200.00	4.6.2	1129B.1	\$7,200.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	35	Entrance at West side of Administrative Center	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$225.00		1133B.4.4	\$225.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	36	Entrance at East side to Children's Center	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$1,125.00	4.9.4(5)	1133B.4.2.1 & B.5.5.1	\$1,125.00		To be demolished	2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

	Exterior	On-site	36	Entrance at East side to Children's Center	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2			To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	36	Entrance at East side to Children's Center	Signage	No signs at non-accessible entrances directing persons to an accessible entrance of the building.	\$230.00	4.1.2(7)(c)	1117B.5.7		\$230.00	To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	37	Entrance at South of Harlan Center	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).		4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1			To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	37	Entrance at South of Harlan Center	Handrail	Handrails not returned to wall or newel post.		4.9.4(6)	1133B.4.2.3			To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	37	Entrance at South of Harlan Center	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2			To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	37	Entrance at South of Harlan Center	Sidewalk	Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.	\$22,500.00	4.8.1	1133B.7.3		\$22,500.00	To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	37	Entrance at South of Harlan Center	Sidewalk	Cross slope more than 1/4":12" (2%).		4.3.7	1133B.7.1.3			To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	37	Entrance at South of Harlan Center	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$1,350.00		1133B.4.4		\$1,350.00	To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	38	Courtyard Adjacent to Harlan Center	Disabled Seating	Wheelchair space (33" x 48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat).	\$450.00	4.2.4	1104.3.6		\$450.00	To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	38	Courtyard Adjacent to Harlan Center	Exterior Furniture	Level change between accessible path of travel and adjacent surface greater than 4".	\$6,750.00		1133B.8.1		\$6,750.00	To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	38	Courtyard Adjacent to Harlan Center	Exterior Furniture	Accessible exterior furniture (benches, stools, tables) cracked, broken or in need of repair.	\$250.00				\$250.00	To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	38	Courtyard Adjacent to Harlan Center	Sidewalk	Sidewalk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route.	\$210.00	4.5.2	1133B.7.4		\$210.00	To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	39	Entrance at West side of Management Building	Door	Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).	\$600.00	4.13.6	1133B.2.4		\$600.00	To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	39	Entrance at West side of Management Building	Sidewalk	Paved area has excessively rough, irregular surface.	\$3,600.00	4.5.2	1133B.7.1		\$3,600.00	To be demolished		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	40	Entrance Ramp at Building #16	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.		4.9.4(5)	1133B.4.2.1 & B.5.5.1					2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	40	Entrance Ramp at Building #16	Handrail	Standard handrail: Gripping section narrower than 1-1/4" or wider than 1-1/2".		4.26.2	1133B.4.2.6.1					2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	40	Entrance Ramp at Building #16	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1					2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	40	Entrance Ramp at Building #16	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$2,850.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1		\$2,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	41	Accessible Parking at the North end of Parking Lot #6	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	\$2,190.00	Fig.9	1129B.4.3		\$2,190.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	41	Accessible Parking at the North end of Parking Lot #6	Parking	No van parking provided (one in every 8 accessible spaces, but not less than one, 8' wide access aisle to the right of the parking stall, 98" height clearance).	\$350.00	4.1.2(5)(b)	1129B.4.2		\$350.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	42	Accessible Parking at the Center of Parking Lot #6	Parking	Accessible parking space(s) not located close to the nearest possible entrance on an accessible route.	\$1,750.00	4.6.2	1129B.1		\$1,750.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	42	Accessible Parking at the Center of Parking Lot #6	Parking	Parking-ticket vending machine is not accessible.	\$2,500.00	4.6.1			\$2,500.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	43	Ramp to the East of the Science Center	Handrail	Standard handrail: Gripping section narrower than 1-1/4" or wider than 1-1/2".	\$5,625.00	4.26.2	1133B.4.2.6.1		\$5,625.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	43	Ramp to the East of the Science Center	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1			Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	43	Ramp to the East of the Science Center	Ramp	72" level area not provided at bottom landing.	\$15,750.00	4.8.4(3)	1133B.5.4		\$15,750.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	43	Ramp to the East of the Science Center	Ramp	Ramp: Rise more than 30" between landings.		4.8.2	1133B.5.4.1			Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	44	Walkway to Lower Level Parking in Science Center	Sidewalk	Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.	\$19,500.00	4.8.1	1133B.7.3		\$19,500.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	44	Walkway to Lower Level Parking in Science Center	Sidewalk	Paved area has excessively rough, irregular surface.		4.5.2	1133B.7.1			Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	45	Accessible Parking at East end of Parking Lot #7	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	\$730.00	Fig.9	1129B.4.3		\$730.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	45	Accessible Parking at East end of Parking Lot #7	Sidewalk	Cross slope more than 1/4":12" (2%) on account of swale near accessible path of travel.	\$30,000.00	4.3.7	1133B.4.1.3		\$30,000.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	46	Accessible Parking at Lower Level of Science Center	Accessible Route	Overhead clearance less than 80" above finished floor.		4.4.2	1121B.2			Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	46	Accessible Parking at Lower Level of Science Center	Parking	Accessible parking space or aisle smaller than required size (8' wide with 5' wide access aisle, 8' for vans).	\$1,000.00	4.6.3	1129B.4		\$1,000.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	46	Accessible Parking at Lower Level of Science Center	Parking	Accessible parking space does not have 5' x 18" access aisle (van accessible aisle 8' x 18' to the right of the parking stall).	\$200.00	4.6.3	1129B.4		\$200.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	47	Accessible Parking at East end of Parking Lot #9	Parking Signage	Sign for accessible parking space is missing or non-compliant.	\$630.00	4.6.4	1129B.5		\$630.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	48	Ramp and Stairs at the North of the Science Center	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$1,875.00	4.9.4(5)	1133B.4.2.1 & B.5.5		\$1,875.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	48	Ramp and Stairs at the North of the Science Center	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2			Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	48	Ramp and Stairs at the North of the Science Center	Ramp	Ramp: Slope greater than 1:12 (8.3%).		4.8.2	1133B.5.3			Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	48	Ramp and Stairs at the North of the Science Center	Ramp	Ramp: Rise more than 30" between landings.		4.8.2	1133B.5.4.1			Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	48	Ramp and Stairs at the North of the Science Center	Signage	No sign at inaccessible ramp directing persons to an accessible route.	\$250.00	35.163(b)			\$250.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	48	Ramp and Stairs at the North of the Science Center	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$2,250.00		1133B.4.4		\$2,250.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	49	Stairs to the South of the Science Center	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$1,875.00	4.9.4(5)	1133B.4.2.1 & B.5.5		\$1,875.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	49	Stairs to the South of the Science Center	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2			Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	49	Stairs to the South of the Science Center	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$2,250.00		1133B.4.4		\$2,250.00	Swing space to be demo		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	50	Accessible Parking at the West end of Parking Lot #12	Parking	Disabled persons must wheel or walk behind parked car(s) other than their own.	\$730.00	Fig.9	1129B.4.3		\$730.00	Completed in PE project		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	50	Accessible Parking at the West end of Parking Lot #12	Parking Signage	Sign for accessible parking space is missing, obscured or non-compliant.	\$315.00	4.6.4	1129B.5		\$315.00	Completed in PE project		2004 Access Compliance Survey Report Sally Swanson Architects
	Exterior	On-site	51	Steps leading from Parking Lot #12 to Pool Complex	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$1,125.00	4.9.4(5)	1133B.4.2.1 & B.5.5		\$1,125.00	Completed in PE project		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Exterior	On-site	51	Steps leading from Parking Lot #12 to Pool Complex	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.		4.9.4(2)	1133B.4.2.2		Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	51	Steps leading from Parking Lot #12 to Pool Complex	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$450.00		1133B.4.4	\$450.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	52	Ramps and Steps from sidewalk along College Ave. to Pool Complex	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$2,250.00	4.9.4(5)	1133B.4.2.1 & B.5.5.	\$2,250.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	52	Ramps and Steps from sidewalk along College Ave. to Pool Complex	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.		4.8.5(2)	1133B.5.5.1		Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	52	Ramps and Steps from sidewalk along College Ave. to Pool Complex	Signage	No sign at inaccessible ramp directing persons to an accessible route.	\$250.00	35.163(b)		\$250.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	52	Ramps and Steps from sidewalk along College Ave. to Pool Complex	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$2,475.00		1133B.4.4	\$2,475.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	53	Sidewalk along College Ave. in front of Pool Complex	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$1,900.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$1,900.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	53	Sidewalk along College Ave. in front of Pool Complex	Passenger Drop-off	No curb ramp provided at passenger drop-off area.	\$2,500.00	4.6.6	1131B.2.1	\$2,500.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	53	Sidewalk along College Ave. in front of Pool Complex	Sidewalk	Cross slope more than 1/4"=12" (2%).	\$600.00	4.3.7	1133B.7.1.3	\$600.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	54	Fenced Areas - Tennis Courts and Athletic Field	Disabled Seating	Wheelchair space (33" x 48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat).	\$450.00	4.2.4	1104.3.6	\$450.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	54	Fenced Areas - Tennis Courts and Athletic Field	Door Closer	Gate in accessible path of travel does not have compliant hardware.	\$1,125.00	4.13.10 & 11	1133B.1.1.1.4	\$1,125.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Exterior	On-site	55	Steps leading up to East Entrance from Parking Lot #10	Stairs	Contrasting color strip not provided at all stair nosings (required in CA only).	\$675.00		1133B.4.4	\$675.00	Completed in PE project	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	1	Elevator	Elevator	Neither audible signal nor visual wall lantern provided.	\$2,510.00	4.10.4	5103 (d.1) 9	\$2,510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	1	Elevator	Elevator	Braille symbols on floor indicators of each elevator entrance jamb not compliant.	\$0.00		3003.4.16a	\$0.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	2	Jewelry classroom (# 15)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	2	Jewelry classroom (# 15)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	3	Ceramic's classroom (# 10)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	3	Ceramic's classroom (# 10)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	3	Ceramic's classroom (# 10)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	3	Ceramic's classroom (# 10)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	4	Green room (# 34)	Desk	Accessible fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.	\$2,500.00	4.32.3 & 4	1122B.3 & 4	\$2,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	4	Green room (# 34)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	4	Green room (# 34)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	5	Control booth (# 33)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	6	Theater black box (# 32)	Assistive Listening	No permanently installed assistive listening system provided for smaller assembly area (accommodating 50 to 200 persons).	\$1,700.00	4.1.3 (19) (b)		\$1,700.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	6	Theater black box (# 32)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	6	Theater black box (# 32)	Fixed Seating	Proper amount of seating for disabled persons at public seating is not provided (>25=1; >50=2; >300=4; >500=6; >500=1%).	\$600.00	4.1.2(19)a	1104B.3.4	\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	6	Theater black box (# 32)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	6	Theater black box (# 32)	Stages	Stage, enclosed and unenclosed platform, backstage areas or orchestra pit not accessible.	\$25,000.00	4.33.5	1104B.3.10	\$25,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	7	Steps on the other side of Black Box Theater entrance	Handrail	Stair handrail does not extend horizontally 12" min. beyond top of stair.	\$680.00	4.9.4(2)	1133B4.2.2	\$680.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	7	Steps on the other side of Black Box Theater entrance	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$680.00	4.9.4(2)	1133B.4.2.2	\$680.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	7	Steps on the other side of Black Box Theater entrance	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$420.00		1133B.4.4	\$420.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	8	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in good condition.	\$0.00	4.15.2	1507.3.3	\$0.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	8	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$7,600.00	4.4.1	Fig. 11B-3	\$7,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	8	Drinking fountain	Drinking Fountain	Where more than one drinking fountain is provided per floor, less than 50% comply with ADAAG 4.15.	\$4,000.00	4.1.3.(10)(b)	1117B.1.1	\$4,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Accessories	Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$360.00	4.19.4	1504.2.2	\$360.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.	\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fine Arts Building	Lower Level	9	Men's restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").	\$5,000.00	Fig. 25(c)	11B-26A(c)	\$5,000.00			
Fine Arts Building	Lower Level	9	Men's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Urinal	Fixture mounted with rim more than 17" above floor.	\$2,400.00	4.18.2	1503.2 C.P.C.	\$2,400.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	9	Men's restrooms	Urinal	30" x 48" clear floor space in front of accessible urinal not provided.		4.18.3	1115B.9.4				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Accessories	Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$360.00	4.19.4	1504.2.2	\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").	\$5,000.00	Fig. 25(c)	11B-26A(c)	\$5,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	10	Women's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	11	Practice rooms	Door Hardware	Door does not have accessible operating hardware.	\$3,000.00	4.13.9	1133B.2.5.1	\$3,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	11	Practice rooms	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$1,080.00	4.30.6	1117B.5.2	\$1,080.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	11	Practice rooms	Signage	Accessible service location not designated with appropriate sign.	\$110.00	35.163(a)		\$110.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	12	W. Lefort Recital Hall (# 72)	Assistive Listening	No permanently installed assistive listening system provided for smaller assembly area (accommodating 50 to 200 persons).	\$1,700.00	4.1.3 (19) (b)		\$1,700.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	12	W. Lefort Recital Hall (# 72)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	12	W. Lefort Recital Hall (# 72)	Fixed Seating	Proper amount of seating for disabled persons at public seating is not provided (>25=1; >50=2; >300=4; >500=6; +500=6=1%).	\$1,200.00	4.1.2(19)a	1104B.3.4	\$1,200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	12	W. Lefort Recital Hall (# 72)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	12	W. Lefort Recital Hall (# 72)	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	12	W. Lefort Recital Hall (# 72)	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$840.00		1133B.4.4	\$840.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	13	Ramp between recital halls	Ramp	Ramp: Slope greater than 1:20 (5.0%) with no handrails.	\$2,700.00	4.8.1*	3307 (e.1)	\$2,700.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	13	Ramp between recital halls	Ramp	Ramp: Slope greater than 1:12 (8.3%) .	\$1,050.00	4.8.2	3307 (c.1)	\$1,050.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	14	J. Myers rehearsal hall (# 75)	Door Hardware	Cabinet or storage door / drawer does not have accessible hardware.	\$200.00	4.25.4	1125B.4	\$200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	14	J. Myers rehearsal hall (# 75)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	14	J. Myers rehearsal hall (# 75)	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	14	J. Myers rehearsal hall (# 75)	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$2,800.00		1133B.4.4	\$2,800.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	15	Hallway adjacent to practice rooms	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$100.00	4.4.1	1121B.1	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	15	Hallway adjacent to practice rooms	Locker Facilities	Lockers do not have accessible operating hardware.	\$450.00	-	3103(a)2D(5)	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	16	Sculpture classroom (# 51)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	16	Sculpture classroom (# 51)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	16	Sculpture classroom (# 51)	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$100.00	4.13.4	1133B.2.3.1	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Lower Level	16	Sculpture classroom (# 51)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	1	Lobby/ art gallery	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fine Arts Building	Upper level	2	Elevator	Elevator	Door reopening device does not remain effective for at least 20 seconds.	\$50.00	4.10.6	3003.4.5	\$50.00			
Fine Arts Building	Upper level	2	Elevator	Elevator	Neither audible signal nor visual wall lantern provided.	\$2,510.00	4.10.4	5103 (d.1) 9	\$2,510.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	2	Elevator	Elevator	*Floor numbers not provided at all elevator entrances with both raised characters 2" high and Braille numbers, on each entrance jamb.*	\$50.00	4.10.5*	5103 (d.1) 10.	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	3	Ticket Booth	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Assistive Listening	No permanently installed assistive listening system provided for larger assembly area (accommodating 200 or more persons).	\$4,700.00	4.1.3 (19) (b)		\$4,700.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Assistive Listening	No signs at the building or assembly area entrance to notify patrons that an assistive listening system is available.		4.1.3 (19) (b)	1104B.2.4				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Assistive Listening	*An adequate number of receivers (4% of seating capacity, min. 2) is not available to patrons in theaters with more than 50 seats.*		4.1.3(19)(b)*	3103(a)2G(1)				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$3,000.00	4.13.4	1133B.2.3.1	\$3,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Fixed Seating	Proper amount of seating for disabled persons at public seating is not provided (>25=1; >50=2; >300=4; >500=6; +500=6=1%).	\$600.00	4.1.2(19)a	1104B.3.4	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Fixed Seating	Less than one percent of total seating are aisle seats with removable armrest (at aisle side) that are identified by a sign.	\$350.00	4.1.2(19)a	1104B.3.4	\$350.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Fixed Seating	At least one fixed companion seat next to each wheelchair seating area is not provided.	\$350.00	4.33.3	1104B.3.5	\$350.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Fixed Seating	CA only: Less than one percent of total seats have at least 24" clear leg space between the front of the seat and any obstruction to accommodate semi-ambulant individuals.	\$350.00		1104B.3.8	\$350.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$540.00	4.1.3 (16)	1117B.5.2 & 6	\$540.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Stages	Stage, enclosed and unenclosed platform, backstage areas or orchestra pit not accessible.	\$25,000.00	4.33.5	1104B.3.10	\$25,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	4	Theater	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$3,808.00		1133B.4.4	\$3,808.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	5	Drinking fountain	Drinking Fountain	Where more than one drinking fountain is provided per floor, less than 50% comply with ADAAG 4.15.	\$4,000.00	4.1.3.(10)(b)	1117B.1.1	\$4,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	5	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).		4.15.5(1)	1507.3.1				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	5	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	5	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$7,600.00	4.4.1	Fig. 11B-3	\$7,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	6	Public Telephone	Sign	Signs directing persons to the location of public text telephones not provided where required.	\$150.00	4.30.7(3)	3105A(d)2(iii)	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	6	Public Telephone	T.D.D.	Interior public text telephone (T.D.D.) not provided at type of facility required to have a public text telephone.	\$1,150.00	4.1.3(17)(c)	3105A(d)2i	\$1,150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	6	Public Telephone	Telephone	Telephone mounting height greater than 48" to highest operable part (only front reach available).	\$250.00	4.31.3	1118B.5	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.			Fig.No.31-1B				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$360.00	4.19.4	1504.2.2	\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").	\$500.00	Fig. 25(c)	11B-26A(c)	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3					2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Urinal	Fixture mounted with rim more than 17" above floor.	\$2,400.00	4.18.2	1503.2 C.P.C.	\$2,400.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	7	Men's Restrooms	Urinal	CA only: Front of rim projects less than 14" from wall.			1503.2.1 C.P.C.				2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fine Arts Building	Upper level	7	Men's Restrooms	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00		
Fine Arts Building	Upper level	8	Women's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. Bottom of flat, not tilted mirror more than 40" above floor.	\$200.00	28 CFR 35.133	1115B.9.2	\$200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	4.19.6	1115B.9.1.2	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$300.00	Fig. 28	DSA/AAC # 99-07	\$300.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.			Fig.No.31-1B			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$360.00	4.19.4	1504.2.2	\$360.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.	\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").	\$500.00	Fig. 25(c)	11B-26A(c)	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	8	Women's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	9	Room # 177	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	9	Room # 177	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	9	Room # 177	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	9	Room # 177	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$100.00	Fig. 25(a)	11B-26A(a)	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	9	Room # 177	Vestibule	"12" clear width from strike side of door not provided in vestibule with door swinging out and with both latch & closer."		*4.13.7, 4.13.6	3304 (i.1) 2D			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	10	Room # 178	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	10	Room # 178	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	10	Room # 178	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	10	Room # 178	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$100.00	Fig. 25(a)	11B-26A(a)	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	10	Room # 178	Vestibule	"12" clear width from strike side of door not provided in vestibule with door swinging out and with both latch & closer."		*4.13.7, 4.13.6	3304 (i.1) 2D			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	11	Music Library (# 179)	Card Files	Accessible section or desk not provided for use of computer to browse library catalogue.	\$1,600.00	8.4	1106B.4.4	\$1,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	11	Music Library (# 179)	Desk/Counter	Information desk or circulation counter or section not 36" max. high and min. 36" wide (CA only: top 28" to 34" high, min. 36" counter length).	\$4,000.00	8.3	1122B.4	\$4,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	11	Music Library (# 179)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	11	Music Library (# 179)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	11	Music Library (# 179)	Open Stack	Open stacks (i.e. public use) do not have min 36" (44" preferred) wide aisles (CA only: 44" min. width at main aisles and 36" min. at end aisles).	\$0.00	8.5	1106B.4.2	\$0.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	11	Music Library (# 179)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	12	Staff private offices (#s184-186)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	12	Staff private offices (#s184-186)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	12	Staff private offices (#s184-186)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	12	Staff private offices (#s184-186)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	12	Staff private offices (#s184-186)	Vestibule	"Vestibule length in direction of travel less than width(es) of door(s) swinging into vestibule, plus 48"."		4.13.7	3304 (i.1) 2D.			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	13	Piano C.R. (room #188)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fine Arts Building	Upper level	13	Piano C.R. (room #188)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		
Fine Arts Building	Upper level	13	Piano C.R. (room #188)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	13	Piano C.R. (room #188)	Vestibule	Vestibule length in direction of travel less than width(es) of door(s) swinging into vestibule, plus 48"."	4.13.7	3304 (I.1) 2D.				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	14	Staircase at N.W. corner of Building.	Elevator	In an existing building, which exceeds 100,000 sq ft on any floor, an accessible means of vertical access is not provided within 200 ft. of each staircase.	\$200,000.00	4	5103	\$200,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	14	Staircase at N.W. corner of Building.	Handrail	Stair handrail does not extend horizontally 12" min. beyond top of stair.	\$510.00	4.9.4(2)	1133B4.2.2	\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	14	Staircase at N.W. corner of Building.	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$510.00	4.9.4(2)	1133B.4.2.2	\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	14	Staircase at N.W. corner of Building.	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$2,250.00	4.9.4(5)	1133B.4.2.1 & B.5.5.	\$2,250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	14	Staircase at N.W. corner of Building.	Route Sign	No sign by inaccessible route directing persons to an accessible route.	\$510.00	35.163(b)		\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	14	Staircase at N.W. corner of Building.	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$420.00		1133B.4.4	\$420.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	15	Staircase at N.E. corner of Building.	Handrail	Stair handrail does not extend horizontally 12" min. beyond top of stair.	\$510.00	4.9.4(2)	1133B4.2.2	\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	15	Staircase at N.E. corner of Building.	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$510.00	4.9.4(2)	1133B.4.2.2	\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	15	Staircase at N.E. corner of Building.	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$2,250.00	4.9.4(5)	1133B.4.2.1 & B.5.5.	\$2,250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	15	Staircase at N.E. corner of Building.	Route Sign	No sign by inaccessible route directing persons to an accessible route.	\$510.00	35.163(b)		\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	15	Staircase at N.E. corner of Building.	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$420.00		1133B.4.4	\$420.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	16	Staircase at S.E. corner of Building.	Handrail	Stair handrail does not extend horizontally 12" min. beyond top of stair.	\$510.00	4.9.4(2)	1133B4.2.2	\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	16	Staircase at S.E. corner of Building.	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$510.00	4.9.4(2)	1133B.4.2.2	\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	16	Staircase at S.E. corner of Building.	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$2,250.00	4.9.4(5)	1133B.4.2.1 & B.5.5.	\$2,250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	16	Staircase at S.E. corner of Building.	Route Sign	No sign by inaccessible route directing persons to an accessible route.	\$510.00	35.163(b)		\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	16	Staircase at S.E. corner of Building.	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$420.00		1133B.4.4	\$420.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	17	Staircase at S.W. corner of Building.	Handrail	Stair handrail does not extend horizontally 12" min. beyond top of stair.	\$510.00	4.9.4(2)	1133B4.2.2	\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	17	Staircase at S.W. corner of Building.	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$510.00	4.9.4(2)	1133B.4.2.2	\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	17	Staircase at S.W. corner of Building.	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$2,250.00	4.9.4(5)	1133B.4.2.1 & B.5.5.	\$2,250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	17	Staircase at S.W. corner of Building.	Route Sign	No sign by inaccessible route directing persons to an accessible route.	\$510.00	35.163(b)		\$510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	17	Staircase at S.W. corner of Building.	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$420.00		1133B.4.4	\$420.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	18	Department of theater arts	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	18	Department of theater arts	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	18	Department of theater arts	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	18	Department of theater arts	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	19	Rooms #134-136	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	19	Rooms #134-136	Fixed Seating	At room with 4-25 fixed seats, fewer than required number of wheelchair seating spaces provided; 1 space required.	\$760.00	4.1.3(19)a		\$760.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	19	Rooms #134-136	Platform	Access to raised areas and platforms not provided.	\$1,950.00	4.5.2		\$1,950.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	19	Rooms #134-136	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	19	Rooms #134-136	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$1,000.00	Fig. 25(a)	11B-26A(a)	\$1,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	20	Room #137	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	20	Room #137	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	21	Room #138	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	21	Room #138	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	21	Room #138	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	21	Room #138	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	22	Room #142	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	22	Room #142	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	23	Hallway on southside of theater	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$100.00	4.4.1	1121B.1	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	24	Art Dept. office (#102)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	24	Art Dept. office (#102)	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	24	Art Dept. office (#102)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	25	Staff meeting (room #103)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fine Arts Building	Upper level	25	Staff meeting (room #103)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	25	Staff meeting (room #103)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	25	Staff meeting (room #103)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	26	Lecture Hall (#120)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	26	Lecture Hall (#120)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	26	Lecture Hall (#120)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	26	Lecture Hall (#120)	Platform	Access to raised areas and platforms not provided.	\$1,560.00	4.5.2		\$1,560.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	26	Lecture Hall (#120)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	26	Lecture Hall (#120)	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	26	Lecture Hall (#120)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	27	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	27	Drinking fountain	Drinking Fountain	CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.			1117B.1.2		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$240.00	4.19.4	1504.2.2	\$240.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.	\$600.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.		4.1.2(7)			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Signage	Otherwise compliant sign identifying permanent room or space not mounted 5' high to center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing).	\$50.00	4.30.6	1117B.5.9	\$50.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	\$1,500.00	4.17.3	1115B.7.2	\$1,500.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Urinal	Fixture mounted with rim more than 17" above floor.	\$2,400.00	4.18.2	1503.2 C.P.C.	\$2,400.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	28	Men's restrooms (# 122)	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	29	Women's restrooms (# 124)	Directional Sign	No sign at non-accessible room or space directing persons to an accessible that provides the same or equivalent service.	\$90.00	35.163(b); 4.1.6(3)(e)(iii)		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	29	Women's restrooms (# 124)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	29	Women's restrooms (# 124)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	30	Staircase adjacent to room #120	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	30	Staircase adjacent to room #120	Handrail	Stair handrail does not extend horizontally 12" min. beyond top of stair.	\$510.00	4.9.4(2)	1133B4.2.2	\$510.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	30	Staircase adjacent to room #120	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$850.00	4.9.4(2)	1133B.4.2.2	\$850.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	30	Staircase adjacent to room #120	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$3,900.00	4.9.4(5)	1133B.4.2.1 & B.5.5.	\$3,900.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	30	Staircase adjacent to room #120	Route Sign	No sign by inaccessible route directing persons to an accessible route.	\$510.00	35.163(b)		\$510.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	30	Staircase adjacent to room #120	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$616.00		1133B.4.4	\$616.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	31	Staircase adjacent to room #151	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	31	Staircase adjacent to room #151	Handrail	Stair handrail does not extend horizontally 12" min. beyond top of stair.	\$510.00	4.9.4(2)	1133B4.2.2	\$510.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	31	Staircase adjacent to room #151	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$850.00	4.9.4(2)	1133B.4.2.2	\$850.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	31	Staircase adjacent to room #151	Handrail	Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$3,900.00	4.9.4(5)	1133B.4.2.1 & B.5.5.	\$3,900.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	31	Staircase adjacent to room #151	Route Sign	No sign by inaccessible route directing persons to an accessible route.	\$510.00	35.163(b)		\$510.00	2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	31	Staircase adjacent to room #151	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$616.00		1133B.4.4	\$616.00	2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fine Arts Building	Upper level	32	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	32	Drinking fountain	Drinking Fountain	CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.			1117B.1.2			2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Accessories	Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$240.00	4.19.4	1504.2.2	\$240.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.	\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Signage	Existing geometric symbol on door leaf sign has braille and raised text.	\$100.00		1115B.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").	\$500.00	Fig. 25(c)	11B-26A(c)	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	33	Women's restrooms (#157)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	\$1,500.00	4.17.3	1115B.7.2	\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	34	Design studio (# 153)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	34	Design studio (# 153)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	34	Design studio (# 153)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	34	Design studio (# 153)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	34	Design studio (# 153)	Studio/Shop	"Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."	\$4,500.00	4.1.3(18)	3103A(d)2	\$4,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	35	Design studio (# 151)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	35	Design studio (# 151)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	35	Design studio (# 151)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	35	Design studio (# 151)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	35	Design studio (# 151)	Studio/Shop	"Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."	\$4,500.00	4.1.3(18)	3103A(d)2	\$4,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	36	Women's restrooms (# 160)	Directional Sign	No sign at non-accessible room or space directing persons to an accessible that provides the same or equivalent service.	\$90.00	35.163(b); 4.1.6(3)(e)(iii)		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	36	Women's restrooms (# 160)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	36	Women's restrooms (# 160)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Upper level	36	Women's restrooms (# 160)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	1	Elevator	Elevator	Neither audible signal nor visual wall lantern provided.	\$2,510.00	4.10.4	5103 (d.1) 9	\$2,510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	1	Elevator	Elevator	Floor numbers not provided at all elevator entrances with both raised characters 2" high and Braille numbers, on each entrance jamb."	\$50.00	4.10.5*	5103 (d.1) 10.	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	2	Studio # 201	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	2	Studio # 201	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	2	Studio # 201	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	2	Studio # 201	Studio/Shop	"Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."	\$4,500.00	4.1.3(18)	3103A(d)2	\$4,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	3	Studio # 202	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	3	Studio # 202	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	3	Studio # 202	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	3	Studio # 202	Studio/Shop	"Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."	\$4,500.00	4.1.3(18)	3103A(d)2	\$4,500.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fine Arts Building	Roof level	4	Drinking fountain	Drinking Fountain	Where only one drinking fountain is provided per floor: Fountain it is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping.	\$2,000.00	4.1.3.(10)(a)	1117B.1.1	\$2,000.00				
Fine Arts Building	Roof level	4	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	4	Drinking fountain	Drinking Fountain	Fountain bubbler not easily activated by lever, push bar, or other accessible control.		4.27.4	1507.3.3					2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	4	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3					2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	4	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).		4.15.5(1)	1507.3.1					2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	5	Digital arts (# 225)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	5	Digital arts (# 225)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	5	Digital arts (# 225)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	6	Painting studio (# 226)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	6	Painting studio (# 226)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Fine Arts Building	Roof level	6	Painting studio (# 226)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	1	Entrance door on west side	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$100.00	4.4.1	1121B.1	\$100.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	1	Entrance door on west side	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$90.00		1133B.2.6	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	1	Entrance door on west side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	2	Office Lobby (# 20)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	2	Office Lobby (# 20)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	2	Office Lobby (# 20)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	2	Office Lobby (# 20)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	3	Patio	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	3	Patio	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	3	Patio	Door Threshold	Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.	\$0.00	4.13.8	1133B.2.4.1	\$0.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	4	Private offices (#s 21-25)	Door Hardware	Door does not have accessible operating hardware.	\$1,250.00	4.13.9	1133B.2.5.1	\$1,250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	4	Private office (rooms # 21-25)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$450.00	4.30.6	1117B.5.2	\$450.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	5	Custodian room (#11)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	6	Ramp to restrooms	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$3,040.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$3,040.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	6	Ramp to restroom level	Handrail	Handrail: Clearance to wall is not 1-1/2".		4.9.4(3)	1133B4.2.5					2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	6	Ramp to restroom level	Handrail	Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.	\$170.00	4.8.5(2)	1133B.5.5.1	\$170.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	6	Ramp to restroom level	Ramp	Ramp: Slope greater than 1:12 (8.3%) .	\$1,120.00	4.8.2	3307 (c.1)	\$1,120.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	7	Mechanical room (# 12)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	7	Mechanical room (# 12)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	8	Storage room (# 13)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	8	Storage room (# 13)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restroom	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115B.9.2	\$200.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$240.00	4.19.4	1504.2.2	\$240.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$50.00	4.19.5	1504.2.1 C.P.C.	\$50.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Locker Facilities	"Adequate wheelchair space between lockers and benches not provided (44" width needed)."	\$150.00	-	3103(a)2D(5)	\$150.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00				2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Dickson Hall	Lower Level	9	Women's restrooms	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	4.17.5	1115B.7.1.4											
Dickson Hall	Lower Level	9	Women's restrooms	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3											2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Toilet Stall	Less than 95" from back wall to front wall of side entry toilet stall when door swings inward, or less than 92" if water closet is wall-hung (CA only: Less than 60" from front of water closet to opposite wall in side entry stall).		4.17.3	1115B.7.3										2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27.4	1502.0	\$500.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	9	Women's restrooms	Water Closet	Height of water closet seat less than 17" from floor.	\$80.00	4.16.3	1502.0	\$80.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Lavatory	Wheelchair clearance under lavatory or lavatory counter front edge less than 29" high x 8" deep x 30" wide.	\$3,400.00	4.19.2	1504.2.1	\$3,400.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$600.00	4.19.4	1504.2.2	\$600.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$50.00	4.19.5	1504.2.1 C.P.C.	\$50.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$200.00		1115B.5	\$200.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$180.00	4.1.3(16)(a)	1117B.5.9	\$180.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3											2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Toilet Stall	Less than 95" from back wall to front wall of side entry toilet stall when door swings inward, or less than 92" if water closet is wall-hung (CA only: Less than 60" from front of water closet to opposite wall in side entry stall).		4.17.3	1115B.7.3										2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Urinal	CA only: Front of rim projects less than 14" from wall.			1503.2.1 C.P.C.										2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Urinal	Fixture mounted with rim more than 17" above floor.	\$2,400.00	4.18.2	1503.2 C.P.C.	\$2,400.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27.4	1502.0	\$500.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	10	Men's restrooms	Water Closet	Height of water closet seat less than 17" from floor.	\$80.00	4.16.3	1502.0	\$80.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	11	Exit door on south side of building	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	11	Exit door on south side of building	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	12	Lecture room (# 30)	Directional Sign	No directions posted at inaccessible entrance.	\$90.00	35.163(b)	1117B.5.7	\$90.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	12	Lecture room (# 30)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	12	Lecture room (# 30)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	12	Lecture room (# 30)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	12	Lecture room (# 30)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	13	Staircase adjacent to room # 30	Handrail	Wall mounted handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.	\$840.00	4.8.4(5) & 4.9.	1133B.4.2.1 & B.5.5.	\$840.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Lower Level	13	Staircase adjacent to room # 30	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$600.00	4.9.4(2)	1133B.4.2.2	\$600.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	1	Entrance door on east side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	1	Entrance door on east side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	2	Health center (# 118)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	2	Health center (# 118)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00									2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	2	Health center (# 118)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00									2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Dickson Hall	Upper level	3	Classroom (# 113)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			
Dickson Hall	Upper level	3	Classroom (# 113)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	3	Classroom (# 113)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	4	Mechanical room (# 112)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	4	Mechanical room (# 112)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	5	Classroom # 111	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	5	Classroom # 111	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	5	Classroom # 111	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	6	Mechanical room (# 110)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	6	Mechanical room (# 110)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	7	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in good condition.	\$1,200.00	4.15.2	1507.3.3	\$1,200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	7	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	8	Social Science Department office lobby (#104)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	8	Social Science Department office lobby (#104)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	8	Social Science Department office lobby (#104)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	9	Private offices (#105-109)	Door Hardware	Door does not have accessible operating hardware.	\$1,250.00	4.13.9	1133B.2.5.1	\$1,250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	9	Private offices (#105-109)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$450.00	4.30.6	1117B.5.2	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	10	Classroom #103	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	10	Classroom #103	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	10	Classroom #103	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	11	Exit door at south end of corridor	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	11	Exit door at south end of corridor	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	12	Classroom # 102	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	12	Classroom # 102	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	12	Classroom # 102	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	13	Laboratory # 122	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	13	Laboratory # 122	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	13	Laboratory # 122	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	14	Classroom # 101	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	14	Classroom # 101	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dickson Hall	Upper level	14	Classroom # 101	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	1	Entrance door on east side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	1	Entrance door on east side	Swinging Door	Hinge approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 36" x 60" or door width plus 42" x 54" (CA only: door width plus 36" x 60").	\$5,000.00	Fig. 25(b)	11B-26A(b)	\$5,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	2	Private offices (#104-110)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$630.00	4.30.6	1117B.5.2	\$630.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	3	Drinking fountain	Drinking Fountain	Drinking fountain water flow less than 4" high; unit in good condition.	\$75.00	4.15.3	1507.3.4	\$75.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	3	Drinking fountain	Drinking Fountain	CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.	\$1,200.00		1117B.1.2	\$1,200.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	4	Women's restroom	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.		Fig. 28	DSA/AC # 99-07				2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	4	Women's restroom	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	4	Women's restroom	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.			Fig.No.31-1B				2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	4	Women's restroom	Grab Bars	Rear grab bar less than 12" from C/L of wc.	\$300.00	4.17.6	1115B.8.1	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	4	Women's restroom	Lavatory	Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).	\$900.00	4.19.3	1504.2.1 C.P.C.	\$900.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

D.S.P.S. Center	Lower Level	4	Women's restroom	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	4	Women's restroom	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.			1115B.7.3				2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	4	Women's restroom	Water Closet	More than 18" from near side wall to center line of water closet.	\$1,000.00	4.17.3	1115B.7.1.3	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	5	Men's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.		Fig. 28	DSA/AC # 99-07				2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	5	Men's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	5	Men's restrooms	Accessories	Seat cover dispenser is less than 18" above the grab bar, as such impedes it's use.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	5	Men's restrooms	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.			Fig.No.31-1B				2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	5	Men's restrooms	Grab Bars	Rear grab bar less than 12" from C/L of wc.	\$300.00	4.17.6	1115B.8.1	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	5	Men's restrooms	Lavatory	Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).	\$900.00	4.19.3	1504.2.1 C.P.C.	\$900.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	5	Men's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	5	Men's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.			1115B.7.3				2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	5	Men's restrooms	Water Closet	More than 18" from near side wall to center line of water closet.	\$1,000.00	4.17.3	1115B.7.1.3	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	6	Exit door on east side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
D.S.P.S. Center	Lower Level	6	Exit door on east side	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$2,600.00	Fig. 25(a)	11B-26A(a)	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	1	Library/Office (# 13)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	1	Library/Office (# 13)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	2	Classroom # 12	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	2	Classroom # 12	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	3	Laboratory # 11	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	3	Laboratory # 11	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	3	Laboratory # 11	Sink	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$240.00	4.24.6	1117B.3	\$240.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	3	Laboratory # 11	Sink	Kitchenette sink rim higher than 34" above floor.		4.24.2	1117B.3				2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	3	Laboratory # 11	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	\$1,850.00	4.24.3	1117B.3	\$1,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	4	Storage room # 10	Door Hardware	Cabinet or storage door / drawer does not have accessible hardware.	\$100.00	4.25.4	1125B.4	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Lower Level	4	Storage room # 10	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	1	Entrance lobby	Directional Sign	No directions posted at inaccessible entrance.	\$90.00	35.163(b)	1117B.5.7	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	1	Entrance lobby	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$150.00		1133B.2.6	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	1	Entrance lobby	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	1	Entrance lobby	Door Threshold	Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.	\$720.00	4.13.8	1133B.2.4.1	\$720.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	1	Entrance lobby	Drinking Fountain	Where only one drinking fountain is provided per floor: Fountain it is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping.	\$2,000.00	4.1.3.(10)(a)	1117B.1.1	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	1	Entrance lobby	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	2	Storage room (# 110)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	3	Dance studio (# 101)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	3	Dance studio (# 101)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	3	Dance studio (# 101)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	3	Dance studio (# 101)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	4	Unisex restroom	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.		Fig. 28	DSA/AC # 99-07				2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	4	Unisex restroom	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$300.00	28 CFR 35.133	1115B.9.2	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	4	Unisex restroom	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Dance/Landscape Buidling	Upper level	4	Unisex restroom	Grab Bars	Rear grab bar less than 36" long, or starting less than 42" from side wall.	\$300.00	4.17.6	1115B.8.1	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	4	Unisex restroom	Grab Bars	Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).	\$300.00	4.17.6	1115B.8.1	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	4	Unisex restroom	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	4	Unisex restroom	Water Closet	More than 18" from near side wall to center line of water closet.	\$1,000.00	4.17.3	1115B.7.1.3	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	4	Unisex restroom	Water Closet	CA only: In single-accommodation restroom less than 48" in front of water closet provided.	\$500.00		1115B.7.2	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	5	Custodial room (# 107)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	6	Warm-up room (#102)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	6	Warm-up room (#102)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	7	Private office (#104)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	8	Men's locker room (#106)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	8	Men's locker room (#106)	Locker Facilities	Lockers do not have accessible operating hardware.	\$450.00	-	3103(a)2D(5)	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	8	Men's locker room (#106)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	8	Men's locker room (#106)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.		4.1.2(7)					2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	9	Women's locker room (#103)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	9	Women's locker room (#103)	Locker Facilities	Lockers do not have accessible operating hardware.	\$450.00	-	3103(a)2D(5)	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	9	Women's locker room (#103)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	9	Women's locker room (#103)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.		4.1.2(7)					2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	10	Private office (#105)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Dance/Landscape Buidling	Upper level	10	Private office (#105)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	1	Entrance door at S.W. end.	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$90.00		1133B.2.6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	1	Entrance door at S.W. end.	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	1	Entrance door at S.W. end.	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	2	Private office (# 15)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	2	Private office (# 15)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	3	Storage room (# 14)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	3	Storage room (# 14)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	4	Private office (# 13)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	4	Private office (# 13)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	5	Photography -Dry lab (# 16)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	5	Photography -Dry lab (# 16)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	5	Photography -Dry lab (# 16)	Fixed Desk	"Fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided."		4.32.3 & 4.32.3	3105(n)				2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	5	Photography -Dry lab (# 16)	Lab	Accessible dry lab fixed work station(s) not provided (5% of stations; not less than one).	\$9,200.00	4.1.3 (18)	3103A(d)1	\$9,200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	5	Photography -Dry lab (# 16)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	6	Photography -Dark room (# 12)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	6	Photography -Dark room (# 12)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	6	Photography -Dark room (# 12)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	6	Photography -Dark room (# 12)	Studio/Shop	"Accessible fixed work station for studio (e.g. art, drafting, language) or vocational shop (e.g. typing, auto mech., darkroom) not provided (5% of stations; not less than one)."	\$4,500.00	4.1.3(18)	3103A(d)2	\$4,500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	6	Photography -Dark room (# 12)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fusselman Hall	Level 1	6	Photography -Dark room (# 12)	Swinging Door	Hinge approach: At push side, door does not have clear and level maneuvering space measuring 54" width (starting at latch) x 42" deep (48" deep if door has both, latch and closer) (CA only: 54" x 44").	\$5,000.00	Fig. 25(b)	11B-26A(b)		\$5,000.00		
Fusselman Hall	Level 1	7	Room # 18	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	7	Room # 18	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	8	Room # 19	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	8	Room # 19	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2		\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8		\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$240.00	4.19.4	1504.2.2		\$240.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Signage	Otherwise compliant sign identifying permanent room or space not mounted 5' high to center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing).	\$50.00	4.30.6	1117B.5.9		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3		\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3					2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Urinal	CA only: Urinal floor-mounted, stall type or trough.	\$4,000.00		1503.2.1 C.P.C.		\$4,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	9	Men's restrooms	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27.4	1502.0		\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	10	Film room (#10-11)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	10	Film room (#10-11)	Fixed Desk	*Fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided.	\$2,876.00	4.32.3 & 4.32.4	3105(n)		\$2,876.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	10	Film room (#10-11)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	11	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	11	Women's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115B.9.2		\$200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	11	Women's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	11	Women's restrooms	Grab Bars	Grab bar clearance not 1-1/2" from wall.	\$500.00	4.26.2	1115B.8.2		\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	11	Women's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$480.00	4.19.4	1504.2.2		\$480.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	11	Women's restrooms	Signage	Otherwise compliant sign identifying permanent room or space not mounted 5' high to center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing).	\$50.00	4.30.6	1117B.5.9		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	11	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	11	Women's restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	12	Exit door to stairs	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1		\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	12	Exit door to stairs	Signage	At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6		\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	13	Rooms #13-15	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$750.00	4.13.9	1133B.2.5.1		\$750.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 1	13	Rooms #13-15	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2		\$270.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	1	Rear entrance doors on west side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	1	Rear entrance doors on west side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	2	Staircase at east entrance	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$680.00	4.9.4(2)	1133B.4.2.2		\$680.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fusselman Hall	Level 2	2	Staircase at east entrance	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$350.00		1133B.4.4		\$350.00		
Fusselman Hall	Level 2	3	Main entrance doors on east side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	3	Main entrance doors on east side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	4	Private office (#122)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	4	Private office (#122)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	5	Store room (#121)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6		\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	5	Store room (#121)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	5	Store room (#121)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	6	Lecture hall (#120)	Assistive Listening	No portable assistive listening system provided for small meeting room.	\$0.00	4.1.3 (19) (b)	1104B.2		\$0.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	6	Lecture hall (#120)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6		\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	6	Lecture hall (#120)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	6	Lecture hall (#120)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$270.00	4.1.3 (16)	1117B.5.2 & 6		\$270.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	7	Com. foundation office (#112)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6		\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	7	Com. foundation office (#112)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	7	Com. foundation office (#112)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	7	Com. foundation office (#112)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	8	Lobby	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$100.00	4.4.1	1121B.1		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	8	Lobby	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3		\$1,900.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	8	Lobby	Drinking Fountain	Drinking fountain water flow less than 4" high; unit in good condition.	\$75.00	4.15.3	1507.3.4		\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	9	Room #100	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	9	Room #100	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	10	Photo studio (#111)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	10	Photo studio (#111)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	10	Photo studio (#111)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	11	Exit doors leading to room (#111) from lobby	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	11	Exit doors leading to room (#111) from lobby	Signage	At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	12	Classroom (#110)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6		\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	12	Classroom (#110)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	12	Classroom (#110)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1		\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	12	Classroom (#110)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2		\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	13	Private offices (#101-106)	Door Hardware	Door does not have accessible operating hardware.	\$1,500.00	4.13.9	1133B.2.5.1		\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	13	Private offices (#101-106)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$540.00	4.30.6	1117B.5.2		\$540.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	14	Exit door at south end	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	14	Exit door at south end	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	15	Elevator	Elevator	"Interior controls top row more than 48" from floor (front approach) or more than 54" high (side approach)."	\$1,970.00	4.10.12(3)*	5103 (d.1) 6A		\$1,970.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	15	Elevator	Elevator	Elevator control panel buttons not illuminated.	\$980.00	4.10.12 (2)	5103 (d.1) 6B.		\$980.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	15	Elevator	Elevator	Braille or tactile symbols at numerals not provided on elevator control panel.	\$110.00	4.10.12(2)	5103 (d.1) 6B.		\$110.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	15	Elevator	Elevator	Neither audible signal nor visual wall lantern provided.	\$2,510.00	4.10.4	5103 (d.1) 9		\$2,510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	15	Elevator	Elevator	"Floor numbers not provided at all elevator entrances with both raised characters 2" high and Braille numbers, on each entrance jamb."	\$50.00	4.10.5*	5103 (d.1) 10.		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	15	Elevator	Elevator	Door reopening device does not remain effective for at least 20 seconds.	\$50.00	4.10.6	3003.4.5		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	16	Interior stairs at south side	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$1,425.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1		\$1,425.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Fusselman Hall	Level 2	16	Interior stairs at south side	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$300.00	4.9.4(2)	1133B.4.2.2	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 2	16	Interior stairs at south side	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$98.00		1133B.4.4	\$98.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	1	Exit door near elevator	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	1	Exit door near elevator	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	2	Private offices (#202-207)	Door Hardware	Door does not have accessible operating hardware.	\$1,500.00	4.13.9	1133B.2.5.1	\$1,500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	2	Private offices (#202-207)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$540.00	4.30.6	1117B.5.2	\$540.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	3	Staircase adjacent to room (#201)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	3	Staircase adjacent to room (#201)	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$340.00	4.9.4(2)	1133B.4.2.2	\$340.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	3	Staircase adjacent to room (#201)	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$1,425.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$1,425.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	3	Staircase adjacent to room (#201)	Signage	At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	3	Staircase adjacent to room (#201)	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$252.00		1133B.4.4	\$252.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	4	Storage room	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Fusselman Hall	Level 3	4	Storage room	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	1	Main entrance vestibule	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$200.00	4.13.10 & 11	1133B.2.5	\$200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	1	Main entrance vestibule	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	1	Main entrance vestibule	Vestibule	"Vestibule length in direction of travel less than width(es) of door(s) swinging into vestibule, plus 48"."	\$200,000.00	4.13.7	3304 (1.1) 2D.	\$200,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	2	Switch board cabin (#139)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only)...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	2	Switch board cabin (#139)	Door Hardware	Door does not have accessible operating hardware.	\$150.00	4.13.9	1133B.2.5.1	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	2	Switch board cabin (#139)	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 38" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	3	Office counter (#101)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only)...or has leaf size less than 36" wide or 80" high).	\$5,200.00	4.13.5	1003.3.1.3a	\$5,200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	3	Office counter (#101)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	3	Office counter (#101)	Door Hardware	Door does not have accessible operating hardware.	\$0.00	4.13.9	1133B.2.5.1	\$0.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	3	Office counter (#101)	Public Counter	Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide).	\$1,200.00	4.32.3 & 4	1122B.3 & 4	\$1,200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	3	Office counter (#101)	Special Transactions	"Special Transactions Counter, minimum length of 36", is not between 28" and 34" high."	\$0.00	7.2(2)	3105A.(1)3 & 3103A(\$0.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	4	Spiral stairs	Elevator	Elevator not provided in multistory building.	\$200,000.00	4	5103	\$200,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	4	Spiral stairs	Handrail	Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).	\$1,920.00		CBC 509	\$1,920.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	4	Spiral stairs	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$300.00	4.9.4(2)	1133B.4.2.2	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	5	Storage room (#102)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	5	Storage room (#102)	Sink	Kitchenette sink rim higher than 34" above floor.		4.24.2	1117B.3				2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	5	Storage room (#102)	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	\$1,850.00	4.24.3	1117B.3	\$1,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	5	Storage room (#102)	Sink	Kitchenette sink is more than 6 1/2" deep.		4.24.4	1117B.3				2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	6	Private offices (#105-112)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	6	Private offices (#105-112)	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$750.00	4.13.10 & 11	1133B.2.5	\$750.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	6	Private offices (#105-112)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$2,000.00	4.13.9	1133B.2.5.1	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	6	Private offices (#105-112)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	6	Private offices (#105-112)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$720.00	4.30.6	1117B.5.2	\$720.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	7	Electrical room (#103)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	7	Electrical room (#103)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	8	Custodian room (#104)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	8	Custodian room (#104)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

	Harlan Center	Lower Level	9	Private offices (#114-121)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$2,000.00	4.13.9	1133B.2.5.1	\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	9	Private offices (#114-121)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	9	Private offices (#114-121)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$720.00	4.30.6	1117B.5.2	\$720.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	10	Exit door adjacent to staircase (#136)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	10	Exit door adjacent to staircase (#136)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	11	Staircase (#136)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	11	Staircase (#136)	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$300.00	4.9.4(2)	1133B.4.2.2	\$300.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	11	Staircase (#136)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	12	Storage room (#130)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	12	Storage room (#130)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	13	Room (#142)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	13	Room (#142)	Door Closer	Floor-mounted closer (internal). Excessive force required to open door and/or door closing time of less than 3 seconds.	\$450.00	4.13.10 & 11	1133B.2.5	\$450.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	13	Room (#142)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	14	Exit door adjacent to classroom #129	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	14	Exit door adjacent to classroom #129	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	15	Classroom #129	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	15	Classroom #129	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	16	Classroom #128	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	16	Classroom #128	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	17	Classroom #127	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	17	Classroom #127	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	18	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in good condition.	\$1,200.00	4.15.2	1507.3.3	\$1,200.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	19	Communications room (#125)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	19	Communications room (#125)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	20	Film Laboratory (#122)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	20	Film Laboratory (#122)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	21	Classroom (#126)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	21	Classroom (#126)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	22	Communication classroom (#124)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	22	Communication classroom (#124)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	23	E.S.L. classroom (#123)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	23	E.S.L. classroom (#123)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	24	Exit door from east corridor to inner courtyard	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$1,500.00	4.13.10 & 11	1133B.2.5	\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	24	Exit door from east corridor to inner courtyard	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	25	Dental Operation Theater (#150)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only... or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	25	Dental Operation Theater (#150)	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	25	Dental Operation Theater (#150)	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	26	Supply room (#157)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	26	Supply room (#157)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	27	Dental Lab	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only... or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	27	Dental Lab	Door Hardware	Door does not have accessible operating hardware.	\$750.00	4.13.9	1133B.2.5.1	\$750.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	27	Dental Lab	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	28	Locker room	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	28	Locker room	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	28	Locker room	Locker Facilities	"Adequate wheelchair space between lockers and benches not provided (44" width needed)."	\$150.00	-	3103(a)2D(5)	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	28	Locker room	Locker Facilities	"Lockers not at proper height for disabled persons (maximum height 54" to hooks, shelves, etc.)."	\$450.00	-	3103(a)2D(5)	\$450.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	28	Locker room	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

	Harlan Center	Lower Level	29	Dental assisting office	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			
	Harlan Center	Lower Level	29	Dental assisting office	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	29	Dental assisting office	Signage	All door leading into exit corridor. Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	29	Dental assisting office	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$400.00	4.4.1	1121B.1	\$400.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$8,100.00	4.19.6	1115B.9.1.2	\$8,100.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$720.00	4.19.4	1504.2.2	\$720.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4				2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$2,600.00	Fig. 25(a)	11B-26A(a)	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Toilet Stall	Toilet stall less than 60" wide.		4.17.3					2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Urinal	CA only: Front of rim projects less than 14" from wall.	\$4,000.00		1503.2.1 C.P.C.	\$4,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Urinal	Fixture mounted with rim more than 17" above floor.		4.18.2	1503.2 C.P.C.				2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Urinal	Urinal flush control lever more than 54" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	30	Men's restrooms (#175)	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27.4	1502.0	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	31	Mechanical room (#177)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	31	Mechanical room (#177)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$400.00	4.4.1	1121B.1	\$400.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Accessories	Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$720.00	4.19.4	1504.2.2	\$720.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4				2004 Access Compliance Survey Report Sally Swanson Architects
	Harlan Center	Lower Level	32	Women's restrooms (#178)	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Harlan Center	Lower Level	32	Women's restrooms (#178)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$2,600.00	Fig. 25(a)	11B-26A(a)	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	32	Women's restrooms (#178)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$2,600.00	Fig. 25(a)	11B-26A(a)	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	32	Women's restrooms (#178)	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	32	Women's restrooms (#178)	Toilet Stall	Toilet stall less than 60" wide.			4.17.3				2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	32	Women's restrooms (#178)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).			4.17.3	1115B.7.2			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	33	Exit door from west corridor to inner courtyard	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	33	Exit door from west corridor to inner courtyard	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Door Hardware	Door does not have accessible operating hardware.		4.13.9	1133B.2.5.1				2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Lavatory	Restroom entry/exit door swings into clear floor space, 30" X 48" in front of fixture. (CA only: less than 18" from side wall to centerline of lavatory)	\$900.00	4.19.3	1504.2.1 C.P.C.	\$900.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$120.00	4.19.4	1504.2.2	\$120.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	34	Women's staff restrooms (#179)	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	35	Nursing Ed. and study (#163)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	35	Nursing Ed. and study (#163)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	35	Nursing Ed. and study (#163)	Sink	Kitchenette sink rim higher than 34" above floor.		4.24.2	1117B.3				2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	35	Nursing Ed. and study (#163)	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	\$1,850.00	4.24.3	1117B.3	\$1,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	35	Nursing Ed. and study (#163)	Sink	Kitchenette sink is more than 6 1/2" deep.		4.24.4	1117B.3				2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	35	Nursing Ed. and study (#163)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$5,000.00	Fig. 25(a)	11B-26A(a)	\$5,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	36	Supply room (#167)	Door Hardware	Door does not have accessible operating hardware.	\$750.00	4.13.9	1133B.2.5.1	\$750.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	36	Supply room (#167)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	36	Supply room (#167)	Sink	Kitchenette sink rim higher than 34" above floor.		4.24.2	1117B.3				2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	36	Supply room (#167)	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	\$1,850.00	4.24.3	1117B.3	\$1,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	36	Supply room (#167)	Sink	Kitchenette sink is more than 6 1/2" deep.		4.24.4	1117B.3				2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	37	Custodian room (#168)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	37	Custodian room (#168)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	38	Nursing lab (#174)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	38	Nursing lab (#174)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	38	Nursing lab (#174)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	39	Classroom #173	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	39	Classroom #173	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	40	Classroom #172	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	40	Classroom #172	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	40	Classroom #172	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	41	Classroom #171	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	41	Classroom #171	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	41	Classroom #171	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	42	Classroom #170	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	42	Classroom #170	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	43	Classroom #169	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Harlan Center	Lower Level	43	Classroom #169	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			
Harlan Center	Lower Level	44	Exit door adjacent to classroom #170	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	44	Exit door adjacent to classroom #170	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	45	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	\$1,850.00	4.15.5(1)	1507.3.1	\$1,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	45	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3				2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	46	Classroom #166	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	46	Classroom #166	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	46	Classroom #166	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	47	Classroom #165	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	47	Classroom #165	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	47	Classroom #165	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$5,000.00	Fig. 25(a)	11B-26A(a)	\$5,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	48	Storage/copy room #164	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	48	Storage/copy room #164	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	49	Classroom #161	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	49	Classroom #161	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Lower Level	49	Classroom #161	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	1	Private offices	Door Hardware	Door does not have accessible operating hardware.	\$5,000.00	4.13.9	1133B.2.5.1	\$5,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	1	Private offices	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$1,800.00	4.30.6	1117B.5.2	\$1,800.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	2	Custodian room #215	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	2	Custodian room #215	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	3	Mechanical room #217	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	3	Mechanical room #217	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	4	Door to fire exit doors	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	4	Door to fire exit doors	Signage	At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	5	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	\$1,850.00	4.15.5(1)	1507.3.1	\$1,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
Harlan Center	Upper Level	5	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3				2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	1	Main entrance	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$750.00	4.13.10 & 11	1133B.2.5	\$750.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	1	Main entrance	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	1	Main entrance	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$2,400.00	4.13.4	1133B.2.3.1	\$2,400.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	1	Main entrance	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$380.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$380.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	1	Main entrance	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$600.00	4.9.4(2)	1133B.4.2.2	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	1	Main entrance	Ramp	Ramp needed to provide disabled access at steps or change of level along path of travel.	\$42,000.00	4.1.1	1127B.1	\$42,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	1	Main entrance	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$168.00		1133B.4.4	\$168.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	2	Child Care Center (#40)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$90.00		1133B.2.6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	2	Child Care Center (#40)	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	2	Child Care Center (#40)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	2	Child Care Center (#40)	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$2,400.00	4.13.4	1133B.2.3.1	\$2,400.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	2	Child Care Center (#40)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	3	Store Rooms (#44-45)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	3	Store Rooms (#44-45)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	4	Restrooms (#43)	Restroom	Multiple accommodation restroom not accessible; multiple compliance violations.	\$23,000.00	4.22	1115B.7.1	\$23,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	4	Restrooms (#43)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	5	Classrooms (#40)	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Lower Level	5	Classrooms (#40)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	1	Human Resources Room (#124)	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Administrative Services	Upper Level	20	Exit door adjacent to room (#101)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			
Administrative Services	Upper Level	20	Exit door adjacent to room (#101)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	20	Exit door adjacent to room (#101)	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	\$450.00	4.2.5	760-10	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	20	Exit door adjacent to room (#101)	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	20	Exit door adjacent to room (#101)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).		Fig. 25(a)	11B-26A(a)				2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	20	Exit door adjacent to room (#101)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only; exterior door width plus 24").	\$2,600.00	Fig. 25(a)	11B-26A(a)	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	21	Pantry/copy room (#110)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115B.9.2	\$200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	21	Pantry/copy room (#110)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	21	Pantry/copy room (#110)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	21	Pantry/copy room (#110)	Sink	Kitchenette sink rim higher than 34" above floor.		4.24.2	1117B.3				2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	21	Pantry/copy room (#110)	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	\$1,850.00	4.24.3	1117B.3	\$1,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	21	Pantry/copy room (#110)	Sink	Kitchenette sink faucet controls not accessible.	\$600.00	4.24.7	1508.0	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	21	Pantry/copy room (#110)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only; exterior door width plus 24").	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	22	Board conference room	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	22	Board conference room	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	22	Board conference room	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$2,400.00	4.13.4	1133B.2.3.1	\$2,400.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Elevator	Elevator not provided in multistory building.	\$200,000.00	4	5103	\$200,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Fire Alarm	Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.	\$450.00	4.2.5	760-10	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Handrail	Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).	\$1,440.00		CBC 509	\$1,440.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$2,375.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$2,375.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$320.00	4.9.4(2)	1133B.4.2.2	\$320.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$300.00	4.9.4(2)	1133B.4.2.2	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	23	Staircase	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$224.00		1133B.4.4	\$224.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control. Accessible coat hook not within reach range.	\$200.00	28 CFR 35.133	1115B.9.2	\$200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Coat Hook		\$75.00	4.2.5	(1110B.1.7)	\$75.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Grab Bars	Side grab bar located more than 12" from rear wall.	\$250.00	Fig. 29		\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Grab Bars	Rear grab bar extends less than 42" from side wall.	\$250.00	4.17.6	1115B.8.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Lavatory	Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).		4.19.3	1504.2.1 C.P.C.				2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Signage	Required in CA only: Identification symbol centered 60" high on sanitary facility door not to be provided with braille/tactile information.	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$4,600.00		1115B.7.3	\$4,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27.4	1502.0	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	24	Unisex restrooms	Water Closet	More than 18" from near side wall to center line of water closet.	\$1,000.00	4.17.3	1115B.7.1.3	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	25	Unisex restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	25	Unisex restrooms	Coat Hook	Accessible coat hook not within reach range.	\$75.00	4.2.5	(1110B.1.7)	\$75.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Administrative Services	Upper Level	25	Unisex restrooms	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00			
Administrative Services	Upper Level	25	Unisex restrooms	Grab Bars	Side grab bar located more than 12" from rear wall.	\$250.00	Fig. 29		\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	25	Unisex restrooms	Grab Bars	Rear grab bar extends less than 42" from side wall.	\$250.00	4.17.6	1115B.8.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	25	Unisex restrooms	Lavatory	Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).		4.19.3	1504.2.1 C.P.C.				2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	25	Unisex restrooms	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	25	Unisex restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	25	Unisex restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not to be provided with braille/tactile information.	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	25	Unisex restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$4,600.00		1115B.7.3	\$4,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Administrative Services	Upper Level	25	Unisex restrooms	Water Closet	More than 18" from rear side wall to center line of water closet.	\$1,000.00	4.17.3	1115B.7.1.3	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	1	Main entrance doors at south side	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$2,250.00	4.13.10 & 11	1133B.2.5	\$2,250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	1	Main entrance doors at south side	Door Threshold	Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.	\$3,000.00	4.13.8	1133B.2.4.1	\$3,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	2	Main hall	Assistive Listening	No signs at the building or assembly area entrance to notify patrons that an assistive listening system is available.		4.1.3 (19) (b)	1104B.2.4				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	2	Main hall	Assistive Listening	"An adequate number of receivers (4% of seating capacity, min. 2) is not available to patrons in theaters with more than 50 seats."		4.1.3(19)(b*)	3103(a)2G(1)				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	2	Main hall	Assistive Listening	No permanently installed assistive listening system provided for smaller assembly area (accommodating 50 to 200 persons).	\$1,700.00	4.1.3 (19) (b)		\$1,700.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	2	Main hall	Fixed Seating	Proper amount of seating for disabled persons at public seating is not provided (>25=1, >50=2, >300=4, >500=6, >500=8+1%).	\$600.00	4.1.2(19)a	1104B.3.4	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	2	Main hall	Fixed Seating	Less than one percent of total seating are aisle seats with removable armrest (at aisle side) that are identified by a sign.	\$350.00	4.1.2(19)a	1104B.3.4	\$350.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	2	Main hall	Fixed Seating	At least one fixed companion seat next to each wheelchair seating area is not provided.	\$350.00	4.33.3	1104B.3.5	\$350.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	2	Main hall	Fixed Seating	CA only: Less than one percent of total seats have at least 24" clear leg space between the front of the seat and any obstruction to accommodate semi-ambulant individuals.	\$350.00		1104B.3.8	\$350.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	2	Main hall	Signage	All door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$270.00	4.1.3 (16)	1117B.5.2 & 6	\$270.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	2	Main hall	Stages	Stage, enclosed and unenclosed platform, backstage areas or orchestra pit not accessible.	\$4,800.00	4.33.5	1104B.3.10	\$4,800.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	3	Entrance lobby	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig	1507.3.1	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	3	Entrance lobby	Drinking Fountain	CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.			1117B.1.2				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	3	Entrance lobby	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	3	Entrance lobby	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	3	Entrance lobby	Ticket Booth	Ticket Booth: Auditorium, theater, stadium, or gymnasium counter is not accessible (with min. 36" counter length and max. 36" high), or auxiliary counter in close proximity not provided.	\$3,000.00	7.2.(2)		\$3,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	4	Women's restrooms	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	4	Women's restrooms	Restroom	Multiple accommodation restroom not accessible; multiple compliance violations.	\$23,000.00	4.22	1115B.7.1	\$23,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	4	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	4	Women's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	5	Staircase in south east corner	Elevator	Elevator not provided in multistory building.	\$200,000.00	4	5103	\$200,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	5	Staircase in south east corner	Handrail	Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).	\$2,850.00	4.8.5 & 4.9.4	1133B.4.1 & B.5.5.1	\$2,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	5	Staircase in south east corner	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$448.00		1133B.4.4	\$448.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	6	Men's restrooms	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	6	Men's restrooms	Restroom	Multiple accommodation restroom not accessible; multiple compliance violations.	\$23,000.00	4.22	1115B.7.1	\$23,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	6	Men's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Lower Level	6	Men's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	1	Central corridor	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$1,500.00	4.13.10 & 11	1133B.2.5	\$1,500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	1	Central corridor	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig	1507.3.1	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Olney Hall	Upper level	1	Central corridor	Drinking Fountain	CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.			1117B.1.2					2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	1	Central corridor	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	1	Central corridor	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3					2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	1	Central corridor	Drinking Fountain	Drinking fountain water flow less than 4" high; unit in poor condition.	\$0.00	4.15.3	1507.3.4	\$0.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	1	Central corridor	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	2	Classroom #101	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	2	Classroom #101	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	2	Classroom #101	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	3	Classroom #102	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	3	Classroom #102	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	3	Classroom #102	Drinking Fountain	Drinking fountain water flow less than 4" high; unit in poor condition.	\$0.00	4.15.3	1507.3.4	\$0.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	3	Classroom #102	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	4	Classroom #103	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	4	Classroom #103	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	4	Classroom #103	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	5	Classroom #104	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	5	Classroom #104	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	5	Classroom #104	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	6	Classroom #105	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$750.00	4.13.10 & 11	1133B.2.5	\$750.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	6	Classroom #105	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	6	Classroom #105	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	7	Classroom #106	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	7	Classroom #106	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	7	Classroom #106	Platform	Access to raised areas and platforms not provided.	\$25,000.00	4.5.2		\$25,000.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	7	Classroom #106	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	8	Storage room #111	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	8	Storage room #111	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	8	Storage room #111	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	9	Classroom #107	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	9	Classroom #107	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	9	Classroom #107	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	10	Classroom #108	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$750.00	4.13.10 & 11	1133B.2.5	\$750.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	10	Classroom #108	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	10	Classroom #108	Platform	Access to raised areas and platforms not provided.	\$25,000.00	4.5.2		\$25,000.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	10	Classroom #108	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	11	Classroom #109	Door Closer	Excessive force required to open door and/or door closing time of less than 3 seconds.	\$375.00	4.13.10 & 11	1133B.2.5	\$375.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	11	Classroom #109	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Olney Hall	Upper level	11	Classroom #109	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	1	Central corridor	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$200.00	4.13.10 & 11	1133B.2.5	\$200.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	1	Central corridor	Drinking Fountain	CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.			1117B.1.2					2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	1	Central corridor	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	1	Central corridor	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.	\$2,000.00	4.15.2	1507.3.3	\$2,000.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	1	Central corridor	Drinking Fountain	Drinking fountain water flow less than 4" high; unit in poor condition.	\$0.00	4.15.3	1507.3.4	\$0.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	1	Central corridor	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	2	Classroom #101	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	2	Classroom #101	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	3	Classroom #102	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	3	Classroom #102	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	4	Classroom #104	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	4	Classroom #104	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	5	Room #103	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Business Management Bui	Lower Level	5	Room #103	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			
Business Management Bui	Lower Level	6	Classroom #105	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	6	Classroom #105	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	7	Room #106	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	7	Room #106	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	8	Custodian's room #107	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	8	Custodian's room #107	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	9	Unisex restroom	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$5,200.00	4.13.5	1003.3.1.3a	\$5,200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	9	Unisex restroom	Restroom	Single accommodation restroom not accessible; multiple compliance violations.	\$17,000.00	4.22	1115B.7.2	\$17,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	9	Unisex restroom	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Business Management Bui	Lower Level	9	Unisex restroom	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	1	Main entrance at north side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	2	Book store (#10)	Book Shelves	CA only: Book shelves are more than 54" maximum height.	\$0.00		1106B.4.3	\$0.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	2	Book store (#10)	Check-out Aisle	Signage identifying accessible check-out aisle not provided above the aisle (CA only: sign should display the international symbol and state "This checkstand to be open at all times for customers with disabilities").	\$1,000.00	7.3(3)	1110B.1.3	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	2	Book store (#10)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	2	Book store (#10)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	2	Book store (#10)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	3	Reprographics (#70)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	3	Reprographics (#20)	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	\$1,850.00	4.15.5(1)	1507.3.1	\$1,850.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	3	Reprographics (#20)	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3				2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	3	Reprographics (#20)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	3	Reprographics (#20)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	4	Mail room (#70)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	4	Mail room (#70)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	4	Mail room (#70)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	5	Instructional Media Services (#66)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	5	Instructional Media Services (#66)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	6	Preview/Conference Room (#65)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	6	Preview/Conference Room (#65)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	7	Teleconference Room (#53)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	7	Teleconference Room (#53)	Fixed Seating	At room with 26-50 fixed seats, fewer than required number of wheelchair seating spaces provided; 2 spaces required.	\$760.00	4.1.3(19)a		\$760.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	7	Teleconference Room (#53)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	8	Atrium Display Units	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$800.00	4.4.1	1121B.1	\$800.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	8	Atrium Display Units	Handrail	Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.	\$340.00	4.9.4(2)	1133B.4.2.2	\$340.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	9	Exit door at south-end	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	9	Exit door at south-end	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	10	Echo Times (#32)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	10	Echo Times (#32)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	10	Echo Times (#32)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	11	Classroom #36	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	11	Classroom #36	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	12	Elevator	Elevator	"Door opening has less than 36" clear opening width. "	\$19,600.00	4.10.9	5103 (d.1) 3.	\$19,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	12	Elevator	Elevator	Small size of car makes elevator difficult to use or unusable by persons in wheelchairs.	\$120,000.00	4.10.9	5103 (d.1) 6	\$120,000.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Learning Resources Center	Lower Level	12	Elevator	Elevator	Call buttons in lobby / hall not centered 3'-6" above floor.	\$450.00	4.10.3	3003.4.9b	\$450.00		
Learning Resources Center	Lower Level	12	Elevator	Elevator	Neither audible signal nor visual wall lantern provided.	\$2,510.00	4.10.4	5103 (d.1) 9	\$2,510.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	12	Elevator	Elevator	*Floor numbers not provided at all elevator entrances with both raised characters 2" high and Braille numbers, on each entrance jamb.*	\$100.00	4.10.5*	5103 (d.1) 10.	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	12	Elevator	Elevator	*Interior controls top row more than 48" from floor (front approach) or more than 54" high (side approach).*	\$1,970.00	4.10.12(3)*	5103 (d.1) 6A	\$1,970.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	12	Elevator	Elevator	Elevator car lacks emergency communication device that is not dependent on speaking/hearing ability of elevator passenger.	\$700.00	4.10.14	5103 (d.1) 6A	\$700.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	12	Elevator	Elevator	Handrail not provided on at least one wall of car.	\$400.00	-	5103 (d.1) 7.	\$400.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	12	Elevator	Elevator	Braille or tactile symbols at numerals not provided on elevator control panel.	\$110.00	4.10.12(2)	5103 (d.1) 6B.	\$110.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	13	Lecture room (#38)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	13	Lecture room (#38)	Non-fixed Desk	Recommended only: Non-fixed desk not at proper height and does not provide proper knee space.	\$1,200.00	4.32.4		\$1,200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	13	Lecture room (#38)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	14	Parking permits counter	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	14	Parking permits counter	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	15	Classroom #39	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	15	Classroom #39	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	16	Classroom #20	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	16	Classroom #20	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	17	C.I.S. Computer Lab. (#35)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$150.00		1133B.2.6	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	17	C.I.S. Computer Lab. (#35)	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	17	C.I.S. Computer Lab. (#35)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	18	C.I.S. Faculty Offices (#23-28)	Door Hardware	Door does not have accessible operating hardware.	\$1,500.00	4.13.9	1133B.2.5.1	\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	18	C.I.S. Faculty Offices (#23-28)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$540.00	4.30.6	1117B.5.2	\$540.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	18	C.I.S. Faculty Offices (#23-28)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	\$1,000.00	Fig. 25(a)	11B-26A(a)	\$1,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	19	Storage/Assembly rooms (#29-31)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$750.00	4.13.9	1133B.2.5.1	\$750.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	19	Storage/Assembly rooms (#29-31)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2	\$270.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Accessible Compart	The location of the stall door is not in front of the clear space (next to the water closet), with a maximum stile width of 4".	\$500.00	4.17.3 & Fig. 30(a)		\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Door Hardware	Door does not have accessible operating hardware.		4.13.9	1133B.2.5.1			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Grab Bars	Rear grab bar less than 36" long, or starting less than 42" from side wall.	\$300.00	4.17.6	1115B.8.1	\$300.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Lavatory	Lavatory: Fixture rim or counter height more than 34" above floor.	\$900.00	4.19.2	1504.2.1 C.P.C.	\$900.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$360.00	4.19.4	1504.2.2	\$360.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3	\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").		Fig. 25(a)	11B-26A(a)			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Urinal	CA only: Front of rim projects less than 14" from wall.	\$4,000.00		1503.2.1 C.P.C.	\$4,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Urinal	Fixture mounted with rim more than 17" above floor.		4.18.2	1503.2 C.P.C.			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	20	Men's restrooms (#15)	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27.4	1502.0	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.		28 CFR 35.133	1115B.9.2			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Accessories	Feminine Tampon Dispenser mounted with control higher than 40" above floor.	\$200.00	28 CFR 35.133	1115.B.9.2	\$200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Accessories	Feminine Napkin Disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00		
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a		\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Grab Bars	Rear grab bar less than 36" long, or starting less than 42" from side wall.	\$300.00	4.17.6	1115B.8.1		\$300.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Lavatory	Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).	\$900.00	4.19.3	1504.2.1 C.P.C.		\$900.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$360.00	4.19.4	1504.2.2		\$360.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3		\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").		Fig. 25(a)	11B-26A(a)				2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	\$4,600.00	4.17.3	1115B.7.2		\$4,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.		4.16.5 & 4.27.4	1502.0				2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	21	Women's restrooms (#17)	Wheelchair Clearance	Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide).	\$850.00	4.3.3	1115B.7.1.3		\$850.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	22	Drinking fountain	Drinking Fountain	Drinking fountain water flow less than 4" high; unit in good condition.	\$75.00	4.15.3	1507.3.4		\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	23	Exit door at east end of building	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	23	Exit door at east end of building	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	24	Exit door adjacent to room #55	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6		\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	24	Exit door adjacent to room #55	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	24	Exit door adjacent to room #55	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$5,000.00	Fig. 25(a)	11B-26A(a)		\$5,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	25	Film editing rooms (#55-59)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$450.00	4.30.6	1117B.5.2		\$450.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	26	Sound editing rooms (#82-86)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$450.00	4.30.6	1117B.5.2		\$450.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	26	Sound editing rooms (#82-86)	Signage	No signs at non-accessible entrances directing persons to an accessible entrance of the building.	\$230.00	4.1.2(7)(c)	1117B.5.7		\$230.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	27	Television studio (#72)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2		\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	27	Television studio (#72)	Signage	No signs at non-accessible entrances directing persons to an accessible entrance of the building.		4.1.2(7)(c)	1117B.5.7				2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Lower Level	28	Edit rooms (#74-76)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2		\$270.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	1	Library (#100)	Book Shelves	CA only: Book shelves are more than 54" maximum height.	\$0.00		1106B.4.3		\$0.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	1	Library (#100)	Desk/Counter	Information desk or circulation counter or section not 36" max. high and min. 36" wide (CA only: top 28" to 34" high, min. 36" counter length).	\$4,000.00	8.3	1122B.4		\$4,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	1	Library (#100)	Open Stack	Open stacks (i.e. public use) do not have min 36" (44" preferred) wide aisles (CA only: 44" min. width at main aisles and 36" min. at end aisles).	\$67,140.00	8.5	1106B.4.2		\$67,140.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	1	Library (#100)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	1	Library (#100)	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6		\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	2	Room #134	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	3	Dean's office #133	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	3	Dean's office #133	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$1,500.00	4.13.4	1133B.2.3.1		\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	3	Dean's office #133	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	4	Faculty study #109	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	4	Faculty study #109	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$1,500.00	4.13.4	1133B.2.3.1		\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	4	Faculty study #109	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	5	Room #136	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1		\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
	Learning Resources Center	Upper Level	5	Room #136	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$1,500.00	4.13.4	1133B.2.3.1		\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Learning Resources Center	Upper Level	5	Room #136	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$2,600.00	Fig. 25(a)	11B-26A(a)	\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	6	Room #108	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	7	Room #111	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	7	Room #111	Sink	Kitchenette sink rim higher than 34" above floor.		4.24.2	1117B.3			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	7	Room #111	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	\$1,850.00	4.24.3	1117B.3	\$1,850.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	7	Room #111	Sink	Kitchenette sink is more than 6 1/2" deep.		4.24.4	1117B.3			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	7	Room #111	Sink	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$120.00	4.24.6	1117B.3	\$120.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	7	Room #111	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	7	Room #111	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$2,600.00	Fig. 25(a)	11B-26A(a)	\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	8	Reference office #107	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	8	Reference office #107	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$1,500.00	4.13.4	1133B.2.3.1	\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	9	Group study rooms #101-106	Door Hardware	Door does not have accessible operating hardware.	\$2,000.00	4.13.9	1133B.2.5.1	\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	9	Group study rooms #101-106	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$12,000.00	4.13.4	1133B.2.3.1	\$12,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	9	Group study rooms #101-106	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$720.00	4.30.6	1117B.5.2	\$720.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	10	Writing Lab #110	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	10	Writing Lab #110	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	10	Writing Lab #110	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	10	Writing Lab #110	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	11	Teaching Resource Center #115	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	11	Teaching Resource Center #115	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	11	Teaching Resource Center #115	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both latch and closer).	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	12	Media Center #120	Non-Fixed Desk	Recommended only: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.	\$1,600.00	4.32.3 & 4		\$1,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	12	Media Center #120	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	13	Private Office #121	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	13	Private Office #121	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$1,500.00	4.13.4	1133B.2.3.1	\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	13	Private Office #121	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	14	Foreign Language Lab #127	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	14	Foreign Language Lab #127	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	15	Computer Lab #150	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	15	Computer Lab #150	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	16	Private office #126	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	16	Private office #126	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$1,500.00	4.13.4	1133B.2.3.1	\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	16	Private office #126	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	17	English skills labs #125-126	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	17	English skills labs #125-126	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$3,000.00	4.13.4	1133B.2.3.1	\$3,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	17	English skills labs #125-126	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	18	Private offices #122-123	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	18	Private offices #122-123	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$3,000.00	4.13.4	1133B.2.3.1	\$3,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	18	Private offices #122-123	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	19	Meeting Room #140	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	20	Staff Break Room #170	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	20	Staff Break Room #170	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	20	Staff Break Room #170	Sink	Food waste disposal at kitchen sink protrudes into knee-space (recommended: remove equipment if requested as a reasonable accommodation by an employee).	\$3,000.00	4.24.3		\$3,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	21	Staff Restroom #194	Directional Sign	No sign at non-accessible room or space directing persons to an accessible that provides the same or equivalent service.	\$90.00	35.163(b); 4.1.6(3)(e)(iii)		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	21	Staff Restroom #194	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	21	Staff Restroom #194	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	21	Staff Restroom #194	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	21	Staff Restroom #194	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Learning Resources Center	Upper Level	22	Unisex Restroom #191	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115B.9.2		\$200.00			
Learning Resources Center	Upper Level	22	Unisex Restroom #191	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a		\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	22	Unisex Restroom #191	Grab Bars	CA only: Back grab bar not at 33" from floor (36" allowed at tank toilet).			1115B.8.1					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	22	Unisex Restroom #191	Lavatory	Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).		4.19.3	1504.2.1 C.P.C.					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	22	Unisex Restroom #191	Lavatory	Wheelchair clearance under lavatory or lavatory counter front edge less than 29" high x 8" deep x 30" wide.		4.19.2	1504.2.1					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	22	Unisex Restroom #191	Restroom	Single accommodation restroom not accessible; multiple compliance violations.	\$17,000.00	4.22	1115B.7.2		\$17,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	22	Unisex Restroom #191	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	22	Unisex Restroom #191	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	22	Unisex Restroom #191	Toilet Stall	CA only: In existing buildings a single accommodation restroom has less than 36" wide x 48" long space in front of a water closet or less than 32" in front when 32" from side wall to water closet are provided.			Fig. 11B-1C					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	22	Unisex Restroom #191	Water Closet	Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").		4.17.3	1115B.7.1.3					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).		4.13.5	1003.3.1.3a					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8		\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$360.00	4.19.4	1504.2.2		\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Stall Door	Stall door opening less than 32" clear (CA only...or less than 34" at side entry door).		4.17.5	1115B.7.1.4					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$2,600.00	Fig. 25(a)	11B-26A(a)		\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3		\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Toilet Stall	Toilet stall less than 60" wide.		4.17.3						2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Urinal	CA only: Front of rim projects less than 14" from wall.	\$4,000.00		1503.2.1 C.P.C.		\$4,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Urinal	Fixture mounted with rim more than 17" above floor.		4.18.2	1503.2 C.P.C.					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.		\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Water Closet	Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").	\$4,600.00	4.17.3	1115B.7.1.3		\$4,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	23	Men's Restroom	Wheelchair Clearance	Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide).	\$1,360.00	4.3.3	1115B.7.1.3		\$1,360.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).		4.13.5	1003.3.1.3a					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8		\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$360.00	4.19.4	1504.2.2		\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Learning Resources Center	Upper Level	24	Women's Restroom	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4				2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$2,600.00	Fig. 25(a)	11B-26A(a)		\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3		\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Toilet Stall	Toilet stall less than 60" wide.		4.17.3					2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Water Closet	Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").	\$4,600.00	4.17.3	1115B.7.1.3		\$4,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	24	Women's Restroom	Wheelchair Clearance	Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide).	\$2,890.00	4.3.3	1115B.7.1.3		\$2,890.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	25	Drinking fountain	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in good condition.	\$1,200.00	4.15.2	1507.3.3		\$1,200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	25	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3		\$1,900.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	26	Exit doors at east side	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	26	Exit doors at east side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$90.00	4.1.3 (16)	1117B.5.2 & 6		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	27	E.O.P.S./Tutoring Center (#160)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	28	Counselor's offices (#161-163)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).	\$7,800.00	4.13.5	1003.3.1.3a		\$7,800.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	28	Counselor's offices (#161-163)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	29	E.O.P.S. Room (#180)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1		\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	29	E.O.P.S. Room (#180)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2		\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	30	Room #30	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Learning Resources Center	Upper Level	30	Room #30	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	1	Entrance doors at south side	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6		\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.	\$2,050.00		Fig.No.31-1B		\$2,050.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8		\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$120.00	4.19.4	1504.2.2		\$120.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.	\$600.00	4.19.5	1504.2.1 C.P.C.		\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9		\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5		\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).	\$1,500.00	4.17.5	1115B.7.1.4		\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$2,600.00	Fig. 25(a)	11B-26A(a)		\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3		\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	\$1,500.00	4.17.3	1115B.7.2		\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Toilet Stall	Toilet stall less than 60" wide.	\$1,500.00	4.17.3			\$1,500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Urinal	CA only: Front of rim projects less than 14" from wall.	\$4,000.00		1503.2.1 C.P.C.		\$4,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	2	Men's restrooms (#139-140)	Urinal	Fixture mounted with rim more than 17" above floor.	\$2,400.00	4.18.2	1503.2 C.P.C.		\$2,400.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	3	Women's restrooms (#144)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	3	Women's restrooms (#144)	Accessories	Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Student Services Building	Lower Level	3	Women's restrooms (#144)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115B.9.2		\$200.00			
Student Services Building	Lower Level	3	Women's restrooms (#144)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	3	Women's restrooms (#144)	Grab Bars	Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).	\$300.00	4.17.6	1115B.8.1		\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	3	Women's restrooms (#144)	Grab Bars	Rear grab bar less than 36" long, or starting less than 42" from side wall.	\$300.00	4.17.6	1115B.8.1		\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	3	Women's restrooms (#144)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	3	Women's restrooms (#144)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door is provided with braille text.	\$100.00		1115B.5		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	3	Women's restrooms (#144)	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	3	Women's restrooms (#144)	Toilet Stall	Toilet stall less than 60" wide.	\$1,500.00	4.17.3			\$1,500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07		\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles not accessible or more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115.B.9.2		\$200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Grab Bars	Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).	\$300.00	4.17.6	1115B.8.1		\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Grab Bars	Rear grab bar less than 36" long, or starting less than 42" from side wall.	\$300.00	4.17.6	1115B.8.1		\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Grab Bars	CA only: Back grab bar not at 33" from floor (36" allowed at tank toilet).			1115B.8.1					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door is provided with braille or raised text.	\$100.00		1115B.5		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	4	Unisex restrooms (# 142)	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$100.00		1115B.7.3		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	5	Entrance lobby at south side	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$100.00	4.4.1	1121B.1		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	5	Entrance lobby at south side	Sign	Signs directing persons to the location of public text telephones not provided where required.	\$150.00	4.30.7(3)	3105A(d)(2)(iii)		\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	5	Entrance lobby at south side	Telephone	Telephone: Clear floor space, 30" wide x 48" out from wall, not provided.	\$2,220.00	4.31.2	1117B.2.2		\$2,220.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	5	Entrance lobby at south side	Telephone	Telephone mounting height greater than 48" to highest operable part (only front reach available).	\$250.00	4.31.3	1118B.5		\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	6	Associated students of emeritus college (# 146)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	6	Associated students of emeritus college (# 146)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	7	Private office (# 145)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	8	Underside of stairs at central atrium	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$3,000.00	4.4.1	1121B.1		\$3,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	9	Cafeteria	Route Sign	No sign by inaccessible route directing persons to an accessible route.	\$170.00	35.163(b)			\$170.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	9	Cafeteria	Turnstile	Alternate entry for disabled individuals not provided within 30' of turnstile or revolving door.	\$1,628.00	4.13.2	3304 (i.4) 2.		\$1,628.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	10	Staff lounge	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6		\$75.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	10	Staff lounge	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	10	Staff lounge	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	10	Staff lounge	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	10	Staff lounge	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$50.00	Fig. 25(a)	11B-26A(a)		\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	11	Student club offices (# 112-115)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$360.00	4.30.6	1117B.5.2		\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	12	Student club offices (# 117-120)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$360.00	4.30.6	1117B.5.2		\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Lower Level	13	Ascom (# 124)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	1	Main entrance at north end of the building	Directional Sign	No directions posted at inaccessible entrance.	\$90.00	35.163(b)	1117B.5.7		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	1	Main entrance at north end of the building	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6		\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	2	Transfer and career center (#202)	Book Shelves	CA only: Book shelves are more than 54" maximum height.	\$0.00		1106B.4.3		\$0.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Student Services Building	Upper level	2	Transfer and career center (#202)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	2	Transfer and career center (#202)	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4		\$150.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	2	Transfer and career center (#202)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	3	Meeting room a (# 203)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5		\$100.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	3	Meeting room a (# 203)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2		\$180.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	4	Drinking fountain at north side	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in good condition.	\$0.00	4.15.2	1507.3.3		\$0.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	4	Drinking fountain at north side	Drinking Fountain	Drinking fountain water flow less than 4" high; unit in good condition.	\$75.00	4.15.3	1507.3.4		\$75.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	4	Drinking fountain at north side	Drinking Fountain	Oval and round drinking fountains: bubbler outlet more than 3" from front edge of fountain (CA only; all drinking fountain bubbler out lets more than 6" from front edge).	\$2,000.00	4.15.3	1507.3.3		\$2,000.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	5	Re-entry counseling (# 206)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	5	Re-entry counseling (# 206)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	6	Counseling rooms	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4		\$150.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	6	Counseling rooms	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$1,260.00	4.30.6	1117B.5.2		\$1,260.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	7	Copy room (# 259)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	7	Copy room (# 259)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	8	Private office (# 258)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6		\$75.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	8	Private office (# 258)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	8	Private office (# 258)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	9	Elevator	Elevator	Braille symbols on floor indicators of each elevator entrance jamb not compliant.	\$100.00		3003.4.16a		\$100.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	10	Staircase on northside of atrium	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$640.00	4.9.4(2)	1133B.4.2.2		\$640.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	10	Staircase on northside of atrium	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$308.00		1133B.4.4		\$308.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	11	Admissions and records (# 255)	Signage	Accessible service location not designated with appropriate sign.	\$110.00	35.163(a)			\$110.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	11	Admissions and records (# 255)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	12	Admissions and records (# 254)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	12	Admissions and records (# 254)	Special Transactions	Enrollment drop-box mounted with deposit slot higher than 48"	\$1,500.00	7.2(2)	3105A.(I)3 & 3103A(c)2A(iii)		\$1,500.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	13	Private office (# 249)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6		\$75.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	13	Private office (# 249)	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4		\$150.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	13	Private office (# 249)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	14	Storage room (# 250)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	15	Private office (# 251)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	16	Assoc. student office	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	17	Student affair P.O.Box	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$600.00	4.4.1	1121B.1		\$600.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	18	Non-fixed table at student affair office	Non-Fixed Desk	Recommended only: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.	\$1,600.00	4.32.3 & 4			\$1,600.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	19	Drinking fountain at south side	Directional Sign	No sign at non-accessible room or space directing persons to an accessible that provides the same or equivalent service.	\$90.00	35.163(b); 4.1.6(3)(e)(iii)			\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	19	Drinking fountain at south side	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).		4.15.5(1) & Fig	1507.3.1			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	20	Electrical room (# 242)	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1		\$250.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	21	Testing room (# 238)	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6		\$75.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	21	Testing room (# 238)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	21	Testing room (# 238)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	21	Testing room (# 238)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	\$500.00	Fig. 25(a)	11B-26A(a)		\$500.00	2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	22	Main entrance at south end of the building	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6		\$180.00	2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Student Services Building	Upper level	23	Staircase at south side of atrium	Handrail Extension	Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$640.00	4.9.4(2)	1133B.4.2.2		\$640.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	23	Staircase at south side of atrium	Stairway	Stairs: There is no 2" wide contrasting color strip 1" from nosing on top & bottom treads (required in CA only).	\$308.00		1133B.4.4		\$308.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	24	Office (# 235)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	25	Financial Aid Office(# 236)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	25	Financial Aid Office(# 236)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	25	Financial Aid Office(# 236)	Signage	Accessible service location not designated with appropriate sign.	\$110.00	35.163(a)			\$110.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	26	Private Office (# 234)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	27	Job placement office (# 234)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5		\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	27	Job placement office (# 234)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	27	Job placement office (# 234)	Signage	Accessible service location not designated with appropriate sign.	\$110.00	35.163(a)			\$110.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	28	Private office (# 230)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	29	Private office (# 231)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.		28 CFR 35.133	1115B.9.2					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.		Fig. 28	DSA/AC # 99-07					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.			Fig.No.31-1B					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Grab Bars	Grab bars not provided or are not code compliant.		4.17.6*	1115B.8					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.		4.19.4	1504.2.2					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.		4.19.5	1504.2.1 C.P.C.					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Restroom	Multiple accommodation restroom not accessible; multiple compliance violations.	\$23,000.00	4.22	1115B.7.1		\$23,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.			1115B.7.3					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Toilet Stall	Toilet stall less than 60" wide.		4.17.3						2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Urinal	CA only: Front of rim projects less than 14" from wall.			1503.2.1 C.P.C.					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	30	Men's restrooms (# 245)	Urinal	Fixture mounted with rim more than 17" above floor.		4.18.2	1503.2 C.P.C.					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.		28 CFR 35.133	1115B.9.2					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.		Fig. 28	DSA/AC # 99-07					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.			Fig.No.31-1B					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Grab Bars	Grab bars not provided or are not code compliant.		4.17.6*	1115B.8					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.		4.19.4	1504.2.2					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Lavatory	Lavatory: Self-closing faucet at accessible lavatory does not remain open for at least 10 seconds.		4.19.5	1504.2.1 C.P.C.					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Restroom	Multiple accommodation restroom not accessible; multiple compliance violations.	\$23,000.00	4.22	1115B.7.1		\$23,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9		\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.			1115B.7.3					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2					2004 Access Compliance Survey Report Sally Swanson Architects
Student Services Building	Upper level	31	Women's restrooms (# 243)	Toilet Stall	Toilet stall less than 60" wide.		4.17.3						2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	1	Main entrance door	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5		\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	1	Main entrance door	Door Threshold	Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.	\$600.00	4.13.8	1133B.2.4.1		\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Temporary Building-1	Lower Level	1	Main entrance door	Signage	Accessible building entrance when not all are accessible not identified with a sign showing the International Symbol of Accessibility.	\$50.00	4.1.2(7)(c)	1117B.5.7	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	2	Campus Police Counter	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	2	Campus Police Counter	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 38" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	3	Classroom #101	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	3	Classroom #101	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	3	Classroom #101	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	4	Classroom #102	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	4	Classroom #102	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	4	Classroom #102	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	5	Classroom #103	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$5,200.00	4.13.5	1003.3.1.3a	\$5,200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	5	Classroom #103	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	5	Classroom #103	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	5	Classroom #103	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only; exterior door width plus 24").	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	6	Classroom #119	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$1,000.00	4.13.5	1003.3.1.3a	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	6	Classroom #119	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	6	Classroom #119	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	6	Classroom #119	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	7	Private office #142	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	7	Private office #142	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	7	Private office #142	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	8	Room #120	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$500.00	4.13.5	1003.3.1.3a	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	8	Room #120	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	8	Room #120	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	8	Room #120	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	9	Private office (#121)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$500.00	4.13.5	1003.3.1.3a	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	9	Private office (#121)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	9	Private office (#121)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	9	Private office (#121)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	10	Open office space (#124)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$1,000.00	4.13.5	1003.3.1.3a	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	10	Open office space (#124)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	10	Open office space (#124)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	11	Room #s 127-128	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$1,000.00	4.13.5	1003.3.1.3a	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	11	Room #s 127-128	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	11	Room #s 127-128	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	11	Room #s 127-128	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	12	Classroom #129	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,000.00	4.13.5	1003.3.1.3a	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	12	Classroom #129	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$200.00	4.13.10 & 11	1133B.2.5	\$200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	12	Classroom #129	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	12	Classroom #129	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	13	Fire exit doors	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	13	Fire exit doors	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	\$1,000.00	Fig. 25(a)	11B-26A(a)	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	14	Drinking fountain	Drinking Fountain	Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).	\$1,850.00	4.15.5(1)	1507.3.1	\$1,850.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Temporary Building-1	Lower Level	14	Drinking fountain	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00			
Temporary Building-1	Lower Level	15	Men's restroom	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.	\$2,050.00		Fig.No.31-1B	\$2,050.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$120.00	4.19.4	1504.2.2	\$120.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4				2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").		Fig. 25(c)	11B-26A(c)				2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3					2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Urinal	CA only: Front of rim projects less than 14" from wall.	\$4,000.00		1503.2.1 C.P.C.	\$4,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Urinal	Fixture mounted with rim more than 17" above floor.		4.18.2	1503.2 C.P.C.				2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	15	Men's restrooms	Water Closet	Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").	\$4,600.00	4.17.3	1115B.7.1.3	\$4,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restroom	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$100.00	28 CFR 35.133	1115B.9.2	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.	\$2,050.00		Fig.No.31-1B	\$2,050.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$120.00	4.19.4	1504.2.2	\$120.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4				2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").		Fig. 25(c)	11B-26A(c)				2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3					2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	16	Women's restrooms	Water Closet	Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").	\$4,600.00	4.17.3	1115B.7.1.3	\$4,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	17	Reception room #105	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	17	Reception room #105	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	17	Reception room #105	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	18	Patrol office #107	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Temporary Building-1	Lower Level	18	Patrol office #107	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	18	Patrol office #107	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	19	Women's locker room #106	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	19	Women's locker room #106	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	19	Women's locker room #106	Locker Facilities	"Adequate wheelchair space between lockers and benches not provided (44" width needed)."	\$150.00	-	3103(a)2D(5)	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	19	Women's locker room #106	Locker Facilities	"Lockers not at proper height for disabled persons (maximum height 54" to hooks, shelves, etc.)."	\$450.00	-	3103(a)2D(5)	\$450.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	19	Women's locker room #106	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	20	Interview room #108	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	20	Interview room #108	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	21	Chief's room #110	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	21	Chief's room #110	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	21	Chief's room #110	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	22	Men's locker room #113	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	22	Men's locker room #113	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	22	Men's locker room #113	Locker Facilities	"Adequate wheelchair space between lockers and benches not provided (44" width needed)."	\$150.00	-	3103(a)2D(5)	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	22	Men's locker room #113	Locker Facilities	"Lockers not at proper height for disabled persons (maximum height 54" to hooks, shelves, etc.)."	\$450.00	-	3103(a)2D(5)	\$450.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	22	Men's locker room #113	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	23	Room #s114-117	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$10,400.00	4.13.5	1003.3.1.3a	\$10,400.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	23	Room #s114-117	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	23	Room #s114-117	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$360.00	4.30.6	1117B.5.2	\$360.00		2004 Access Compliance Survey Report Sally Swanson Architects
Temporary Building-1	Lower Level	24	Exit doors	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	1	Lecture room (#101)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$150.00	4.13.10 & 11	1133B.2.5	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	1	Lecture room (#101)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	1	Lecture room (#101)	Fixed Seating	At room with 51-300 fixed seats, fewer than required number of wheelchair seating spaces provided; 4 spaces required.	\$760.00	4.1.3(19)a		\$760.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	1	Lecture room (#101)	Handrail Extension	Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.	\$1,200.00	4.9.4(2)	1133B.4.2.2	\$1,200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	1	Lecture room (#101)	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$270.00	4.1.3 (16)	1117B.5.2 & 6	\$270.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	1	Lecture room (#101)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2	\$270.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	2	Classroom (#102)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	2	Classroom (#102)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	2	Classroom (#102)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	2	Classroom (#102)	Swinging Door	Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").	\$500.00	Fig. 25(a)	11B-26A(a)	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	3	Classroom (#104)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	4	Facility offices(#107-110)	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	4	Facility offices(#107-110)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$360.00	4.30.6	1117B.5.2	\$360.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	5	Engineering Materials Lab (#111)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	5	Engineering Materials Lab (#111)	Fixed Desk	"Fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided."	\$2,876.00	4.32.3 & 4.32.4	3105(n)	\$2,876.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	5	Engineering Materials Lab (#111)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	6	Classroom #115	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	6	Classroom #115	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	7	Faculty offices #118-119	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	7	Faculty offices #118-119	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	8	Drinking fountain adjacent to room #120	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig	1507.3.1	\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	8	Drinking fountain adjacent to room #120	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	8	Drinking fountain adjacent to room #120	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Science Center	Upper Level	9	Physics Laboratory #120	Door	At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).	\$75.00		1133B.2.6	\$75.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	9	Physics Laboratory #120	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$150.00	4.13.10 & 11	1133B.2.5	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	9	Physics Laboratory #120	Non-Fixed Desk	Recommended only: Non-fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided.	\$1,197.00	4.32.3 & 4.32.4	3105(n)	\$1,197.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	9	Physics Laboratory #120	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2	\$270.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	9	Physics Laboratory #120	Sink	"Sink has more than 34" rim height from floor."	\$2,000.00	4.19.2	1504(a) C.P.C.	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	10	Classroom #124	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	11	Classroom #125	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	11	Classroom #125	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	12	Faculty offices (#127-129)	Door Hardware	Door does not have accessible operating hardware.	\$750.00	4.13.9	1133B.2.5.1	\$750.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	12	Faculty offices (#127-129)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2	\$270.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	13	Faculty offices (#147-150)	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	13	Faculty offices (#147-150)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$360.00	4.30.6	1117B.5.2	\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	14	Rooms (#s151-153, 156-157)	Door Hardware	Door does not have accessible operating hardware.	\$1,250.00	4.13.9	1133B.2.5.1	\$1,250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	14	Rooms (#s151-153, 156-157)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$450.00	4.30.6	1117B.5.2	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	15	Chemistry Laboratories (#s154,155-158)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$150.00	4.13.10 & 11	1133B.2.5	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	15	Chemistry Laboratories (#s154,155-158)	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$1,500.00	4.13.4	1133B.2.3.1	\$1,500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	15	Chemistry Laboratories (#s154,155-158)	Fixed Desk	"Fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided."	\$8,628.00	4.32.3 & 4.32.4	3105(n)	\$8,628.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	15	Chemistry Laboratories (#s154,155-158)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2	\$270.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	15	Chemistry Laboratories (#s154,155-158)	Sink	"Sink has more than 34" rim height from floor."	\$6,000.00	4.19.2	1504(a) C.P.C.	\$6,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	16	Faculty rooms (#s160, 161)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	16	Faculty rooms (#s160, 161)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	17	Geology Labs (#s159 and 166)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$150.00	4.13.10 & 11	1133B.2.5	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	17	Geology Labs (#s159 and 166)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	17	Geology Labs (#s159 and 166)	Fixed Desk	"Fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided."	\$5,752.00	4.32.3 & 4.32.4	3105(n)	\$5,752.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	17	Geology Labs (#s159 and 166)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2	\$270.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	17	Geology Labs (#s159 and 166)	Sink	"Sink has more than 34" rim height from floor."	\$2,000.00	4.19.2	1504(a) C.P.C.	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	18	Faculty rooms (#s162-165)	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	18	Faculty rooms (#s162-165)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$360.00	4.30.6	1117B.5.2	\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	19	Drinking fountain adjacent to room #167	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig	1507.3.1	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	19	Drinking fountain adjacent to room #167	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	19	Drinking fountain adjacent to room #167	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3				2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	20	Geology museum	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	20	Geology museum	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	21	Faculty rooms (#172-175)	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	21	Faculty rooms (#172-175)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	22	Anatomy/Physiology Lab	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	22	Anatomy/Physiology Lab	Fixed Desk	"Fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided."	\$2,876.00	4.32.3 & 4.32.4	3105(n)	\$2,876.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	22	Anatomy/Physiology Lab	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	22	Anatomy/Physiology Lab	Sink	"Sink has more than 34" rim height from floor."	\$2,000.00	4.19.2	1504(a) C.P.C.	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	23	Classroom #177	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	23	Classroom #177	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	24	Room #178	Door Hardware	Non-common use areas within this facility, such as offices, do not have accessible door hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	24	Room #178	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	25	Life Science Museum (#179)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	25	Life Science Museum (#179)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	25	Life Science Museum (#179)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	25	Life Science Museum (#179)	Swinging Door	Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).	\$50.00	Fig. 25(a)	11B-26A(a)	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Science Center	Upper Level	26	Faculty offices (#180-183)	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	26	Faculty offices (#180-183)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$360.00	4.30.6	1117B.5.2	\$360.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	27	Biology Laboratories (#184-185)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	27	Biology Laboratories (#184-185)	Fixed Desk	"Fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided."	\$5,752.00	4.32.3 & 4.32.4	3105(n)	\$5,752.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	27	Biology Laboratories (#184-185)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	27	Biology Laboratories (#184-185)	Sink	"Sink has more than 34" rim height from floor."	\$4,000.00	4.19.2	1504(a) C.P.C.	\$4,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	28	Faculty offices (#186-189)	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	28	Faculty offices (#186-189)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$360.00	4.30.6	1117B.5.2	\$360.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	29	Biology Laboratories (#190-191)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	29	Biology Laboratories (#190-191)	Fixed Desk	"Fixed desk, counter, etc. less than 28" or more than 34" in height, or knee space 27" high x 19" deep x 30" wide not provided."	\$5,752.00	4.32.3 & 4.32.4	3105(n)	\$5,752.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	29	Biology Laboratories (#190-191)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	29	Biology Laboratories (#190-191)	Sink	"Sink has more than 34" rim height from floor."	\$4,000.00	4.19.2	1504(a) C.P.C.	\$4,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	30	Faculty offices (#192-195)	Door Hardware	Door does not have accessible operating hardware.	\$1,000.00	4.13.9	1133B.2.5.1	\$1,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	30	Faculty offices (#192-195)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$360.00	4.30.6	1117B.5.2	\$360.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	31	Drinking fountain adjacent to room #191	Drinking Fountain	Wall- and post-mounted cantilevered units. Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig.	1507.3.1	\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	31	Drinking fountain adjacent to room #191	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in poor condition.		4.15.2	1507.3.3			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	31	Drinking fountain adjacent to room #191	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	32	Rooms #196-197	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	32	Rooms #196-197	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	33	Preparations and projections (#134-135)	Door Hardware	Door does not have accessible operating hardware.	\$750.00	4.13.9	1133B.2.5.1	\$750.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	33	Preparations and projections (#134-135)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2	\$270.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	34	Faculty Mail Room #137	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	34	Faculty Mail Room #137	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	35	Classroom #133	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	35	Classroom #133	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	35	Classroom #133	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	36	Classroom #105	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	36	Classroom #105	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	37	Classroom #130	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	38	Computer room #144-146	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	39	Private office #140	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	39	Private office #140	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$100.00	4.4.1	1121B.1	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115B.9.2	\$200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.	\$2,050.00		Fig.No.31-1B	\$2,050.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Grab Bars	Rear grab bar less than 36" long, or starting less than 42" from side wall.	\$300.00	4.17.6	1115B.8.1	\$300.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$720.00	4.19.4	1504.2.2	\$720.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3	\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").		Fig. 25(c)	11B-26A(c)			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3				2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Science Center	Upper Level	40	Men's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Urinal	CA only: Front of rim projects less than 14" from wall.	\$4,000.00		1503.2.1 C.P.C.	\$4,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Urinal	Fixture mounted with rim more than 17" above floor.		4.18.2	1503.2 C.P.C.			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	40	Men's restrooms	Water Closet	More than 18" from near side wall to center line of water closet.	\$4,600.00	4.17.3	1115B.7.1.3	\$4,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Accessible Route	Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.	\$100.00	4.4.1	1121B.1	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115B.9.2	\$200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Entry Door	CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.	\$2,050.00		Fig.No.31-1B	\$2,050.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Grab Bars	Rear grab bar less than 36" long, or starting less than 42" from side wall.	\$300.00	4.17.6	1115B.8.1	\$300.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$720.00	4.19.4	1504.2.2	\$720.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3	\$600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Swinging Door	Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").		Fig. 25(c)	11B-26A(c)			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3				2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	41	Women's restrooms	Water Closet	More than 18" from near side wall to center line of water closet.	\$4,600.00	4.17.3	1115B.7.1.3	\$4,600.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	42	Drinking fountain adjacent to restrooms	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig.	1507.3.1	\$2,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	42	Drinking fountain adjacent to restrooms	Drinking Fountain	Fountain bubbler not easily activated by lever, push bar, or other accessible control.		4.27.4	1507.3.3			2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	42	Drinking fountain adjacent to restrooms	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00		2004 Access Compliance Survey Report Sally Swanson Architects
Science Center	Upper Level	43	Main entrance/exit doors to central court	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	1	Reception area (#10)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	1	Reception area (#10)	Public Counter	Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.	\$150.00	7.2(3)	1122B.4	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	1	Reception area (#10)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	2	Private offices (#11-13)	Door Hardware	Door does not have accessible operating hardware.	\$750.00	4.13.9	1133B.2.5.1	\$750.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	2	Private offices (#11-13)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$270.00	4.30.6	1117B.5.2	\$270.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	3	Pantry	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	3	Pantry	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	3	Pantry	Sink	Kitchenette sink rim higher than 34" above floor.		4.24.2	1117B.3			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	3	Pantry	Sink	Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.	\$1,850.00	4.24.3	1117B.3	\$1,850.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	3	Pantry	Sink	Kitchenette sink is more than 6 1/2" deep.		4.24.4	1117B.3			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	4	Unisex restrooms	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	4	Unisex restrooms	Restroom	Single accommodation restroom not accessible; multiple compliance violations.	\$17,000.00	4.22	1115B.7.2	\$17,000.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	4	Unisex restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	4	Unisex restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115B.9.2	\$200.00		2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Coat Hook	Accessible coat hook not within reach range.	\$75.00	4.2.5	(1110B.1.7)	\$75.00		2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Physical Educational Comp	Lower Level	5	Women's locker room	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$2,400.00	4.13.4	1133B.2.3.1	\$2,400.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$5,700.00	4.4.1	Fig. 11B-3	\$5,700.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Drinking Fountain	Oval and round drinking fountains: bubbler outlet more than 3" from front edge of fountain (CA only: all drinking fountain bubbler out lets more than 6" from front edge).		4.15.3	1507.3.3				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig	1507.3.1	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Grab Bars	Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).	\$300.00	4.17.6	1115B.8.1	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Grab Bars	Rear grab bar less than 36" long, or starting less than 42" from side wall.	\$300.00	4.17.6	1115B.8.1	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$600.00	4.19.4	1504.2.2	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Locker Facilities	No bench provided at accessible lockers.	\$150.00	-	3103(a)2D(5)	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Locker Facilities	An adequate number of accessible lockers (5% total ; min 1 not provided).	\$450.00	-	3103(a)2D(5)	\$450.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Shower	Grab bar not mounted between 33" to 36" above the shower floor.	\$500.00	Fig. 37(a)	1115B.6.2.4.5	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Shower	CA only: Where extreme vandalism is a consideration, two fixed shower heads that can be operated independently and one mounted at 48" [+/- 1"] are not provided.	\$500.00		1115B.6.2.4.3	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Shower	The bottom of the control area less than 38" or top more than 48" above the shower floor, or area not within 18" of the front of the shower (CA only: center line of controls not at 40" [+/- 1"])	\$800.00	4.27.3	1115B.6.2.4.1	\$800.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	\$1,500.00	4.17.3	1115B.7.2	\$1,500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27.4	1502.0	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	5	Women's locker room	Water Closet	Height of water closet seat less than 17" or more than 19" from floor.	\$1,400.00	4.16.3	1502 C.P.C.	\$1,400.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	6	Private office (#93)	Door Clearance	Door on accessible route has less than 32" clear opening width when 90° open (CA only...or has leaf size less than 36" wide or 80" high).	\$2,600.00	4.13.5	1003.3.1.3a	\$2,600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	6	Private office (#93)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	6	Private office (#93)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	7	Room #91	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	7	Room #91	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Accessories	Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.	\$200.00	28 CFR 35.133	1115B.9.2	\$200.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Coat Hook	Accessible coat hook not within reach range.	\$75.00	4.2.5	(1110B.1.7)	\$75.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$100.00	4.13.10 & 11	1133B.2.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$1,500.00	4.13.4	1133B.2.3.1	\$1,500.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$5,700.00	4.4.1	Fig. 11B-3	\$5,700.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Drinking Fountain	Drinking fountain bubbler more than 36" above floor; unit in good condition.		4.15.2	1507.3.3				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig	1507.3.1	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Grab Bars	Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).	\$300.00	4.17.6	1115B.8.1	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Grab Bars	Rear grab bar less than 36" long, or starting less than 42" from side wall.	\$300.00	4.17.6	1115B.8.1	\$300.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$600.00	4.19.4	1504.2.2	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Locker Facilities	No bench provided at accessible lockers.	\$150.00	-	3103(a)2D(5)	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Locker Facilities	An adequate number of accessible lockers (5% of total; min 1 accessible is not provided.	\$450.00	-	3103(a)2D(5)	\$450.00				
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Shower	Grab bar not mounted between 33" to 36" above the shower floor.	\$500.00	Fig. 37(a)	1115B.6.2.4.5	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Shower	CA only: Where extreme vandalism is a consideration, two fixed shower heads that can be operated independently and one mounted at 48" [+/- 1"] are not provided.	\$500.00		1115B.6.2.4.3	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Shower	The bottom of the control area less than 38" or top more than 48" above the shower floor, or area not within 18" of the front of the shower (CA only: center line of controls not at 40" [+/- 1"]).	\$800.00	4.27.3	1115B.6.2.4.1	\$800.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Signage	At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$180.00	4.1.3 (16)	1117B.5.2 & 6	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Stall Door	Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).	\$100.00	4.17.5	1115B.7.1.4	\$100.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).	\$1,500.00	4.17.3	1115B.7.2	\$1,500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Urinal	CA only: Front of rim projects less than 14" from wall.	\$4,000.00		1503.2.1 C.P.C.	\$4,000.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Urinal	Fixture mounted with rim more than 17" above floor.		4.18.2	1503.2 C.P.C.					2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27.	1502.0	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	8	Men's locker room (#70)	Water Closet	Height of water closet seat less than 17" or more than 19" from floor.	\$1,400.00	4.16.3	1502 C.P.C.	\$1,400.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	9	Private office (#76)	Door Hardware	Door does not have accessible operating hardware.	\$250.00	4.13.9	1133B.2.5.1	\$250.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	9	Private office (#76)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	10	Private office (#77)	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	10	Private office (#77)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	11	Team room	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	11	Team room	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	12	Room #61	Door Hardware	Door does not have accessible operating hardware.	\$500.00	4.13.9	1133B.2.5.1	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	12	Room #61	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	13	Gymnastic room (#60)	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig	1507.3.1	\$2,000.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	13	Gymnastic room (#60)	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$1,900.00	4.4.1	Fig. 11B-3	\$1,900.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	13	Gymnastic room (#60)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	14	Physical Education Department Office (#50)	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$4,800.00	4.13.4	1133B.2.3.1	\$4,800.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	14	Physical Education Department Office (#50)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$180.00	4.30.6	1117B.5.2	\$180.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	15	Private office (#51-56)	Door Hardware	Door does not have accessible operating hardware.	\$2,000.00	4.13.9	1133B.2.5.1	\$2,000.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	15	Private office (#51-56)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$720.00	4.30.6	1117B.5.2	\$720.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	16	Cardio-vascular equipment room (#40)	Door Closer	Floor-mounted closer (internal). Excessive force required to open door and/or door closing time of less than 3 seconds.	\$900.00	4.13.10 & 11	1133B.2.5	\$900.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	16	Cardio-vascular equipment room (#40)	Drinking Fountain	Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).	\$2,000.00	4.15.5(1) & Fig	1507.3.1	\$2,000.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	16	Cardio-vascular equipment room (#40)	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$0.00	4.4.1	Fig. 11B-3	\$0.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	16	Cardio-vascular equipment room (#40)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	17	Pool area	Swimming Pool	*Pool edges, ramps and stairs are not identified by texture and/or color change.*	\$31,390.00	pending	3105(d)4	\$31,390.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	17	Pool area	Swimming Pool	*Pool steps: No 34" high railings, with complying end extensions.*	\$1,568.00	-	3105(d)4	\$1,568.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	18	Men's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	18	Men's restrooms	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	18	Men's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	18	Men's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	18	Men's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$600.00	4.19.4	1504.2.2	\$600.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	18	Men's restrooms	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3	\$600.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	18	Men's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	18	Men's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00				2004 Access Compliance Survey Report Sally Swanson Architects
Physical Educational Comp	Lower Level	18	Men's restrooms	Stall Door	Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).		4.17.5	1115B.7.1.4					2004 Access Compliance Survey Report Sally Swanson Architects

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

Physical Educational Comp	Lower Level	18	Men's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00				
Physical Educational Comp	Lower Level	18	Men's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3					2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	18	Men's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	18	Men's restrooms	Urinal	CA only: Front of rim projects less than 14" from wall.	\$4,000.00		1503.2.1 C.P.C.	\$4,000.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	18	Men's restrooms	Urinal	Fixture mounted with rim more than 17" above floor.		4.18.2	1503.2 C.P.C.				2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	18	Men's restrooms	Urinal	Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.18.4	1503.2 C.P.C.	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	18	Men's restrooms	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27	1502.0	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	18	Men's restrooms	Water Closet	Height of water closet seat less than 17" or more than 19" from floor.	\$1,400.00	4.16.3	1502 C.P.C.	\$1,400.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	18	Men's restrooms	Water Closet	Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").		4.17.3	1115B.7.1.3				2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Accessories	Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.	\$150.00	Fig. 28	DSA/AC # 99-07	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Accessories	Bottom of flat, not tilted mirror more than 40" above floor.	\$150.00	4.19.6	1115B.9.1.2	\$150.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Grab Bars	Grab bars not provided or are not code compliant.	\$500.00	4.17.6*	1115B.8	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Lavatory	Hot or sharp-surfaced water/drain pipe not insulated or covered.	\$600.00	4.19.4	1504.2.2	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Lavatory	Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.	\$600.00	4.19.5	1504.1.3	\$600.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Signage	Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).	\$100.00		1115B.5	\$100.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Signage	Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.	\$90.00	4.1.3(16)(a)	1117B.5.9	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Stall Door	Stall door opening less than 32" clear (CA only: ...or less than 34" at side entry door).		4.17.5	1115B.7.1.4				2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Toilet Stall	CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.	\$2,000.00		1115B.7.3	\$2,000.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Toilet Stall	Toilet stall less than 60" wide.		4.17.3					2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Toilet Stall	Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).		4.17.3	1115B.7.2				2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Water Closet	Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.	\$500.00	4.16.5 & 4.27	1502.0	\$500.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Water Closet	Height of water closet seat less than 17" or more than 19" from floor.	\$1,400.00	4.16.3	1502 C.P.C.	\$1,400.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	19	Women's restrooms	Water Closet	Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").		4.17.3	1115B.7.1.3				2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	20	Gymnasium Lobby (#30)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$400.00	4.13.10 & 11	1133B.2.5	\$400.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	20	Gymnasium Lobby (#30)	Drinking Fountain	Drinking fountain lacks protection for visually impaired persons.	\$3,800.00	4.4.1	Fig. 11B-3	\$3,800.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	20	Gymnasium Lobby (#30)	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$360.00	4.1.3 (16)	1117B.5.2 & 6	\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	21	Gymnasium	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$400.00	4.13.10 & 11	1133B.2.5	\$400.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	21	Gymnasium	Fixed Seating	Less than one percent of total seating are aisle seats with removable armrest (at aisle side) that are identified by a sign.	\$2,100.00	4.1.2(19)a	1104B.3.4	\$2,100.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	21	Gymnasium	Signage	At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.	\$360.00	4.1.3 (16)	1117B.5.2 & 6	\$360.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	22	Weight Training Room (#20)	Door Pair	Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.	\$2,400.00	4.13.4	1133B.2.3.1	\$2,400.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	22	Weight Training Room (#20)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	23	Classroom (#22)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	23	Classroom (#22)	Door Threshold	Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.	\$480.00	4.13.8	1133B.2.4.1	\$480.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	23	Classroom (#22)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	24	Classroom (#23)	Door Closer	Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.	\$50.00	4.13.10 & 11	1133B.2.5	\$50.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	24	Classroom (#23)	Door Threshold	Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.	\$480.00	4.13.8	1133B.2.4.1	\$480.00			2004 Access Compliance Survey Report Sally Swanson Architects	
Physical Educational Comp	Lower Level	24	Classroom (#23)	Signage	Sign designating a permanent room or space does not include Grade 2 Braille.	\$90.00	4.30.6	1117B.5.2	\$90.00			2004 Access Compliance Survey Report Sally Swanson Architects	
K	LRC				Change the turnstile to handicapped gate, Library					Complete		2001 Architectural Barrier Removal Transition Plan	
K	LRC				Provide Signage (Accessible Route*)						pending-not currently funded	possible dup w/ SS estimat	2001 Architectural Barrier Removal Transition Plan
K	LRC				Change out door hardware					Complete			2001 Architectural Barrier Removal Transition Plan
K	LRC				Major upstairs male and female restroom refitting						pending-not currently funded	possible dup w/ SS estimat	2001 Architectural Barrier Removal Transition Plan

MCCD 2004 ACS Report Updated 2014 and 05-04-2016 - Kentfield Campus

K	LRC				Electric door opener, upstairs east side				Complete				2001 Architectural Barrier Removal Transition Plan
K	HC				Major male and female restroom refitting				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	HC				Install threshold ramp Southeast entrance				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	HC				Provide signage (Accessible Route)				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	HC				Change outdoor hardware				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	HC				Install elevator				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	HC				Electric door opener, front main entrance				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Provide signage				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Replace platform elevator				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Change out door hardware				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Major male and female restroom refitting				lower level restrooms not remodeled since new dance ones were installed				2001 Architectural Barrier Removal Transition Plan
K	PA				Minor restroom refitting to dressing area restrooms				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Drama and Music Wings:				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Major male and female restroom wings				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Provide signage (Accessible Route)				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Change out door hardware				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				South and North Wings (Gallery/Lobby)				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Provide signage (Accessible Route)				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Install ramps at main entrance				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Refit Elevator				Complete				2001 Architectural Barrier Removal Transition Plan
K	PA				Change out door hardware				Complete				2001 Architectural Barrier Removal Transition Plan
K	FH				Provide signage (Accessible Route)					incl in SS est	SMC estimate from 2009		2001 Architectural Barrier Removal Transition Plan
K	FH				Change out door hardware					pending			2001 Architectural Barrier Removal Transition Plan
K	FH				Minor male and female restroom refitting					pending			2001 Architectural Barrier Removal Transition Plan
K	FH				Need accessible Rest Room on main level					pending			?
K	FH				Other accessibility upgrades per 2004 VBRP					pending			2004 VBRP
K	DH				Provide Signage				Demolished				2001 Architectural Barrier Removal Transition Plan
K	DH				Refit ADA unisex restroom at Health Center				Demolished				2001 Architectural Barrier Removal Transition Plan
K	DH				Change out door hardware				Demolished				2001 Architectural Barrier Removal Transition Plan
K	DH				Major male and female restroom refitting				Demolished				2001 Architectural Barrier Removal Transition Plan
K	DH				Replace handrails at stairs				Demolished				2001 Architectural Barrier Removal Transition Plan
K	ASC				Provide signage				swing space-to be demolished				2001 Architectural Barrier Removal Transition Plan
K	ASC				Install ADA lab workstations				swing space-to be demolished				2001 Architectural Barrier Removal Transition Plan
K	ASC				Change outdoor hardware				swing space-to be demolished				2001 Architectural Barrier Removal Transition Plan
K	ASC				Major male and female restroom refitting				swing space-to be demolished				2001 Architectural Barrier Removal Transition Plan
K	ASC				Reverse opening direction of restroom doors to out-swing				swing space-to be demolished				2001 Architectural Barrier Removal Transition Plan
K	ASC				Electric door opener, main front entrance				Complete				2001 Architectural Barrier Removal Transition Plan
K	PE				Provide signage				Complete				2001 Architectural Barrier Removal Transition Plan
K	PE				Major male and female restroom refitting				Complete				2001 Architectural Barrier Removal Transition Plan
K	PE				Replace threshold ramps at all exterior exits				Complete				2001 Architectural Barrier Removal Transition Plan
K	PE				Refit male and female shower stalls for ADA				Complete				2001 Architectural Barrier Removal Transition Plan
K	PE				Change out door hardware				Complete				2001 Architectural Barrier Removal Transition Plan
K	PE				Electric door opener, main entrance				Complete				2001 Architectural Barrier Removal Transition Plan
K	BA				Provide signage (Accessible Route)				Demolished				2001 Architectural Barrier Removal Transition Plan
K	BA				Change out door hardware				Demolished				2001 Architectural Barrier Removal Transition Plan
K	DL				Provide signage (Accessible Route)				Demolished				2001 Architectural Barrier Removal Transition Plan
K	DL				Change out door hardware				Demolished				2001 Architectural Barrier Removal Transition Plan
K	Admin				Provide signage (Accessible Route)				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	Admin				Change out door hardware				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	Admin				Construct exterior ramp at North side entrance lower level				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	OH				Construct one unisex accessible restroom lower level				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	OH				Replace threshold ramp lower level main entrance				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	OH				Change out door hardware				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	OH				Install elevator				to be demolished				2001 Architectural Barrier Removal Transition Plan
K	Disabled Students Program				Need better location, currently no meeting privacy					pending-not currently funded			current request: original barriers appear to have been adressed by the current location on the upper level of LRC
K	Student Serv				Provide signage (Accessible Route)				?				2001 Architectural Barrier Removal Transition Plan
K	Student Serv				Install ADA acceptable counter at Registration				Complete				2001 Architectural Barrier Removal Transition Plan
K	Student Serv				Major male and female restroom refitting ??					incl in SS est	SMC estimate from 2009		2001 Architectural Barrier Removal Transition Plan
K	Student Serv				Major male restroom refitting downstairs ??				partial complete	pending-not currently funded			2001 Architectural Barrier Removal Transition Plan
K	Student Serv				Install ADA acceptable counter at Job Placement				Complete				2001 Architectural Barrier Removal Transition Plan
K	Student Serv				Install ADA acceptable counter at Financial Aide				Complete				2001 Architectural Barrier Removal Transition Plan
K	Site Upgrades				Remaining path-of-travel accessibility upgrades per 2004 VBRP						area in front of LRC and SS near creek are currently planned summer 2013		2004 VBRP
K	Site Upgrades				Student Services -main path of travel						area in front of LRC and SS near creek are currently planned summer 2013		?
									\$2,562,236.00	\$740,245.00			
									\$768,670.80	\$222,073.50	30% soft costs		
									\$3,330,906.80	\$962,318.50	subtotal		
									\$1,332,362.72	\$384,927.40	40% escalation from 2004		
									\$4,663,269.52	\$1,347,245.90	Total		