



## College of Marin

### Indian Valley Campus

Access Compliance Survey Report Update

August 2013





## NAVIGATION & LEGEND

Description of Barrier Removal Data Format for Buildings and Site Work

1	2	3	4	5	6	7	8	9	10	11	12	
College of Marin												
Access Compliance Survey Report Update												
Campus: XXXXXXXXXXXXXXXX				Building/Part: Exterior				Area/Floor: On-Site				
Item No	Existing Architectural Barrier and Proposed Solution			Codes / Mitigation Info			Qty	Unit	Cost	Total		
	Funding Source / Mitigation Info											
1	Accessible Parking											
<b>Floor or Ground Surfaces</b>												
11585	<ul style="list-style-type: none"> <li>As-Built Description: Accessible parking space has slope greater than 1/4":12" (2%).</li> <li>As-Built: 3.5%</li> <li>Proposed Solution: Modify slope at accessible parking space.</li> </ul>			PCODE EA05 ADAAG 4.6.3 CSAS 1129B.3.3 ADA ABA 502.4 DSA App. # XX-XXXXXX Year Mitigated 20XX - 20XX Funding Bond Program Mitigation Note Demolish and relocated			575	SF	\$12	\$6900		

- Item Number:** Unique for each part/building in SSA Database.
- Area / Location:** Describes the building location / item title (e.g.: parking lot, room name).
- As-Built:** Description of as-is barrier based on applicable accessibility codes.
- As-is Measurement:** Existing conditions/dimensions.
- Proposed Solution:** Description of steps necessary to remove barrier and, if applicable, an interim solution or notes.
- Funding Source:/ Mitigation Info:** Identifies the DSA application number, funding source, project year and includes additional notes.
- Codes / Info:**
  - PCODE: specifies the relevant SSA database code. Database code plus suffix:
    - REF: data shown for reference only [scope of work related to or covered by other item];
    - NT: non-typical problem or solution.
  - ADAAG, CSAS, ADA ABA and ADA PRow: specifies applicable sections of Federal and State accessibility codes.
- Qty:** Number of units required.
- Unit:** Unit of measurement used to compute cost estimate. LF=linear feet; SF=square feet; JOB=lump sum.
- Cost:** Estimated cost of specific solution per one unit.  
(The final cost of the barrier-removal projects may exceed this estimate based on year of mitigation and design approach.)
- Total:** Total estimated cost for removing identified barrier (multiplied Qty by Cost).
- ID No:** Specifies Facility Number, Area Number: 1= Interior / 0 = Exterior, and Part / Floor Number.



### Access Compliant Report Format

ADA	Americans with Disabilities Act	MoM	Method of mitigation
ADAAG	ADA Accessibility Guidelines	MP	Master priority
ADACO	ADA-Coordinator	MRR	Men's restroom
AFF	Above finished floor	N	North
C.T.P.	Contact third party	N.A.R.	No action required
CA	State of California	NE	Northeast
CDD	Community Development Director	NT	Non-typical
cl	Center line	NW	Northwest
CMGR	City Manager	NWn	Northwest: North side
CP	Chief of Police	NWs	Northwest: South side
CSAS	CA State Accessibility Standards	o.c.	On center
D.A.	Designated accessible	O/R	Official responsible
Dep.	Deputy	PAR	Public Access Route
Dept. Rep	Department representative	P.A.	Physical alteration
DF	Drinking fountain	P.M.	Program modification
DH	Department Head	POT	Path of travel
Dir.	Director	PROW	Public Right of Way
E	East	PTD	Paper towel dispenser
E.D.	Executive Director	PWD	Public Works Director
E.F.	Equivalent facilitation	Qty	Quantity
F-B-F	Facility-Building-Floor	REF	Reference
FC	Fire Chief	S	South
FD	Finance Director	SCD	Seat cover dispenser
Fig.	Figure	SD	Soap dispenser
FM&O	Facilities, Maintenance & Operations	sec.	Second
FND	Feminine napkin dispenser	Sec.	Section
FTD	Feminine tampon dispenser	SE	Southeast
Gov.	Government	SF	Square foot
HQ	Headquarters	SW	Southwest
JOB	per one job (lump sum)	TBD	To be determined
Lab	Laboratory	up	Ramp or stair direction up
Lav	Lavatory	W	West
lbs	Pounds	WC	Water Closet
LF	Linear foot	WRR	Women's Restroom
MOD	Modernization project		

### STANDARDS

PERPENDICULAR CURB RAMP	
Width of Ramp	48" wide min.
Slope of Ramp	8.3% max.
X Slope of the Ramp	2.0% max.
Top Landing Length	48" long min.
Top Landing Slope	2.0% max.
Top Landing X Slope	2.0% max.
Left Flare	10% max.
Right Flare	10% max.
Gutter Slope	5% max.
Gutter X Slope	2% max.
Gutter Lip	0" lip (Flush)
Grooved Borders	12" grooves
Truncated Domes	36" deep x width of ramp
Within Crosswalk	48" within crosswalk

PARALLEL CURB RAMP		
	LEFT	RIGHT
Width of Ramp	48" wide min.	48" wide min.
Slope of Ramp	8.3% max.	8.3% max.
X Slope of the Ramp	2.0% max.	2.0% max.
Top Landing X Slope	2.0% max.	2.0% max.
Bottom Landing Length	48" long x 48" wide	
Bottom Landing Slope	2.0% max.	
Bottom Landing X Slope	2.0% max.	
Gutter Slope	5% max.	
Gutter X Slope	2% max.	
Gutter Lip	0" lip (Flush)	
Grooved Border	12" grooves (on both sides)	
Truncated Domes	36" deep x width of ramp	
Within Crosswalk	48" within crosswalk	

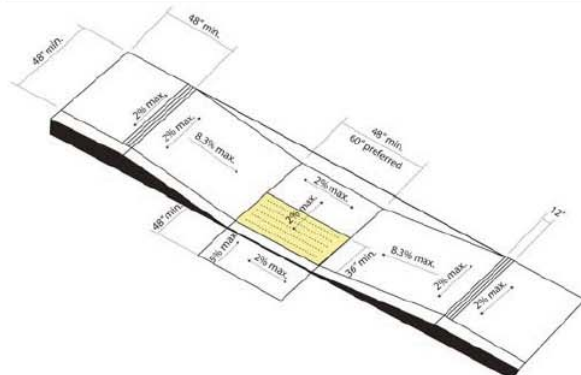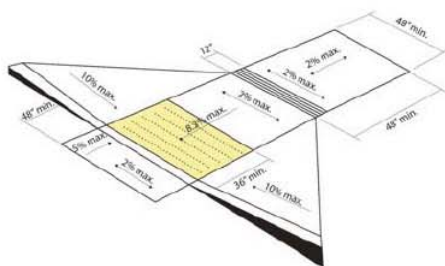



## COST SUMMARY

DSA Application #: **01-106877**

---

Campus: <b>1 Indian Valley Campus</b>	<b>\$214,342.00</b>
Building/Part: <b>8 Administrative Services</b>	<b>\$8,810.00</b>
Area/Floor: 1-8-1 <b>Level 1</b>	<b>\$8,810.00</b>
Building/Part: <b>9 Administrative Services</b>	<b>\$28,015.00</b>
Area/Floor: 1-9-1 <b>Level 1</b>	<b>\$28,015.00</b>
Building/Part: <b>10 Administrative Services</b>	<b>\$3,625.00</b>
Area/Floor: 1-10-1 <b>Level 1</b>	<b>\$3,625.00</b>
Building/Part: <b>11 Administrative Services</b>	<b>\$169,442.00</b>
Area/Floor: 1-11-1 <b>Level 1</b>	<b>\$164,532.00</b>
Area/Floor: 1-11-2 <b>Level 2</b>	<b>\$4,910.00</b>
Building/Part: <b>12 Administrative Services</b>	<b>\$4,450.00</b>
Area/Floor: 1-12-1 <b>Level 1</b>	<b>\$4,450.00</b>

---

DSA Application #: **01-109339**

---

Campus: <b>1 Indian Valley Campus</b>	<b>\$72,010.00</b>
Building/Part: <b>1 Auto Workshop -Building 1</b>	<b>\$37,520.00</b>
Area/Floor: 1-1-1 <b>Level 1</b>	<b>\$37,520.00</b>
Building/Part: <b>2 Auto Workshop -Building 2</b>	<b>\$34,490.00</b>
Area/Floor: 1-2-1 <b>Level 1</b>	<b>\$34,490.00</b>

---

---

DSA Application #: **01-109797**

---

Campus: <b>1 Indian Valley Campus</b>	<b>\$325.00</b>
Building/Part: <b>0 Exterior Site</b>	<b>\$325.00</b>
Area/Floor: 1-0-1 <b>Pomo</b>	<b>\$325.00</b>

---



DSA Application #: **TBD**

Campus: <b>1 Indian Valley Campus</b>	<b>\$1,278,017.00</b>
Building/Part: <b>0 Exterior Site</b>	<b>\$545,460.00</b>
Area/Floor: 1-0-1 <b>Pomo</b>	<b>\$132,145.00</b>
Area/Floor: 1-0-2 <b>Miwok</b>	<b>\$116,655.00</b>
Area/Floor: 1-0-3 <b>Ohlone</b>	<b>\$147,945.00</b>
Area/Floor: 1-0-4 <b>Pool Complex</b>	<b>\$148,715.00</b>
Building/Part: <b>3 Pomo Cluster -Building 3</b>	<b>\$36,575.00</b>
Area/Floor: 1-3-1 <b>Level 1</b>	<b>\$23,295.00</b>
Area/Floor: 1-3-2 <b>Level 2</b>	<b>\$13,280.00</b>
Building/Part: <b>4 Pomo Cluster -Building 4</b>	<b>\$4,910.00</b>
Area/Floor: 1-4-1 <b>Level 1</b>	<b>\$4,910.00</b>
Building/Part: <b>5 Pomo Cluster -Building 5</b>	<b>\$23,535.00</b>
Area/Floor: 1-5-1 <b>Level 1</b>	<b>\$23,535.00</b>
Building/Part: <b>6 Pomo Cluster -Building 6</b>	<b>\$61,000.00</b>
Area/Floor: 1-6-1 <b>Level 1</b>	<b>\$35,325.00</b>
Area/Floor: 1-6-2 <b>Level 2</b>	<b>\$25,675.00</b>
Building/Part: <b>7 Pomo Cluster - Building 7</b>	<b>\$13,660.00</b>
Area/Floor: 1-7-1 <b>Level 1</b>	<b>\$13,660.00</b>
Building/Part: <b>13 Miwok Cluster</b>	<b>\$62,855.00</b>
Area/Floor: 1-13-1 <b>Level 1</b>	<b>\$44,160.00</b>
Area/Floor: 1-13-2 <b>Level 2</b>	<b>\$18,695.00</b>
Building/Part: <b>14 Miwok Cluster</b>	<b>\$6,710.00</b>
Area/Floor: 1-14-2 <b>Level 2</b>	<b>\$6,710.00</b>
Building/Part: <b>15 Miwok Cluster</b>	<b>\$50,210.00</b>
Area/Floor: 1-15-1 <b>Level 1</b>	<b>\$50,210.00</b>
Building/Part: <b>16 Miwok Cluster</b>	<b>\$28,855.00</b>
Area/Floor: 1-16-1 <b>Level 1</b>	<b>\$16,625.00</b>
Area/Floor: 1-16-2 <b>Level 1</b>	<b>\$12,230.00</b>
Building/Part: <b>17 Miwok Cluster</b>	<b>\$264,482.00</b>
Area/Floor: 1-17-1 <b>Level 1</b>	<b>\$194,482.00</b>
Area/Floor: 1-17-2 <b>Level 1</b>	<b>\$70,000.00</b>
Building/Part: <b>18 Ohlone Cluster</b>	<b>\$18,040.00</b>
Area/Floor: 1-18-1 <b>Level 1</b>	<b>\$18,040.00</b>
Building/Part: <b>19 Ohlone Cluster</b>	<b>\$60,375.00</b>
Area/Floor: 1-19-1 <b>Level 1</b>	<b>\$40,560.00</b>
Area/Floor: 1-19-2 <b>Level 1</b>	<b>\$19,815.00</b>
Building/Part: <b>20 Ohlone Cluster</b>	<b>\$36,910.00</b>

---

Area/Floor: 1-20-1	<b>Level 1</b>	<b>\$36,910.00</b>
Building/Part: <b>21</b>	<b>Ohlone Cluster</b>	<b>\$64,440.00</b>
Area/Floor: 1-21-1	<b>Level 1</b>	<b>\$64,440.00</b>

---



## SURVEY DATA

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Main entrance doors</b>						
3624	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 &amp; 6</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$90	\$90
3625	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	2	JOB	\$75	\$150
3626	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 13 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$50	\$50
<b>2 Reception area</b>						
3627	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03</p> <p>ADAAG 4.2.5</p> <p>CSAS 760-10</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$450	\$450
3628	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</p> <p>• <i>As-is Measurement:</i> 18"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02</p> <p>ADAAG 4.15.5(1)</p> <p>CSAS 1507.3.1</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$1,850	\$1,850

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3629	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 41"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>		REF		
3630	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$1,900	<b>\$1,900</b>
3631	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide).</li> <li>• <i>As-is Measurement:</i> 42"</li> <li>• <i>Proposed Solution:</i> Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table.</li> </ul>	PCODE <b>IN03A</b> ADAAG <b>4.32.3 &amp; 4</b> CSAS <b>1122B.3 &amp; 4</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$1,200	<b>\$1,200</b>
3632	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Information brochure bins mounted above accessible height (see IE* codes for dims).</li> <li>• <i>Proposed Solution:</i> Relocate/remount bins at accessible height.</li> </ul>	PCODE <b>IN08</b> ADAAG <b>4.2.5 &amp; 6</b> CSAS <b>1118B.5 &amp; 6</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$100	<b>\$100</b>
3633	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Reach height to control or access point, where side approach is available, exceeds 54" or is less than 9".</li> <li>• <i>Proposed Solution:</i> Modify equipment or mounting.</li> </ul>	PCODE <b>IE02REF</b> ADAAG <b>4.2.6</b> CSAS <b>1118B.6</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>		REF		

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>3 Exit door at south end of reception area</b>						
3634	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li><i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
3635	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li><i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$75	\$75
3636	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li><i>As-is Measurement:</i> 12 lbs</li> <li><i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$50	\$50
<b>4 Private office</b>						
3637	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li><i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
3638	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li><i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$250	\$250

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>5 Mail room</b>						
3639	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$90	\$90
3640	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$250	\$250
3641	<p>• <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.</p> <p>• <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation.</p>	<p>PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$150	\$150
<b>6 Back office</b>						
3642	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>	2	JOB	\$90	\$180
3643	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>	2	JOB	\$250	\$500

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>7 Entrance door to financial aid office</b>						
3644	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
3645	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$250	\$250
3646	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$75	\$75
3647	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$50	\$50
<b>8 Financial aid counter</b>						
3648	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.</li> <li>• <i>As-is Measurement:</i> 42"</li> <li>• <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation.</li> </ul>	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$150	\$150



Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3649	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$250	\$250
3650	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
<b>9 Private office</b>						
3651	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$250	\$250
3652	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90

**Total Costs for****Area/Floor: Level 1****\$8,810.00**

---

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Administrative Services				<b>\$8,810.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Entrance door to suite 100</b>						
3653	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE <b>ID03</b></p> <p>ADAAG <b>4.13.10 &amp; 11</b></p> <p>CSAS <b>1133B.2.5</b></p> <p>Year Mitigated <b>2005-2006</b></p> <p>DSA App. # <b>01-106877</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$50	<b>\$50</b>
3654	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b></p> <p>CSAS <b>1133B.2.6</b></p> <p>Year Mitigated <b>2005-2006</b></p> <p>DSA App. # <b>01-106877</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$75	<b>\$75</b>
3655	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE <b>SA10D</b></p> <p>ADAAG <b>4.1.3 (16)</b></p> <p>CSAS <b>1117B.5.2 &amp; 6</b></p> <p>Year Mitigated <b>2005-2006</b></p> <p>DSA App. # <b>01-106877</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$90	<b>\$90</b>
<b>2 Suite 100</b>						
3656	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE <b>IA05C</b></p> <p>ADAAG <b>4.4.1</b></p> <p>CSAS <b>Fig. 11B-3</b></p> <p>Year Mitigated <b>2005-2006</b></p> <p>DSA App. # <b>01-106877</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$1,900	<b>\$1,900</b>
3657	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE <b>IC03</b></p> <p>ADAAG <b>4.2.5</b></p> <p>CSAS <b>760-10</b></p> <p>Year Mitigated <b>2005-2006</b></p> <p>DSA App. # <b>01-106877</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$450	<b>\$450</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3658	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.</li> <li>• <i>As-is Measurement:</i> 42"</li> <li>• <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation.</li> </ul>	PCODE <b>IN03</b> ADAAG <b>7.2(3)</b> CSAS <b>1122B.4</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <b>Bond Program</b> Mitigation Note <b>Alterations to Administration/Student Services Building</b>	1	JOB	\$150	<b>\$150</b>
3659	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <b>Bond Program</b> Mitigation Note <b>Alterations to Administration/Student Services Building</b>	1	JOB	\$1,850	<b>\$1,850</b>
<b>3 Exit doors at east end</b>						
3660	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <b>Bond Program</b> Mitigation Note <b>Alterations to Administration/Student Services Building</b>	1	JOB	\$90	<b>\$90</b>
3661	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <b>Bond Program</b> Mitigation Note <b>Alterations to Administration/Student Services Building</b>	1	JOB	\$250	<b>\$250</b>
3662	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 13 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <b>Bond Program</b> Mitigation Note <b>Alterations to Administration/Student Services Building</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>4 Conference room</b>						
3663	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	2	JOB	\$250	<b>\$500</b>
3664	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>As-is Measurement:</i> 3"</li> <li>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</li> </ul>	PCODE <b>ID23A</b> ADAAG <b>Fig. 25(a)</b> CSAS <b>11B-26A(a)</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$50	<b>\$50</b>
<b>5 Electrical room</b>						
3665	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Cabinet or storage door / drawer does not have accessible hardware.</li> <li>• <i>Proposed Solution:</i> Provide accessible pull / latch (touch latches or U-pulls).</li> </ul>	PCODE <b>ID07A</b> ADAAG <b>4.25.4</b> CSAS <b>1125B.4</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$100	<b>\$100</b>
3666	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$90	<b>\$90</b>
<b>6 Private offices (#102-103)</b>						
3667	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	2	JOB	\$90	<b>\$180</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3668	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	2	JOB	\$250	\$500
<b>7 Pantry</b>						
3669	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
3670	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$250	\$250
3671	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</li> </ul>	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building		REF		
3672	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$1,850	\$1,850

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3673	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE <b>IN06BREF</b> ADAAG <b>4.24.4</b> CSAS <b>1117B.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>		REF		
3674	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$120	<b>\$120</b>
3675	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 58" S.D: 50"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	2	JOB	\$100	<b>\$200</b>
<b>8 Private office</b>						
3676	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$90	<b>\$90</b>
3677	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>9</b>	<b>Men's restrooms</b>					
3678	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$100	\$100
3679	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$90	\$90
3680	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	2	JOB	\$50	\$100
3681	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 2"</p> <p>• <i>Proposed Solution:</i> Change latch/hinge side of outer door.</p>	<p>PCODE ID24NT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$500	\$500
3682	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 13"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$2,000	\$2,000



Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3683	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 37"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>				REF
3684	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 33" from front edge of wc.</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>				REF
3685	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>				REF
3686	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$500	<b>\$500</b>
3687	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3688	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$100	<b>\$100</b>
3689	<p>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE <b>WE01</b> CSAS <b>1503.2.1 C.P.C.</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$4,000	<b>\$4,000</b>
3690	<p>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>As-is Measurement:</i> 48"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</p>	<p>PCODE <b>WE03</b> ADAAG <b>4.18.4</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$500	<b>\$500</b>
3691	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	2	JOB	\$120	<b>\$240</b>
3692	<p>• <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.</p> <p>• <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory.</p>	<p>PCODE <b>WD06</b> ADAAG <b>4.19.5</b> CSAS <b>1504.1.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$600	<b>\$600</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>10</b>	<b>Women's restrooms</b>					
3693	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$100	\$100
3694	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$90	\$90
3695	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	2	JOB	\$50	\$100
3697	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 13"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$2,000	\$2,000
3698	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 37"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06REF</p> <p>ADAAG 4.17.3</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3699	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 33" from front edge of wc</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>		REF		
3700	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$500	<b>\$500</b>
3701	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>		REF		
3702	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$150	<b>\$150</b>
3703	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3706	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	2	JOB	\$120	<b>\$240</b>
3707	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.</li> <li>• <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory.</li> </ul>	PCODE <b>WD06</b> ADAAG <b>4.19.5</b> CSAS <b>1504.1.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$600	<b>\$600</b>
3708	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$500	<b>\$500</b>
3709	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser not continuous paper flow type.</li> <li>• <i>As-is Measurement:</i> F.T.D: 46" P.T.D: 50"</li> <li>• <i>Proposed Solution:</i> Provide continuous-flow toilet paper dispenser.</li> </ul>	PCODE <b>WG02A</b> ADAAG <b>4.16.6</b> CSAS <b>1115B.9.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	2	JOB	\$75	<b>\$150</b>
<b>11 Staff Lounge</b>						
3710	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	2	JOB	\$250	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3711	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$90	\$90
3712	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$50	\$50
3713	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	2	JOB	\$75	\$150
3714	<p>• <i>As-Built Description:</i> Kitchenette sink does not have knee space (min. 27" high x 19" deep x 30" wide).</p> <p>• <i>Proposed Solution:</i> Replace efficiency kitchen with new sink counter and oven range.</p>	<p>PCODE IN06ANT</p> <p>ADAAG 4.24.3</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$3,000	\$3,000
<b>12 Student Health Services Office</b>						
3715	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$90	\$90

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3716	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	6	JOB	\$250	\$1,500
<b>Total Costs for Area/Floor: Level 1</b>					<b>\$28,015.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Administrative Services				<b>\$28,015.00</b>	



Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>A.S.E.C Room</b>					
3717	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$90	\$90
3718	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$250	\$250
3719	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 12 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$50	\$50
3720	<p>• <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.</p> <p>• <i>As-is Measurement:</i> 41"</p> <p>• <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation.</p>	<p>PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$150	\$150
3721	<p>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</p>	<p>PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building</p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3722	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE <b>IN06A</b> ADAAG <b>4.24.3</b> CSAS <b>1117B.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$1,850	<b>\$1,850</b>
3723	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE <b>IN06BREF</b> ADAAG <b>4.24.4</b> CSAS <b>1117B.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>		REF		
3724	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$120	<b>\$120</b>
3725	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$450	<b>\$450</b>
3726	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$75	<b>\$75</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total	
<b>2 E.O.P. &amp; S. Tutoring Center</b>							
3727	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90	
3728	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	2	JOB	\$250	\$500	
<b>Total Costs for</b>					<b>Area/Floor: Level 1</b>	<b>\$3,625.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Administrative Services				<b>\$3,625.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Hallway</b>						
3729	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 &amp; 6</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	2	JOB	\$90	\$180
3730	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$50	\$50
<b>2 Elevator</b>						
3731	<p>• <i>As-Built Description:</i> "Door opening has less than 36"" clear opening width. "</p> <p>• <i>As-is Measurement:</i> 32"</p> <p>• <i>Proposed Solution:</i> "Enlarge elevator door opening to 36"" width."</p>	<p>PCODE IK03</p> <p>ADAAG 4.10.9</p> <p>CSAS 5103 (d.1) 3.</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$19,600	\$19,600
3732	<p>• <i>As-Built Description:</i> Elevator control panel buttons not illuminated.</p> <p>• <i>Proposed Solution:</i> Provide illuminated elevator control panel buttons .</p>	<p>PCODE IK07B</p> <p>ADAAG 4.10.12 (2)</p> <p>CSAS 5103 (d.1) 6B.</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$980	\$980
3733	<p>• <i>As-Built Description:</i> Elevator car lacks emergency communication device that is not dependent on speaking/hearing ability of elevator passenger.</p> <p>• <i>Proposed Solution:</i> Provide elevator communication device that has combination voice and light signal communications.</p>	<p>PCODE IK06A</p> <p>ADAAG 4.10.14</p> <p>CSAS 5103 (d.1) 6A</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$700	\$700

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3734	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> "Handrail not mounted with top 32"', plus or minus one inch, above the floor of car. "</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> "Remount handrail at 32"' above floor."</li> </ul>	PCODE <b>IK08A</b> - CSAS <b>5103 (d.1) 7.</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$360	<b>\$360</b>
3735	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Neither audible signal nor visual wall lantern provided.</li> <li>• <i>Proposed Solution:</i> "Provide audible signal, and wall lantern device."</li> </ul>	PCODE <b>IK10C</b> ADAAG <b>4.10.4</b> CSAS <b>5103 (d.1) 9</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$2,510	<b>\$2,510</b>
3736	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> "Floor numbers not provided at all elevator entrances with both raised characters 2"' high and Braille numbers, on each entrance jamb."</li> <li>• <i>Proposed Solution:</i> Provide compliant floor numbering on elevator door jambs.</li> </ul>	PCODE <b>IK11</b> ADAAG <b>4.10.5*</b> CSAS <b>5103 (d.1) 10.</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	SET	\$50	<b>\$50</b>
5006	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Small size of car makes elevator difficult to use or unusable by persons in wheelchairs.</li> <li>• <i>As-is Measurement:</i> 57" w x 44" d</li> <li>• <i>Proposed Solution:</i> Provide new elevator with two stops.</li> </ul>	PCODE <b>IK04</b> ADAAG <b>4.10.9</b> CSAS <b>5103 (d.1) 6</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	?	<b>\$120,000</b>
<b>3 Equipment room (#106)</b>						
3737	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3738	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$50	\$50
3739	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$90	\$90
<div style="border: 1px solid black; padding: 5px; display: flex; align-items: center;"> <div style="border: 1px solid black; padding: 2px 10px; margin-right: 10px;"><b>4</b></div> <div><b>Private offices</b></div> </div>						
3740	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	3	JOB	\$90	\$270
3741	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	3	JOB	\$250	\$750
<div style="border: 1px solid black; padding: 5px; display: flex; align-items: center;"> <div style="border: 1px solid black; padding: 2px 10px; margin-right: 10px;"><b>5</b></div> <div><b>Men's restrooms</b></div> </div>						
3742	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$100	\$100

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3743	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$90	\$90
3744	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 8"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID23B</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$2,600	\$2,600
3745	<p>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</p> <p>• <i>As-is Measurement:</i> 17"</p> <p>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</p>	<p>PCODE WB02</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.1.3</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$4,600	\$4,600
3746	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>Proposed Solution:</i> Remove adjacent urinal fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01ANT</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$2,000	\$2,000
3747	<p>• <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall.</p> <p>• <i>As-is Measurement:</i> 39" from side wall</p> <p>• <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar.</p>	<p>PCODE WB07BNT</p> <p>ADAAG 4.17.6</p> <p>CSAS 1115B.8.1</p> <p>Year Mitigated 2005-2006</p> <p>DSA App. # 01-106877</p> <p>Funding Bond Program</p> <p>Mitigation Note Alterations to Administration/Student Services Building</p>	1	JOB	\$300	\$300



Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3748	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Location of flush valve impedes the use of the rear grab bar.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10NT</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$500	<b>\$500</b>
3749	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$120	<b>\$120</b>
3750	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE01</b> CSAS <b>1503.2.1 C.P.C.</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$4,000	<b>\$4,000</b>
3751	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor.</li> <li>• <i>As-is Measurement:</i> 24"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE02REF</b> ADAAG <b>4.18.2</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>		REF		
3752	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>As-is Measurement:</i> 50"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</li> </ul>	PCODE <b>WE03</b> ADAAG <b>4.18.4</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$500	<b>\$500</b>
3753	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 44"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3754	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.</li> <li>• <i>As-is Measurement:</i> 12" protrusion at 48" A.F. F.</li> <li>• <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface.</li> </ul>	PCODE EG04 ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$100	\$100
5007	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE WG02B ADAAG Fig. 28 CSAS DSA/AC # 99-07 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$150	\$150
<b>6 Women's restrooms</b>						
3755	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE SA15 CSAS 1115B.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$100	\$100
3756	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</li> <li>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</li> </ul>	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
3757	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet.</li> <li>• <i>As-is Measurement:</i> 19"</li> <li>• <i>Proposed Solution:</i> Fur out sidewall with 60" x 60" panel to provide 18" dimension. Install grab bar and recess toilet paper dispenser.</li> </ul>	PCODE WB02B ADAAG 4.17.3 CSAS 1115B.7.1.3 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$1,000	\$1,000

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3758	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Location of flush valve impedes the use of the rear grab bar</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10NT</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$500	<b>\$500</b>
3759	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$120	<b>\$120</b>
3760	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$150	<b>\$150</b>
3761	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 4"</li> <li>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</li> </ul>	PCODE <b>WG02BNT</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$150	<b>\$150</b>
3762	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> F.T.D: 44"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3763	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.</li> <li>• <i>As-is Measurement:</i> 12" protrusion at 48"</li> <li>• <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface.</li> </ul>	PCODE EG04 ADAAG 4.4.1 CSAS 1121B.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$100	\$100
<b>7 Conference Training Room (#110)</b>						
3764	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$250	\$250
3765	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
3766	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$50	\$50
<b>8 Staircase</b>						
3767	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	3		\$50	\$150

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3768	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top &amp; bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top &amp; bottom treads when altering area.</p>	<p>PCODE <b>II02B</b></p> <p>CSAS <b>1133B.4.4</b></p> <p>Year Mitigated <b>2005-2006</b></p> <p>DSA App. # <b>01-106877</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	18	LF	\$14	<b>\$252</b>
3769	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE <b>SA10A</b></p> <p>ADAAG <b>4.1.3 (16)</b></p> <p>CSAS <b>1117B.5.2 &amp; 6</b></p> <p>Year Mitigated <b>2005-2006</b></p> <p>DSA App. # <b>01-106877</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$90	<b>\$90</b>
<b>9 Custodial</b>						
3770	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE <b>SA07A</b></p> <p>ADAAG <b>4.30.6</b></p> <p>CSAS <b>1117B.5.2</b></p> <p>Year Mitigated <b>2005-2006</b></p> <p>DSA App. # <b>01-106877</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$90	<b>\$90</b>
3771	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE <b>ID07C</b></p> <p>ADAAG <b>4.13.9</b></p> <p>CSAS <b>1133B.2.5.1</b></p> <p>Year Mitigated <b>2005-2006</b></p> <p>DSA App. # <b>01-106877</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alterations to Administration/Student Services Building</i></p>	1	JOB	\$250	<b>\$250</b>
<b>Total Costs for Area/Floor: Level 1</b>					<b>\$164,532.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Lecture room (#201)</b>						
3772	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	3	JOB	\$250	<b>\$750</b>
3773	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	4	JOB	\$50	<b>\$200</b>
3774	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	2	JOB	\$90	<b>\$180</b>
<b>2 Control room (#202)</b>						
3775	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$90	<b>\$90</b>
3776	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>3 Faculty offices (#203-205)</b>						
3777	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	3		\$250	<b>\$750</b>
3778	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	3	JOB	\$90	<b>\$270</b>
3779	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	1	JOB	\$50	<b>\$50</b>
<b>4 Faculty offices (#207-209)</b>						
3780	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	4	JOB	\$250	<b>\$1,000</b>
3781	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <i>Bond Program</i> Mitigation Note <i>Alterations to Administration/Student Services Building</i>	3	JOB	\$90	<b>\$270</b>

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3782	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$50	\$50
<b>5 Library (#210)</b>						
3783	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
<b>6 Exit doors in hallway</b>						
3784	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "TO EXIT" sign at door.</li> </ul>	PCODE SA10E ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	2	JOB	\$90	\$180
3785	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	2	JOB	\$50	\$100
<b>7 Custodial/electrical room (#213-214)</b>						
3786	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	2	JOB	\$250	\$500



Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3787	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li>   <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2  Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	2	JOB	\$90	\$180
<b>Total Costs for</b>		<b>Area/Floor: Level 2</b>	<b>\$4,910.00</b>			

---

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 2**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Administrative Services				<b>\$169,442.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Classroom for tots (#105)</b>						
3788	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	2	JOB	\$90	\$180
3789	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$250	\$250
3790	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	2	JOB	\$50	\$100
<b>2 Staff restrooms</b>						
3791	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</li> <li>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</li> </ul>	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
3792	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE SA15 CSAS 1115B.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$100	\$100

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3793	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No sign at non-accessible room or space directing persons to an accessible that provides the same or equivalent service.</li> <li>• <i>Proposed Solution:</i> Provide directional sign.</li> </ul>	PCODE SA19 ADAAG 35.163(b); 4.1.6(3)(e)(iii) Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90
<b>3 Classroom #121 for infants</b>						
3794	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	4	JOB	\$50	\$200
<b>4 Campus Bookstore</b>						
3795	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Counter top exceeds 36". Complex code issue: Provision of auxiliary counter per ADAAG triggers California requirement for 34" high full counter.</li> <li>• <i>As-is Measurement:</i> 38"</li> <li>• <i>Proposed Solution:</i> Provide new or remodel existing counter to provide a 36" long section that is 34" high, or obtain variance from local building authority to install an auxiliary counter. Interim: Advise staff to make clip board available.</li> </ul>	PCODE RA01 ADAAG 7.2(1) CSAS 1122B.4 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$2,500	\$2,500
3796	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> In a retail facility of less than 5000 square feet, no accessible check-out aisle is provided (only one required).</li> <li>• <i>Proposed Solution:</i> Provide accessible check-out aisle.</li> </ul>	PCODE RB02REF ADAAG 7.3(1) CSAS 1110B.1.3 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building		REF		
3797	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated 2005-2006 DSA App. # 01-106877 Funding Bond Program Mitigation Note Alterations to Administration/Student Services Building	1	JOB	\$90	\$90

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3798	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 15 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <b>Bond Program</b> Mitigation Note <b>Alterations to Administration/Student Services Building</b>	2	JOB	\$50	<b>\$100</b>
3799	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <b>Bond Program</b> Mitigation Note <b>Alterations to Administration/Student Services Building</b>	2	JOB	\$75	<b>\$150</b>
3800	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.75"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE <b>ID02A</b> ADAAG <b>4.13.8</b> CSAS <b>1133B.2.4.1</b> Year Mitigated <b>2005-2006</b> DSA App. # <b>01-106877</b> Funding <b>Bond Program</b> Mitigation Note <b>Alterations to Administration/Student Services Building</b>	50	SF	\$12	<b>\$600</b>
<b>Total Costs for</b>					<b>Area/Floor: Level 1</b>	<b>\$4,450.00</b>

---

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Administrative Services				<b>\$4,450.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Administrative Services** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Grand Total for</b>		<b>Campus: Indian Valley Campus</b>			<b>\$214,342.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Entrance/exit door at east end</b>					
3801	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$50	\$50
3802	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 &amp; 6</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$90	\$90
3803	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$75	\$75
3804	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03</p> <p>ADAAG 4.2.5</p> <p>CSAS 760-10</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$450	\$450
3805	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID23B</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$2,600	\$2,600



Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Spray booth unit (#148)</b>						
3806	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door on accessible route has less than 32" clear opening width when 90° open (CA only:...or has leaf size less than 36" wide or 80" high).</li> <li>• <i>As-is Measurement:</i> 27"</li> <li>• <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware.</li> </ul>	PCODE <b>ID01</b> ADAAG <b>4.13.5</b> CSAS <b>1003.3.1.3a</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$2,600	<b>\$2,600</b>
3807	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$250	<b>\$250</b>
3808	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$50	<b>\$50</b>
<b>3 Rooms #146, 147, 149</b>						
3809	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	3	JOB	\$250	<b>\$750</b>
3810	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	3	JOB	\$50	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3811	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 6" high.</li> <li>• <i>As-is Measurement:</i> 4.5"</li> <li>• <i>Proposed Solution:</i> Provide ramp including handrails and compliant landings, matching floor level inside door (+/-1/4").</li> </ul>	PCODE <b>ID02B</b> ADAAG <b>4.8.5</b> CSAS <b>1133B.2.4.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	100	SF	\$12	<b>\$1,200</b>
<b>4 Parts xxxxxxxx (#145)</b>						
3812	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$90	<b>\$90</b>
3813	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 13 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$50	<b>\$50</b>
3814	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>As-is Measurement:</i> 3"</li> <li>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</li> </ul>	PCODE <b>ID23A</b> ADAAG <b>Fig. 25(a)</b> CSAS <b>11B-26A(a)</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$50	<b>\$50</b>
3815	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3816	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.</li> <li>• <i>As-is Measurement:</i> 44"</li> <li>• <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation.</li> </ul>	PCODE IN03 ADAAG 7.2(3) CSAS 1122B.4 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions	1	JOB	\$150	\$150
<b>5 O.S &amp; Y. Valve (#144)</b>						
3817	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions	1	JOB	\$90	\$90
3818	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions	1	JOB	\$250	\$250
<b>6 Men's lockers (#143)</b>						
3819	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE SA15 CSAS 1115B.5 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions	1	JOB	\$100	\$100
3820	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</li> <li>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</li> </ul>	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions	1	JOB	\$90	\$90

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3821	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$250	<b>\$250</b>
3822	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$50	<b>\$50</b>
3823	<p>• <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.</p> <p>• <i>As-is Measurement:</i> 12" protrusion, 47" A.F.F.</p> <p>• <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface.</p>	<p>PCODE <b>EG04</b> ADAAG <b>4.4.1</b> CSAS <b>1121B.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$100	<b>\$100</b>
3824	<p>• <i>As-Built Description:</i> Curb or threshold at 30" x 60" shower or more than 1/2" at 36" square shower (CA only: Lip not beveled [45°] or more than 1/2" high).</p> <p>• <i>As-is Measurement:</i> 2"</p> <p>• <i>Proposed Solution:</i> Provide new or modify present shower threshold.</p>	<p>PCODE <b>WF04</b> ADAAG <b>4.21.7</b> CSAS <b>1115B.6.2.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$600	<b>\$600</b>
3825	<p>• <i>As-Built Description:</i> Shower spray unit with hose at least 60" long that can be used fixed and hand-held is not provided (Exception: Where vandalism is a consideration, a fixed shower head mounted at 48" height is allowed).</p> <p>• <i>Proposed Solution:</i> Provide new shower spray unit with hose.</p>	<p>PCODE <b>WF05NT</b> ADAAG <b>4.21.6</b> CSAS <b>1115B.6.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3826	<p>• <i>As-Built Description:</i> In 36" x 36" shower stall, L-shaped grab bar that is located along the full depth of the control wall (opposite the seat) and halfway along the back wall (18") is not provided.</p> <p>• <i>As-is Measurement:</i> 13"</p> <p>• <i>Proposed Solution:</i> Provide new grab bar in shower.</p>	<p>PCODE <b>WF08A</b></p> <p>ADAAG <b>Fig. 37(a)</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$500	<b>\$500</b>
3827	<p>• <i>As-Built Description:</i> In 36" x 36" stall no seat at 17" to 19" height above floor opposite controls provided (CA only: folding seat at 18").</p> <p>• <i>As-is Measurement:</i> 22"</p> <p>• <i>Proposed Solution:</i> Provide new, or relocate, folding wall-mounted shower seat.</p>	<p>PCODE <b>WF07</b></p> <p>ADAAG <b>4.21.3</b></p> <p>CSAS <b>1115B.6.2.4.5</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$550	<b>\$550</b>
3828	<p>• <i>As-Built Description:</i> No accessible bench provided at accessible lockers.</p> <p>• <i>Proposed Solution:</i> Provide accessible bench with adequate wheelchair space between locker and bench.</p>	<p>PCODE <b>GG01NT</b></p> <p>-</p> <p>CSAS <b>3103(a)2D(5)</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$150	<b>\$150</b>
3829	<p>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE <b>WE01</b></p> <p>CSAS <b>1503.2.1 C.P.C.</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$4,000	<b>\$4,000</b>
3830	<p>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>As-is Measurement:</i> 47"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</p>	<p>PCODE <b>WE03</b></p> <p>ADAAG <b>4.18.4</b></p> <p>CSAS <b>1503.2 C.P.C.</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$500	<b>\$500</b>
3832	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE <b>WD05</b></p> <p>ADAAG <b>4.19.4</b></p> <p>CSAS <b>1504.2.2</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$120	<b>\$120</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3833	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> S.D: 45"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$100	<b>\$100</b>
3834	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 14"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$2,000	<b>\$2,000</b>
3835	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 40"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
3836	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
3837	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3838	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$100	<b>\$100</b>
3839	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$500	<b>\$500</b>
3840	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$500	<b>\$500</b>
3841	<p>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</p> <p>• <i>As-is Measurement:</i> 15.5"</p> <p>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</p>	<p>PCODE <b>WB02</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$4,600	<b>\$4,600</b>
3842	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>7 Room (#142)</b>						
3843	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions	1	JOB	\$90	\$90
3844	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions	1	JOB	\$250	\$250
<b>8 Drinking fountain</b>						
3845	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8.5"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions	1	JOB	\$2,000	\$2,000
3846	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 37"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA03BREF ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions		REF		
3847	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE IA05C ADAAG 4.4.1 CSAS Fig. 11B-3 Year Mitigated 2008-2009 DSA App. # 01-109339 Funding Bond Program Mitigation Note Alteration to Transportation Technology Complex and Additions	1	JOB	\$1,900	\$1,900



Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3848	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
<b>9 Women's lockers</b>						
3849	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE <b>SA15</b> CSAS <b>1115B.5</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$100	<b>\$100</b>
3850	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</li> <li>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</li> </ul>	PCODE <b>SA11A</b> ADAAG <b>4.1.3(16)(a)</b> CSAS <b>1117B.5.9</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$90	<b>\$90</b>
3851	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$250	<b>\$250</b>
3852	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3853	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</li> <li>• <i>As-is Measurement:</i> 42" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</li> </ul>	PCODE <b>ID27B</b> ADAAG <b>Fig. 25(c)</b> CSAS <b>11B-26A(c)</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> <i>Mitigation Note</i> <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$2,600	<b>\$2,600</b>
3854	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</li> <li>• <i>As-is Measurement:</i> 42" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</li> </ul>	PCODE <b>WC03BREF</b> CSAS <b>Fig.No.31-1B</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> <i>Mitigation Note</i> <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
3855	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.</li> <li>• <i>As-is Measurement:</i> 12" protrusion at 47"</li> <li>• <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface.</li> </ul>	PCODE <b>EG04</b> ADAAG <b>4.4.1</b> CSAS <b>1121B.1</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> <i>Mitigation Note</i> <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$100	<b>\$100</b>
3856	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No accessible bench section provided at lockers</li> <li>• <i>Proposed Solution:</i> Provide accessible bench with adequate wheelchair space between locker and bench.</li> </ul>	PCODE <b>GG01NT</b> - CSAS <b>3103(a)2D(5)</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> <i>Mitigation Note</i> <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$150	<b>\$150</b>
3857	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Curb or threshold at 30" x 60" shower or more than 1/2" at 36" square shower (CA only: Lip not beveled [45°] or more than 1/2" high).</li> <li>• <i>As-is Measurement:</i> 2"</li> <li>• <i>Proposed Solution:</i> Provide new or modify present shower threshold.</li> </ul>	PCODE <b>WF04</b> ADAAG <b>4.21.7</b> CSAS <b>1115B.6.2.2</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> <i>Mitigation Note</i> <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$600	<b>\$600</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3858	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> In 36" x 36" shower stall, L-shaped grab bar that is located along the full depth of the control wall (opposite the seat) and halfway along the back wall (18") is not provided.</li> <li>• <i>As-is Measurement:</i> 13"</li> <li>• <i>Proposed Solution:</i> Provide new grab bar in shower.</li> </ul>	PCODE <b>WF08A</b> ADAAG <b>Fig. 37(a)</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$500	<b>\$500</b>
3859	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> In 36" x 36" stall no seat at 17" to 19" height above floor opposite controls provided (CA only: folding seat at 18").</li> <li>• <i>As-is Measurement:</i> 23"</li> <li>• <i>Proposed Solution:</i> Provide new, or relocate, folding wall-mounted shower seat.</li> </ul>	PCODE <b>WF07</b> ADAAG <b>4.21.3</b> CSAS <b>1115B.6.2.4.5</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$550	<b>\$550</b>
3860	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$2,000	<b>\$2,000</b>
3861	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 40"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
3862	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 42"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3863	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
3864	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$100	<b>\$100</b>
3865	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$500	<b>\$500</b>
3866	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$150	<b>\$150</b>
3867	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$120	<b>\$120</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3868	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> F.T.D: 51"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$100	<b>\$100</b>
<b>10 Entry/exit door at west side</b>						
3869	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$90	<b>\$90</b>
3870	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$75	<b>\$75</b>
3871	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$50	<b>\$50</b>
3872	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> <i>Year Mitigated</i> <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$450	<b>\$450</b>

**Total Costs for****Area/Floor: Level 1****\$37,520.00**

---

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 1** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Auto Workshop -Building 1				<b>\$37,520.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Entry/exit door at east side</b>					
3873	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 &amp; 6</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$90	\$90
3874	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$75	\$75
3875	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$50	\$50
3876	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$250	\$250
3877	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03</p> <p>ADAAG 4.2.5</p> <p>CSAS 760-10</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$450	\$450

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Room #126</b>						
3878	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE <b>ID07C</b></p> <p>ADAAG <b>4.13.9</b></p> <p>CSAS <b>1133B.2.5.1</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$250	<b>\$250</b>
3879	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b></p> <p>CSAS <b>1133B.2.6</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$75	<b>\$75</b>
<b>3 Auto Lab Shop</b>						
3880	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</p> <p>• <i>As-is Measurement:</i> 8"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE <b>IA02B</b></p> <p>ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b></p> <p>CSAS <b>1507.3.1</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$2,000	<b>\$2,000</b>
3881	<p>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</p> <p>• <i>As-is Measurement:</i> 37"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE <b>IA03BREF</b></p> <p>ADAAG <b>4.15.2</b></p> <p>CSAS <b>1507.3.3</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>		REF		
3882	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</p> <p>• <i>As-is Measurement:</i> 18"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE <b>IA02REF</b></p> <p>ADAAG <b>4.15.5(1)</b></p> <p>CSAS <b>1507.3.1</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>		REF		



Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3883	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$1,900	<b>\$1,900</b>
5004	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Eye wash spout more than 36" above floor.</li> <li>• <i>As-is Measurement:</i> 39"</li> <li>• <i>Proposed Solution:</i> Remount eye-wash at accessible height.</li> </ul>	PCODE <b>LB02NT</b> ADAAG <b>4.1.3(18)</b> CSAS <b>3103A(d)2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$1,200	<b>\$1,200</b>
5005	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At medical cabinet, reach height to opening latch, where side approach is available, exceeds 54".</li> <li>• <i>As-is Measurement:</i> 58"</li> <li>• <i>Proposed Solution:</i> Modify emergency shower handle to be within 48" A.F.F.</li> </ul>	PCODE <b>IE01NT</b> ADAAG <b>4.2.5</b> CSAS <b>1118B.5</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB		
<b>4 Tool room (#124)</b>						
3884	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$90	<b>\$90</b>
3885	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3886	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$75	\$75
3887	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$50	\$50
3888	<p>• <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.</p> <p>• <i>As-is Measurement:</i> 44"</p> <p>• <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation.</p>	<p>PCODE IN03</p> <p>ADAAG 7.2(3)</p> <p>CSAS 1122B.4</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$150	\$150
<b>5 Men's lockers</b>						
3889	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$100	\$100
3890	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$90	\$90

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3891	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE <b>ID03</b></p> <p>ADAAG <b>4.13.10 &amp; 11</b></p> <p>CSAS <b>1133B.2.5</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <b>Bond Program</b></p> <p>Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b></p>	1	JOB	\$50	<b>\$50</b>
3892	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 4"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE <b>ID23B</b></p> <p>ADAAG <b>Fig. 25(a)</b></p> <p>CSAS <b>11B-26A(a)</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <b>Bond Program</b></p> <p>Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b></p>	1	JOB	\$2,600	<b>\$2,600</b>
3893	<p>• <i>As-Built Description:</i> "Adequate wheelchair space between lockers and benches not provided (44" width needed)."</p> <p>• <i>Proposed Solution:</i> Remove and relocate bench and patch floor to provide adequate wheelchair space between locker and bench.</p>	<p>PCODE <b>GG01</b></p> <p>-</p> <p>CSAS <b>3103(a)2D(5)</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <b>Bond Program</b></p> <p>Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b></p>	1	JOB	\$150	<b>\$150</b>
3894	<p>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE <b>WE01</b></p> <p>CSAS <b>1503.2.1 C.P.C.</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <b>Bond Program</b></p> <p>Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b></p>	1	JOB	\$4,000	<b>\$4,000</b>
3895	<p>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>As-is Measurement:</i> 46"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</p>	<p>PCODE <b>WE03</b></p> <p>ADAAG <b>4.18.4</b></p> <p>CSAS <b>1503.2 C.P.C.</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <b>Bond Program</b></p> <p>Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b></p>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3896	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$120	<b>\$120</b>
3897	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 48"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$100	<b>\$100</b>
3898	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> 30" x 48" clear floor space in front of accessible urinal not provided.</li> <li>• <i>Proposed Solution:</i> Provide clear floor space in front of accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE04</b> ADAAG <b>4.18.3</b> CSAS <b>1115B.9.4</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$1,500	<b>\$1,500</b>
3899	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 13"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$2,000	<b>\$2,000</b>
3900	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 35"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
3901	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3902	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
3903	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$500	<b>\$500</b>
3904	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$500	<b>\$500</b>
3905	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$150	<b>\$150</b>
3906	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</li> <li>• <i>As-is Measurement:</i> 15"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet.</li> </ul>	PCODE <b>WB08</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$1,400	<b>\$1,400</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>6 Drinking fountain</b>						
3907	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 38"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
3908	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02B</b> ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$2,000	<b>\$2,000</b>
3909	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>		REF		
3910	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$1,900	<b>\$1,900</b>
<b>7 Room #133</b>						
3911	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE <b>ID07C</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>8</b>	<b>Women's lockers</b>					
3912	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$100	\$100
3913	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$90	\$90
3914	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$50	\$50
3915	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 42" deep</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID27B</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>	1	JOB	\$2,600	\$2,600
3916	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 42" deep</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</p>	<p>PCODE WC03BREF</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated 2008-2009</p> <p>DSA App. # 01-109339</p> <p>Funding Bond Program</p> <p>Mitigation Note Alteration to Transportation Technology Complex and Additions</p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3917	<p>• <i>As-Built Description:</i> "Adequate wheelchair space between lockers and benches not provided (44" width needed)."</p> <p>• <i>Proposed Solution:</i> Remove and relocate bench and patch floor to provide adequate wheelchair space between locker and bench.</p>	<p>PCODE <b>GG01</b></p> <p>-</p> <p>CSAS <b>3103(a)2D(5)</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$150	<b>\$150</b>
3918	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 9.5"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE <b>WB01A</b></p> <p>CSAS <b>1115B.7.3</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$2,000	<b>\$2,000</b>
3919	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE <b>WB06REF</b></p> <p>ADAAG <b>4.17.3</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>		REF		
3920	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 30"</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE <b>WB03REF</b></p> <p>ADAAG <b>4.17.3</b></p> <p>CSAS <b>1115B.7.2</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>		REF		
3921	<p>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</p> <p>• <i>As-is Measurement:</i> 30"</p> <p>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</p>	<p>PCODE <b>WB05REF</b></p> <p>ADAAG <b>4.17.5</b></p> <p>CSAS <b>1115B.7.1.4</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>		REF		
3922	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE <b>WB10</b></p> <p>ADAAG <b>4.16.5 &amp; 4.27.4</b></p> <p>CSAS <b>1502.0</b></p> <p>Year Mitigated <b>2008-2009</b></p> <p>DSA App. # <b>01-109339</b></p> <p>Funding <i>Bond Program</i></p> <p>Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i></p>	1	JOB	\$500	<b>\$500</b>



Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3923	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</li> <li>• <i>As-is Measurement:</i> 15"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet.</li> </ul>	PCODE <b>WB08</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$1,400	<b>\$1,400</b>
3924	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$500	<b>\$500</b>
3925	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 4"</li> <li>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</li> </ul>	PCODE <b>WG02BNT</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$150	<b>\$150</b>
3926	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$150	<b>\$150</b>
3927	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$120	<b>\$120</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3928	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> F.T.D: 50" P.T.D: 48"</li> <li>• <i>Proposed Solution:</i> S.D: 46" Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <b>Bond Program</b> Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b>	3	JOB	\$100	<b>\$300</b>
<b>9 Entry/exit door adjacent to women's locker room</b>						
3929	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <b>Bond Program</b> Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b>	1	JOB	\$90	<b>\$90</b>
3930	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <b>Bond Program</b> Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b>	1	JOB	\$75	<b>\$75</b>
3931	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 12 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <b>Bond Program</b> Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b>	1	JOB	\$50	<b>\$50</b>
3932	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <b>Bond Program</b> Mitigation Note <b>Alteration to Transportation Technology Complex and Additions</b>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3933	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	1	JOB	\$450	<b>\$450</b>
3934	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.75"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE <b>ID02A</b> ADAAG <b>4.13.8</b> CSAS <b>1133B.2.4.1</b> Year Mitigated <b>2008-2009</b> DSA App. # <b>01-109339</b> Funding <i>Bond Program</i> Mitigation Note <i>Alteration to Transportation Technology Complex and Additions</i>	50	SF	\$12	<b>\$600</b>
<b>Total Costs for</b>		<b>Area/Floor: Level 1</b>				<b>\$34,490.00</b>

---

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Auto Workshop -Building 2				<b>\$34,490.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Auto Workshop -Building 2** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Grand Total for</b>	<b>Campus: Indian Valley Campus</b>				<b>\$72,010.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pomo**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Accessible Parking at Parking Lot #2</b>					
1551	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Signage: No "Tow Away" sign at parking lot entrance (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide "Tow Away" sign at parking lot entrance when altering area.</li> </ul>	PCODE EA04C	1	JOB	\$325	<b>\$325</b>
		CSAS 1129B.5				
		Year Mitigated <b>TBD</b>				
		DSA App. # <b>01-109797</b>				
		Funding <i>Bond Program</i>				
		Mitigation Note <i>Demolished And Replaced With Main Building Complex</i>				
<b>Total Costs for</b>		<b>Area/Floor: Pomo</b>	<b>\$325.00</b>			

---

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pomo**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Exterior Site				<b>\$325.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pomo**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Grand Total for</b>	<b>Campus: Indian Valley Campus</b>				<b>\$325.00</b>	



Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pomo**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 P.O.T. from Accessible Parking to Pomo Complex</b>						
1610	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Paved area has excessively rough, irregular surface.</li> <li>• <i>Proposed Solution:</i> Repave area to provide smooth surface for path of travel.</li> </ul>	PCODE EF10A ADAAG 4.5.2 CSAS 1133B.7.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1200	SF	\$6	<b>\$7,200</b>
<b>3 Ramps within Pomo Complex (Building #'s 3-7)</b>						
1611	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</li> <li>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</li> </ul>	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	350	LF	\$95	<b>\$33,250</b>
1612	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1613	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.</li> <li>• <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece).</li> </ul>	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1614	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.</li> <li>• <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide.</li> </ul>	PCODE EB14 ADAAG 4.8.7 CSAS 1133B.5.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	200	LF	\$17	<b>\$3,400</b>
1615	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).</li> <li>• <i>Proposed Solution:</i> Provide new guardrail, including handrail at ramp.</li> </ul>	PCODE ED08REF CSAS CBC 509 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pomo**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1616	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%).</li> <li>• <i>As-is Measurement:</i> 8.4% - 9.3%</li> <li>• <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails.</li> </ul>	PCODE EB02NT ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	600	SF	\$100	<b>\$60,000</b>
1617	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Cross slope more than 1/4":12" (2%).</li> <li>• <i>As-is Measurement:</i> 4.3%</li> <li>• <i>Proposed Solution:</i> Modify ramp's cross slope.</li> </ul>	PCODE EB15 ADAAG 4.8.6 CSAS 1133B.5.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	120	SF	\$45	<b>\$5,400</b>
1618	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Landing less than 60" long.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Modify ramp landing.</li> </ul>	PCODE EB07 ADAAG 4.8.4(2) CSAS 1133B.5.4.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	25	SF	\$45	<b>\$1,125</b>
1619	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Rise more than 30" between landings.</li> <li>• <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise.</li> </ul>	PCODE EB05REF ADAAG 4.8.2 CSAS 1133B.5.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
<b>4 Stairs within Pomo Complex (Building #'s 3-7)</b>						
1620	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</li> </ul>	PCODE EC02 CSAS 1133B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	300	LF	\$9	<b>\$2,700</b>
1621	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</li> <li>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</li> </ul>	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	100	LF	\$95	<b>\$9,500</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pomo**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1622	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1623	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</li> <li>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</li> </ul>	PCODE ED07REF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
<b>5 Staircase at South side of Building #3</b>						
1624	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</li> </ul>	PCODE EC02 CSAS 1133B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	100	LF	\$9	<b>\$900</b>
1625	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	LF	\$75	<b>\$4,500</b>
1626	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route.</li> <li>• <i>Proposed Solution:</i> Provide directional sign.</li> </ul>	PCODE SA20 ADAAG 35.163(b) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$170	<b>\$170</b>
<b>6 Drinking Fountain at Building #5</b>						
1627	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fountain bubbler not easily activated by lever, push bar, or other accessible control.</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA03 ADAAG 4.27.4 CSAS 1507.3.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pomo**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1628	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> </ul>	PCODE IA05ANT ADAAG 4.4.1 CSAS 1117B.1.2	1	JOB	\$2,000	\$2,000
	<ul style="list-style-type: none"> <li>• <i>Proposed Solution:</i> Provide an alcove for the drinking fountain.</li> </ul>	Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				
<b>Total Costs for</b>		<b>Area/Floor: Pomo</b>	<b>\$132,145.00</b>			

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Accessible Parking on East side of Parking Lot #6</b>						
1629	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%).</li> <li>• <i>As-is Measurement:</i> 4.0%</li> <li>• <i>Proposed Solution:</i> Modify slope at accessible parking space.</li> </ul>	PCODE EA05NT ADAAG 4.6.3 CSAS 1129B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	900	SF	\$12	<b>\$10,800</b>
1630	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own.</li> <li>• <i>Proposed Solution:</i> Provide accessible path of travel in front of stalls.</li> </ul>	PCODE EA03NT ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$730	<b>\$2,190</b>
1631	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign for accessible parking space is missing or non-compliant.</li> <li>• <i>Proposed Solution:</i> Provide compliant parking signage.</li> </ul>	PCODE EA04B ADAAG 4.6.4 CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$315	<b>\$1,260</b>
1632	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Signage: No "Tow Away" sign at parking lot entrance (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide "Tow Away" sign at parking lot entrance when altering area.</li> </ul>	PCODE EA04C CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$325	<b>\$325</b>
<b>2 Accessible Parking on East side of Parking Lot #5</b>						
1633	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own.</li> <li>• <i>Proposed Solution:</i> Relocate parking and provide curb ramp to accessible route.</li> </ul>	PCODE EA03 ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$730	<b>\$730</b>
<b>3 Passenger Drop-off Zone at Main Entrance</b>						
1634	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Aisle at passenger drop-off, adjacent to the vehicle pull-up space is not 60"x 240" and/or slopes more than 1/4":12" (2%).</li> <li>• <i>Proposed Solution:</i> Modify passenger drop-off and provide "Loading Zone" sign.</li> </ul>	PCODE EA08NT ADAAG 4.6.6 CSAS 1131B.2.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$600	<b>\$600</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1635	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No curb ramp provided at passenger drop-off zone.</li> <li>• <i>Proposed Solution:</i> Provide new curb ramp.</li> </ul>	PCODE EH01NT ADAAG 4.7.1 CSAS 1127B.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>

#### 4 Van Accessible Parking Stall in Drop-off Zone

1636	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Accessible parking space does not have 5' x 18' access aisle (van accessible aisle 8' x 18' to the right of the parking stall).</li> <li>• <i>Proposed Solution:</i> Modify parking space(s) or aisle(s) to create accessible space by restriping.</li> </ul>	PCODE EA02B ADAAG 4.6.3 CSAS 1129B.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$200	<b>\$200</b>
1637	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Location of parking requires wheelchair users to wheel themselves parallel to vehicular traffic lane.</li> <li>• <i>Proposed Solution:</i> Provide curb ramp at shortest possible distance.</li> </ul>	PCODE EA09BNT Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>

#### 5 Accessible Parking at North side of Building #11

1638	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Signage: International Symbol of Accessibility (36" square, in white on blue) is not painted on the pavement near the rear end of the parking space (required in CA only).</li> <li>• <i>Proposed Solution:</i> Apply symbol on parking space pavement when altering area.</li> </ul>	PCODE EA04A CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$120	<b>\$240</b>
1639	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own.</li> <li>• <i>Proposed Solution:</i> Provide wheel-stop at accessible parking space to allow for passing space in front of parked vehicles.</li> </ul>	PCODE EA03NT ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$730	<b>\$730</b>
1640	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Accessible parking space does not have 5' x 18' access aisle (van accessible aisle 8' x 18' to the right of the parking stall).</li> <li>• <i>Proposed Solution:</i> Modify parking space(s) or aisle(s) to create accessible space by restriping.</li> </ul>	PCODE EA02B ADAAG 4.6.3 CSAS 1129B.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$200	<b>\$200</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1641	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Signage: International Symbol of Accessibility (36" square, in white on blue) painted on the pavement near the rear end of the parking space has faded.</li> <li>• <i>Proposed Solution:</i> Apply symbol on parking space pavement when altering area.</li> </ul>	PCODE EA04ANT CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
<b>6 Staircase at North side of Building #11</b>						
1642	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</li> </ul>	PCODE EC02 CSAS 1133B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	100	LF	\$9	<b>\$900</b>
1643	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 32"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	LF	\$75	<b>\$4,500</b>
1644	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Bottom extension of handrail does not return creating a hazard for blind individuals.</li> <li>• <i>Proposed Solution:</i> Remodel handrail return.</li> </ul>	PCODE ED12REF ADAAG 4.4.1 CSAS 1133B.4.2.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1645	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route.</li> <li>• <i>Proposed Solution:</i> Provide directional sign.</li> </ul>	PCODE SA20 ADAAG 35.163(b) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$170	<b>\$340</b>
<b>7 Ramp at East side of Building #12</b>						
1646	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%).</li> <li>• <i>As-is Measurement:</i> 11.1%</li> <li>• <i>Proposed Solution:</i> Demolish existing and provide new ramp.</li> </ul>	PCODE EB02NT ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	75	SF	\$100	<b>\$7,500</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1647	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.</li> <li>• <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide.</li> </ul>	PCODE EB14REF ADAAG 4.8.7 CSAS 1133B.5.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1648	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 32"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	20	LF	\$75	<b>\$1,500</b>
1649	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.</li> <li>• <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece).</li> </ul>	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
<b>8 Public Telephone at Administration Office Entrance</b>						
1650	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Public text telephone not identified with a sign that includes the international T.D.D. symbol.</li> <li>• <i>Proposed Solution:</i> Provide compliant text phone sign.</li> </ul>	PCODE IB11 ADAAG 4.30.7(3) CSAS 3105A(d)2I(iii) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$95	<b>\$95</b>
1651	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> T.D.D. service not provided in administration, constituent or student service area that communicates by telephone.</li> <li>• <i>Proposed Solution:</i> Provide T.D.D. service.</li> </ul>	PCODE IB13REF ADAAG 35.161 - Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1652	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Telephone: Clear floor space, 30" wide x 48" out from wall, not provided.</li> <li>• <i>Proposed Solution:</i> Provide clear space in front of telephone, 30" wide x 48" out from wall.</li> </ul>	PCODE IB01NT ADAAG 4.31.2 CSAS 1117B.2.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$200	<b>\$200</b>



Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>9 Drinking Fountain at Administration Office Entrance</b>						
1653	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fountain bubbler not easily activated by lever, push bar, or other accessible control.</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA03 ADAAG 4.27.4 CSAS 1507.3.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
1654	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide an alcove for drinking fountain.</li> </ul>	PCODE IA05ANT ADAAG 4.4.1 CSAS 1117B.1.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
<b>10 Ramp at East end of Building #8</b>						
1655	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%).</li> <li>• <i>As-is Measurement:</i> 8.6%</li> <li>• <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails.</li> </ul>	PCODE EB02 ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	80	SF	\$100	<b>\$8,000</b>
1656	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1657	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.</li> <li>• <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece).</li> </ul>	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
<b>11 Stairs at East end of Building #8</b>						
1658	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</li> </ul>	PCODE EC02 CSAS 1133B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	LF	\$9	<b>\$540</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1659	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 32"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	12	LF	\$75	<b>\$900</b>
1660	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</li> <li>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</li> </ul>	PCODE ED07REF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1661	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Bottom extension of handrail does not return creating a hazard for blind individuals.</li> <li>• <i>Proposed Solution:</i> Remodel handrail return.</li> </ul>	PCODE ED12REF ADAAG 4.4.1 CSAS 1133B.4.2.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
<b>12 South Entrance to Student Services Office in Building #8</b>						
1662	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</li> </ul>	PCODE EC02 CSAS 1133B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	50	LF	\$9	<b>\$450</b>
1663	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 32"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	10	LF	\$75	<b>\$750</b>
1664	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</li> <li>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</li> </ul>	PCODE ED07REF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1665	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No signs at non-accessible entrances directing persons to an accessible entrance of the building.</li> <li>• <i>Proposed Solution:</i> Provide directional signage to indicate route to the nearest accessible entrance.</li> </ul>	PCODE SA14 ADAAG 4.1.2(7)(c) CSAS 1117B.5.7 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$230	<b>\$230</b>
<b>13 Entrance to Campus Store in Building #12</b>						
1666	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</li> </ul>	PCODE EC02 CSAS 1133B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	35	LF	\$9	<b>\$315</b>
1667	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</li> <li>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</li> </ul>	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	LF	\$95	<b>\$475</b>
1668	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No signs at non-accessible entrances directing persons to an accessible entrance of the building.</li> <li>• <i>Proposed Solution:</i> Provide directional signage to indicate route to the nearest accessible entrance.</li> </ul>	PCODE SA14 ADAAG 4.1.2(7)(c) CSAS 1117B.5.7 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$230	<b>\$230</b>
<b>14 Ramps within Miwok Complex (Buildings #'s 13-16)</b>						
1669	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Rise more than 30" between landings.</li> <li>• <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise.</li> </ul>	PCODE EB05REF ADAAG 4.8.2 CSAS 1133B.5.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1670	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</li> <li>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</li> </ul>	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	220	LF	\$95	<b>\$20,900</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1671	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1672	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.</li> <li>• <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece).</li> </ul>	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1673	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.</li> <li>• <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide.</li> </ul>	PCODE EB14 ADAAG 4.8.7 CSAS 1133B.5.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	185	LF	\$17	<b>\$3,145</b>
1674	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).</li> <li>• <i>Proposed Solution:</i> Provide new guardrail, including handrail at ramp.</li> </ul>	PCODE ED08REF CSAS CBC 509 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1675	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Concrete ramp with slope greater than 1:12 (8.3%).</li> <li>• <i>As-is Measurement:</i> 9.5%</li> <li>• <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails.</li> </ul>	PCODE EB02NT ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	165	SF	\$100	<b>\$16,500</b>
1676	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Bottom landing is less than 72" in length.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Modify ramp bottom landing to 72" length.</li> </ul>	PCODE EB08NT ADAAG 4.8.4(3) CSAS 1133B.5.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$100	<b>\$6,000</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>15 Stairs within Miwok Complex (Buildings #'s 13-16)</b>						
1677	<p>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</p>	<p>PCODE EC02</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	280	LF	\$9	<b>\$2,520</b>
1678	<p>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</p> <p>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</p>	<p>PCODE ED01</p> <p>ADAAG 4.8.5 &amp; 4.9.4</p> <p>CSAS 1133B.4.1 &amp; B.5.5.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	60	LF	\$95	<b>\$5,700</b>
1679	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02REF</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 &amp; B.5.5.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
1680	<p>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</p>	<p>PCODE ED07REF</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
<b>16 Staircase at South side of Building #13</b>						
1681	<p>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</p>	<p>PCODE EC02</p> <p>CSAS 1133B.4.4</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	100	LF	\$9	<b>\$900</b>
1682	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 &amp; B.5.5.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	60	LF	\$75	<b>\$4,500</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Miwok**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1683	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route.</li> <li>• <i>Proposed Solution:</i> Provide directional sign.</li> </ul>	PCODE SA20 ADAAG 35.163(b) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$170	<b>\$170</b>
<b>17 Drinking Fountain at Building #15</b>						
1684	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fountain bubbler not easily activated by lever, push bar, or other accessible control.</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA03 ADAAG 4.27.4 CSAS 1507.3.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
1685	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alcove for the drinking fountain.</li> </ul>	PCODE IA05ANT ADAAG 4.4.1 CSAS 1117B.1.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
<b>Total Costs for</b>					<b>Area/Floor: Miwok</b>	<b>\$116,655.00</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Ohlone**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Accessible Parking at Lot #7</b>						
1686	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%).</li> <li>• <i>As-is Measurement:</i> 8.1%</li> <li>• <i>Proposed Solution:</i> Modify slope at accessible parking space.</li> </ul>	PCODE EA05NT ADAAG 4.6.3 CSAS 1129B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	500	SF	\$12	<b>\$6,000</b>
1687	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own.</li> <li>• <i>Proposed Solution:</i> Relocate parking and provide curb ramp to accessible route.</li> </ul>	PCODE EA03 ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$730	<b>\$730</b>
1688	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Signage: No "Tow Away" sign at parking lot entrance (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide "Tow Away" sign at parking lot entrance when altering area.</li> </ul>	PCODE EA04C CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$325	<b>\$325</b>
1689	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Parking-Ticket vending machine is not accessible.</li> <li>• <i>Proposed Solution:</i> Modify access to Parking-Ticket vending machine.</li> </ul>	PCODE EA02ANT ADAAG 4.6.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,500	<b>\$2,500</b>
<b>2 Accessible Parking at West side of Parking Lot #6</b>						
1690	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%).</li> <li>• <i>As-is Measurement:</i> 6.3%</li> <li>• <i>Proposed Solution:</i> Modify slope at accessible parking space.</li> </ul>	PCODE EA05NT ADAAG 4.6.3 CSAS 1129B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	900	SF	\$12	<b>\$10,800</b>
1691	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own.</li> <li>• <i>Proposed Solution:</i> Provide accessible path of travel in front of accessible parking stalls.</li> </ul>	PCODE EA03NT ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$730	<b>\$2,190</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Ohlone**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>3 Accessible Parking on West side of the Ohlone Complex</b>						
1692	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%).</li> <li>• <i>As-is Measurement:</i> 2.7% - 3.5%</li> <li>• <i>Proposed Solution:</i> Modify slope at accessible parking space.</li> </ul>	PCODE EA05NT ADAAG 4.6.3 CSAS 1129B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	250	SF	\$12	<b>\$3,000</b>
1693	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign for accessible parking space is missing or non-compliant.</li> <li>• <i>Proposed Solution:</i> Relocate existing sign to a more visible location.</li> </ul>	PCODE EA04BNT ADAAG 4.6.4 CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$315	<b>\$315</b>
1694	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Signage: International Symbol of Accessibility (36" square, in white on blue) painted on the pavement near the rear end of the parking space has faded.</li> <li>• <i>Proposed Solution:</i> Reapply symbol on parking space pavement when altering area.</li> </ul>	PCODE EA04ANT CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
<b>4 P.O.T. from Accessible Parking to Ohlone Complex</b>						
1695	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.</li> <li>• <i>As-is Measurement:</i> 7.0% - 7.8%</li> <li>• <i>Proposed Solution:</i> Provide ramp with handrails on both (2) sides.</li> </ul>	PCODE EF01AREF ADAAG 4.8.1 CSAS 1133B.7.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	125	REF		
1696	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Rise more than 30" between landings.</li> <li>• <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise.</li> </ul>	PCODE EB05 ADAAG 4.8.2 CSAS 1133B.5.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	500	SF	\$45	<b>\$22,500</b>



Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Ohlone**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>5 Ramps within Ohlone Complex (Building #'s 18-20)</b>						
1697	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</li> <li><i>Proposed Solution:</i> Provide new handrail for each side including extensions.</li> </ul>	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	280	LF	\$95	<b>\$26,600</b>
1698	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li><i>As-is Measurement:</i> 31"</li> <li><i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1699	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.</li> <li><i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece).</li> </ul>	PCODE ED05REF ADAAG 4.8.5(2) CSAS 1133B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1700	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.</li> <li><i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide.</li> </ul>	PCODE EB14 ADAAG 4.8.7 CSAS 1133B.5.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	150	LF	\$17	<b>\$2,550</b>
1701	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Recommended guardrail (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).</li> <li><i>Proposed Solution:</i> Provide new guardrail, including handrail at ramp.</li> </ul>	PCODE ED08REF CSAS CBC 509 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1702	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Concrete Ramp: Slope greater than 1:12 (8.3%).</li> <li><i>As-is Measurement:</i> 8.9% - 9.1%</li> <li><i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails.</li> </ul>	PCODE EB02NT ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	300	SF	\$100	<b>\$30,000</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Ohlone**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1703	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Cross slope more than 1/4":12" (2%).</li> <li>• <i>Proposed Solution:</i> Modify ramp's cross slope.</li> </ul>	PCODE EB15 ADAAG 4.8.6 CSAS 1133B.5.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	150	SF	\$45	<b>\$6,750</b>
1704	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wood Ramp: Slope greater than 1:12 (8.3%).</li> <li>• <i>As-is Measurement:</i> 9.3%</li> <li>• <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails.</li> </ul>	PCODE EB02NT ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	150	SF	\$70	<b>\$10,500</b>
1705	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Rise more than 30" between landings.</li> <li>• <i>Proposed Solution:</i> Rebuild ramp to provide landings at 30" maximum rise.</li> </ul>	PCODE EB05REF ADAAG 4.8.2 CSAS 1133B.5.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
<b>6 Stairs within Ohlone Complex (Building #'s 18-20)</b>						
1706	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</li> </ul>	PCODE EC02 CSAS 1133B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	300	LF	\$9	<b>\$2,700</b>
1707	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</li> <li>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</li> </ul>	PCODE ED01 ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	LF	\$95	<b>\$5,700</b>
1708	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02REF ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Ohlone**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1709	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</li> <li><b>Proposed Solution:</b> Extend stair handrail at bottom (cost for each extension piece).</li> </ul>	PCODE ED07REF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
<b>7 Entrance to Computer Room in Building #20</b>						
1710	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Public entrance not accessible to disabled persons.</li> <li><b>Proposed Solution:</b> Modify entrance to be accessible. Requires automatic door opener, ramp, or wheelchair lift, as itemized in entries below.</li> </ul>	PCODE ID04REF ADAAG 4.14.1 CSAS 1134B.2.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1711	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Ramp needed to provide disabled access at steps or change of level along path of travel.</li> <li><b>As-is Measurement:</b> 18" rise</li> <li><b>Proposed Solution:</b> Provide new concrete ramp with handrails [slope more than 1:20 (5.0%) needed].</li> </ul>	PCODE EB01A ADAAG 4.1.1 CSAS 1127B.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	100	SF	\$100	<b>\$10,000</b>
1712	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> No signs at non-accessible entrances directing persons to an accessible entrance of the building.</li> <li><b>Proposed Solution:</b> Provide directional signage to indicate route to the nearest accessible entrance.</li> </ul>	PCODE SA14 ADAAG 4.1.2(7)(c) CSAS 1117B.5.7 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$230	<b>\$230</b>
<b>8 Accessible Parking at South side of Library Building</b>						
1713	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Signage: International Symbol of Accessibility (36" square, in white on blue) is not painted on the pavement near the rear end of the parking space (required in CA only).</li> <li><b>Proposed Solution:</b> Apply symbol on parking space pavement when altering area.</li> </ul>	PCODE EA04A CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
1714	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Sign for accessible parking space is missing or non-compliant.</li> <li><b>Proposed Solution:</b> Provide compliant parking signage.</li> </ul>	PCODE EA04B ADAAG 4.6.4 CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$315	<b>\$315</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Ohlone**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>9 Drinking Fountain at Building #20</b>						
1715	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fountain bubbler not easily activated by lever, push bar, or other accessible control.</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03</b> ADAAG <b>4.27.4</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
1716	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alcove for drinking fountain.</li> </ul>	PCODE <b>IA05ANT</b> ADAAG <b>4.4.1</b> CSAS <b>1117B.1.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
<b>Total Costs for Area/Floor: Ohlone</b>					<b>\$147,945.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pool Complex**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Accessible Parking at Parking Lot #8</b>						
1717	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%).</li> <li>• <i>As-is Measurement:</i> 4%</li> <li>• <i>Proposed Solution:</i> Modify slope at accessible parking space.</li> </ul>	PCODE EA05NT ADAAG 4.6.3 CSAS 1129B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	500	SF	\$12	<b>\$6,000</b>
1718	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Signage: No "Tow Away" sign at parking lot entrance (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide "Tow Away" sign at parking lot entrance when altering area.</li> </ul>	PCODE EA04C CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$325	<b>\$325</b>
1719	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Parking stall incorrectly identified as being "Van Accessible".</li> <li>• <i>Proposed Solution:</i> Provide compliant parking signage.</li> </ul>	PCODE EA04BNT ADAAG 4.6.4 CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$315	<b>\$315</b>
<b>2 Path leading to Baseball &amp; Soccer Fields</b>						
1720	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.</li> <li>• <i>As-is Measurement:</i> 5.6%</li> <li>• <i>Proposed Solution:</i> Modify walk/sidewalk slope to 1:20 or less.</li> </ul>	PCODE EF01 ADAAG 4.8.1 CSAS 1133B.7.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	200	SF	\$45	<b>\$9,000</b>
<b>3 Accessible Parking on West side of Locker Rooms</b>						
1721	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%).</li> <li>• <i>As-is Measurement:</i> 7.1%</li> <li>• <i>Proposed Solution:</i> Modify slope at accessible parking space.</li> </ul>	PCODE EA05NT ADAAG 4.6.3 CSAS 1129B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	500	SF	\$12	<b>\$6,000</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pool Complex**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1722	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Signage: International Symbol of Accessibility (36" square, in white on blue) painted on the pavement near the rear end of the parking space has faded.</li> <li>• <i>Proposed Solution:</i> Reapply symbol on parking space pavement when altering area.</li> </ul>	PCODE EA04ANT CSAS 1129B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$120	<b>\$240</b>
1723	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own.</li> <li>• <i>Proposed Solution:</i> Provide wheel-stop at accessible spaces to allow for passing space in front of parked vehicles.</li> </ul>	PCODE EA03NT ADAAG Fig.9 CSAS 1129B.4.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$730	<b>\$1,460</b>
<b>4 Path leading to Tennis Courts</b>						
1724	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Curb ramp: Slope greater than 1:12 (8.3%).</li> <li>• <i>As-is Measurement:</i> 9.6%</li> <li>• <i>Proposed Solution:</i> Demolish existing and provide new curb ramp.</li> </ul>	PCODE EH02A ADAAG 4.7.2 CSAS 1127B.5.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,500	<b>\$2,500</b>
1725	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Curb ramp: 12" wide grooved border not provided (CA requirement only).</li> <li>• <i>Proposed Solution:</i> Not an ADAAG requirement (Provide 12" wide grooved border per CBC when remodeling).</li> </ul>	PCODE EH07BREF CSAS 1127B.5.7 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1726	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Transition from ramp to gutter does not have a way-finding 1/2" lip at 45°.</li> <li>• <i>Proposed Solution:</i> Provide 1/2" beveled lip at 45°.</li> </ul>	PCODE EH02DREF CSAS 1127B.5.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1727	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Paved area has excessively rough, irregular surface.</li> <li>• <i>Proposed Solution:</i> Repave area to provide smooth surface for path of travel.</li> </ul>	PCODE EF10A ADAAG 4.5.2 CSAS 1133B.7.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1300	SF	\$6	<b>\$7,800</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pool Complex**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1728	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.</li> <li>• <i>As-is Measurement:</i> 3.6% - 5.4%</li> <li>• <i>Proposed Solution:</i> Modify walk/sidewalk slope to 1:20 or less.</li> </ul>	PCODE EF01REF ADAAG 4.8.1 CSAS 1133B.7.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
<b>5 Entrance to Tennis Courts</b>						
1729	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fountain bubbler not easily activated by lever, push bar, or other accessible control.</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA03 ADAAG 4.27.4 CSAS 1507.3.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
1730	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.</li> <li>• <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.</li> </ul>	PCODE IA04REF CSAS 1117B.1.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1731	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate textured floor 12" from front &amp; sides of drinking fountain. (Interim solution only. Not an ADAAG compliant permanent solution).</li> </ul>	PCODE IA05BREF CSAS 1117B.1.2.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
1732	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No curb ramp available where an accessible route crosses a curb.</li> <li>• <i>As-is Measurement:</i> 6"</li> <li>• <i>Proposed Solution:</i> Provide new curb ramp.</li> </ul>	PCODE EH01 ADAAG 4.7.1 CSAS 1127B.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
1733	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</li> </ul>	PCODE EC02 CSAS 1133B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	175	LF	\$9	<b>\$1,575</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pool Complex**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1734	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>As-is Measurement:</i> 31"</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE ED02</p> <p>ADAAG 4.9.4(5)</p> <p>CSAS 1133B.4.2.1 &amp; B.5.5.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	60	LF	\$75	<b>\$4,500</b>
1735	<p>• <i>As-Built Description:</i> Wall mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE ED06BREF</p> <p>ADAAG 4.9.4(2)</p> <p>CSAS 1133B.4.2.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	4	REF		
<b>6 Porch at Locker Room Entrance</b>						
1736	<p>• <i>As-Built Description:</i> Fountain bubbler not easily activated by lever, push bar, or other accessible control.</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA03</p> <p>ADAAG 4.27.4</p> <p>CSAS 1507.3.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>
1737	<p>• <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.</p> <p>• <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.</p>	<p>PCODE IA04REF</p> <p>CSAS 1117B.1.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
1738	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate textured floor 12" from front &amp; sides of drinking fountain. (Interim solution only. Not an ADAAG compliant permanent solution).</p>	<p>PCODE IA05BREF</p> <p>CSAS 1117B.1.2.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		



Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pool Complex**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1739	<p>• <i>As-Built Description:</i> Telephone enclosure: Protrudes more than 4" and has more than 27" height from floor to lowest edge.</p> <p>• <i>Proposed Solution:</i> Lower telephone enclosure.</p>	<p>PCODE <b>1B03B</b> ADAAG <b>4.4.1</b> CSAS <b>3105(d)2.1G1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$250	<b>\$250</b>
1740	<p>• <i>As-Built Description:</i> Telephone amplification for hearing impaired persons not provided (push button volume control).</p> <p>• <i>Proposed Solution:</i> Provide telephone amplification for hearing impaired persons. To be provided by utility company.</p>	<p>PCODE <b>1B05</b> ADAAG <b>4.31.5</b> CSAS <b>1117B.2.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1		\$0	
1741	<p>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</p>	<p>PCODE <b>EC02</b> CSAS <b>1133B.4.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	100	LF	\$9	<b>\$900</b>
1742	<p>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</p> <p>• <i>As-is Measurement:</i> 29"</p> <p>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</p>	<p>PCODE <b>ED02</b> ADAAG <b>4.9.4(5)</b> CSAS <b>1133B.4.2.1 &amp; B.5.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	40	LF	\$75	<b>\$3,000</b>
1743	<p>• <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</p>	<p>PCODE <b>ED06AREF</b> ADAAG <b>4.9.4(2)</b> CSAS <b>1133B.4.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	6	REF		
1744	<p>• <i>As-Built Description:</i> Sidewalk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.</p> <p>• <i>As-is Measurement:</i> 5.6%</p> <p>• <i>Proposed Solution:</i> Modify walk/sidewalk slope to 1:20 or less.</p>	<p>PCODE <b>EF01</b> ADAAG <b>4.8.1</b> CSAS <b>1133B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	100	SF	\$45	<b>\$4,500</b>

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pool Complex**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>7 Stairs leading to Green in front of Pool Complex</b>						
1745	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Contrasting color strip not provided at all stair nosings (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide contrasting color strips at all exterior stair treads when altering area.</li> </ul>	PCODE EC02 CSAS 1133B.4.4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	150	LF	\$9	<b>\$1,350</b>
1746	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Remove existing and provide new handrail.</li> </ul>	PCODE ED02 ADAAG 4.9.4(5) CSAS 1133B.4.2.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	40	LF	\$75	<b>\$3,000</b>
1747	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Floor mounted stair handrail does not extend horizontally 12" minimum beyond top and one tread width sloped, plus 12" minimum horizontally beyond riser.</li> <li>• <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for both extensions).</li> </ul>	PCODE ED06AREF ADAAG 4.9.4(2) CSAS 1133B.4.2.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	REF		
<b>8 Ramped portion of Walkway</b>						
1748	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).</li> <li>• <i>Proposed Solution:</i> Provide new handrail for each side including extensions.</li> </ul>	PCODE ED01REF ADAAG 4.8.5 & 4.9.4 CSAS 1133B.4.1 & B.5.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	120	REF		
1749	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Ramp: Slope greater than 1:12 (8.3%).</li> <li>• <i>As-is Measurement:</i> 7.9% - 9.4%</li> <li>• <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails.</li> </ul>	PCODE EB02 ADAAG 4.8.2 CSAS 1133.B.5.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	900	SF	\$100	<b>\$90,000</b>
1750	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Landing less than 60" long.</li> <li>• <i>As-is Measurement:</i> 48"</li> <li>• <i>Proposed Solution:</i> Modify ramp landing.</li> </ul>	PCODE EB07REF ADAAG 4.8.4(2) CSAS 1133B.5.4.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	75	REF		

---

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pool Complex**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Area/Floor:</b> Pool Complex				<b>\$148,715.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Exterior Site** Area/Floor: **Pool Complex**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Exterior Site				<b>\$545,460.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Lobby</b>					
3935	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
3936	<p>• <i>As-Built Description:</i> Accessible building entrance when not all are accessible not identified with a sign showing the International Symbol of Accessibility.</p> <p>• <i>Proposed Solution:</i> Provide building entrance sign that shows international symbol at accessible entrance.</p>	<p>PCODE SA12 ADAAG 4.1.2(7)(c) CSAS 1117B.5.7 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
3938	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</p> <p>• <i>As-is Measurement:</i> 8"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02B ADAAG 4.15.5(1) &amp; Fig.27(a) CSAS 1507.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>
3939	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</p> <p>• <i>As-is Measurement:</i> 18"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02REF ADAAG 4.15.5(1) CSAS 1507.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>		REF		
3940	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 13 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	4	JOB	\$50	<b>\$200</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3941	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b></p> <p>CSAS <b>1133B.2.6</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	4	JOB	\$75	<b>\$300</b>
3942	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE <b>IC03</b></p> <p>ADAAG <b>4.2.5</b></p> <p>CSAS <b>760-10</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
3943	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE <b>IA05C</b></p> <p>ADAAG <b>4.4.1</b></p> <p>CSAS <b>Fig. 11B-3</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$1,900	<b>\$1,900</b>
<b>2 Laboratory w/ prep. room (#151-152)</b>						
3944	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE <b>SA07A</b></p> <p>ADAAG <b>4.30.6</b></p> <p>CSAS <b>1117B.5.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>
3945	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE <b>ID07</b></p> <p>ADAAG <b>4.13.9</b></p> <p>CSAS <b>1133B.2.5.1</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	5	JOB	\$250	<b>\$1,250</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3946	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$50	<b>\$250</b>
3947	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
3949	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Recommended only: Minimum of one non-fixed station per lab not provided at specialized laboratory equipment (height between 28" and 34", with leg room 27" high x 30" wide x 19" deep).</li> <li>• <i>Proposed Solution:</i> Remodel existing cabinet/counter to provide lab/studio equipment for disabled person.</li> </ul>	PCODE LB01A - CSAS 3103(a)4A(2) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,200	<b>\$1,200</b>
3950	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sink in workstation not accessible.</li> <li>• <i>Proposed Solution:</i> Modify existing sink and casework.</li> </ul>	PCODE LF01 ADAAG 4.19.2 CSAS 1504(a) C.P.C. Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,500	<b>\$2,500</b>
3951	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Minimum of one accessible fume hood station with specialized laboratory equipment not provided. (height between 28"-34" with knee space 27" high x 30" wide x 19" deep)</li> <li>• <i>As-is Measurement:</i> 38"</li> <li>• <i>Proposed Solution:</i> Provide worktop at accessible height.</li> </ul>	PCODE LB02NT ADAAG 4.1.3(18) CSAS 3103A(d)2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,500	<b>\$4,500</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>3 Biology Preparation (#153)</b>						
3952	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
3953	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
3954	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 6 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
<b>4 Classroom #154</b>						
3955	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
3956	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$250	<b>\$750</b>



Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3957	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	3	JOB	\$50	<b>\$150</b>
3958	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
3959	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</p>	<p>PCODE ID24A</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
3960	<p>• <i>As-Built Description:</i> Minimum of one accessible fume hood station with specialized laboratory equipment not provided. (height between 28"-34"; with knee space 27" high x 30" wide x 19" deep).</p> <p>• <i>As-is Measurement:</i> 38"</p> <p>• <i>Proposed Solution:</i> Provide worktop at accessible height.</p>	<p>PCODE LB02NT</p> <p>ADAAG 4.1.3(18)</p> <p>CSAS 3103A(d)2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$4,500	<b>\$4,500</b>
3961	<p>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</p> <p>• <i>As-is Measurement:</i> no knee clearance</p> <p>• <i>Proposed Solution:</i> Remodel sink cabinet.</p>	<p>PCODE IN06A</p> <p>ADAAG 4.24.3</p> <p>CSAS 1117B.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$1,850	<b>\$1,850</b>
3962	<p>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</p>	<p>PCODE IN06REF</p> <p>ADAAG 4.24.2</p> <p>CSAS 1117B.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3963	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE <b>IN06BREF</b> ADAAG <b>4.24.4</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
3964	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
<b>Total Costs for Area/Floor: Level 1</b>					<b>\$23,295.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Lobby</b>					
3965	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
3966	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
3967	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
3968	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
3969	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 1</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	40	SF	\$12	<b>\$480</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Medical Assisting (#251)</b>						
3970	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
3971	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
3972	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
3974	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</li> <li>• <i>As-is Measurement:</i> 3"</li> <li>• <i>Proposed Solution:</i> Change hinge/latch side.</li> </ul>	PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
<b>3 Medical Assisting (#252)</b>						
3975	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3976	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
3977	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
3978	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Change hinge/latch side</li> </ul>	PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
3979	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,850	<b>\$1,850</b>
3980	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</li> </ul>	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
3981	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3982	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
<b>4 Lecture room (#254)</b>						
3983	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
3984	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
3985	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>5 Lecture room (#255)</b>						
3986	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
3987	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3988	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li><b>Proposed Solution:</b> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
<b>6 Drinking fountain</b>						
3989	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li><b>As-is Measurement:</b> 8"</li> <li><b>Proposed Solution:</b> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02B</b> ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
3990	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li><b>As-is Measurement:</b> 18"</li> <li><b>Proposed Solution:</b> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
3991	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li><b>As-is Measurement:</b> 38"</li> <li><b>Proposed Solution:</b> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
3992	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Drinking fountain lacks protection for visually impaired persons.</li> <li><b>Proposed Solution:</b> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>7 Faculty offices (#258-259, #261-262)</b>						
3993	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
3994	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$250	<b>\$1,250</b>
3995	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>8 Custodian (#260)</b>						
3996	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>9 Exit door at west side</b>						
3997	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</li> </ul>	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>



Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total	
3998	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>	
3999	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>Proposed Solution:</i> Change hinge/latch side.</li> </ul>	PCODE ID23NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>	
4000	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>	
4001	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.75"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	40	SF	\$12	<b>\$480</b>	
<b>Total Costs for</b>					<b>Area/Floor: Level 2</b>	<b>\$13,280.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 3** Area/Floor: **Level 2**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Pomo Cluster -Building 3				<b>\$36,575.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 4** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Machine Technology (#160)</b>						
4002	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4003	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
<b>2 Tool room (#162)</b>						
4004	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
<b>3 Store room (#165)</b>						
4005	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1		\$90	<b>\$90</b>
<b>4 Private offices (#163-164)</b>						
4006	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2		\$90	<b>\$180</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 4** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>5</b>	<b>Locker room (#166)</b>					
4007	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2		\$90	<b>\$180</b>
4008	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$50	<b>\$150</b>
4009	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in good condition.</li> <li>• <i>As-is Measurement:</i> 38"</li> <li>• <i>Proposed Solution:</i> Remount fountain at accessible height.</li> </ul>	PCODE IA03C ADAAG 4.15.2 CSAS 1507.3.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,200	<b>\$1,200</b>
4010	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 56" S.D: 52"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE WG01A ADAAG 28 CFR 35.133(a) CSAS 1115B.9.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$100	<b>\$200</b>
4011	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No accessible bench section provided at locker facilities.</li> <li>• <i>Proposed Solution:</i> Provide accessible bench with adequate wheelchair space between locker and bench.</li> </ul>	PCODE GG01NT - CSAS 3103(a)2D(5) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 4** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>6</b>	<b>Unisex restrooms (#170)</b>					
4012	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4013	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4014	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$250	<b>\$250</b>
4015	<p>• <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided.</p> <p>• <i>Proposed Solution:</i> Remove storage cabinet to provide at least 48" in front of water closet (install overhead shelving for storage).</p>	<p>PCODE WB03A</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4016	<p>• <i>As-Built Description:</i> Grab bars not at 33" to 36" from floor (CA only: 33" from floor if no tank toilet).</p> <p>• <i>Proposed Solution:</i> Relocate accessible grab bars.</p>	<p>PCODE WB07C</p> <p>ADAAG 4.16.4</p> <p>CSAS 1115B.8.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$300	<b>\$300</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 4** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4017	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).</li> <li>• <i>As-is Measurement:</i> 45" from rear wall</li> <li>• <i>Proposed Solution:</i> Provide or relocate accessible side grab bar.</li> </ul>	PCODE <b>WB07A</b> ADAAG <b>4.17.6</b> CSAS <b>1115B.8.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$300	<b>\$300</b>
4018	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4019	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 51"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
<b>7 Welding room (#167)</b>						
4020	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4021	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$50	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 4** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4022	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
<b>8 Store room (#169)</b>						
4023	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
<b>9 Private office (#168)</b>						
4024	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1		\$90	<b>\$90</b>
<b>Total Costs for</b>					<b>Area/Floor: Level 1</b>	<b>\$4,910.00</b>

---

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 4** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Pomo Cluster -Building 4				<b>\$4,910.00</b>	



Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Testing room (#180)</b>					
4025	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>
4026	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$250	<b>\$500</b>
4027	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
4028	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4029	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4030	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03</p> <p>ADAAG 4.2.5</p> <p>CSAS 760-10</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
<b>2 Men's restroom</b>						
4031	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4032	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4033	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area.</p>	<p>PCODE ID06</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4034	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4035	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4036	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4037	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</li> <li>• <i>As-is Measurement:</i> 15"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet.</li> </ul>	PCODE <b>WB08</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,400	<b>\$1,400</b>
4038	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,500	<b>\$1,500</b>
4039	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4040	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$120	<b>\$240</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4041	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.</li> <li><b>Proposed Solution:</b> Provide accessible faucet at accessible lavatory.</li> </ul>	PCODE <b>WD06</b> ADAAG <b>4.19.5</b> CSAS <b>1504.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$600	<b>\$600</b>
4042	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li><b>As-is Measurement:</b> P.T.D: 48"</li> <li><b>Proposed Solution:</b> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4043	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Bottom of flat, not tilted mirror more than 40" above floor.</li> <li><b>As-is Measurement:</b> 48"</li> <li><b>Proposed Solution:</b> Relocate or provide new accessible mirror.</li> </ul>	PCODE <b>WG03</b> ADAAG <b>4.19.6</b> CSAS <b>1115B.9.1.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4044	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> CA only: Front of rim projects less than 14" from wall.</li> <li><b>As-is Measurement:</b> 11"</li> <li><b>Proposed Solution:</b> Provide accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE01</b> CSAS <b>1503.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,000	<b>\$4,000</b>
4045	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li><b>As-is Measurement:</b> 47"</li> <li><b>Proposed Solution:</b> Provide accessible urinal flush control.</li> </ul>	PCODE <b>WE03</b> ADAAG <b>4.18.4</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4046	<ul style="list-style-type: none"> <li><b>As-Built Description:</b> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li><b>As-is Measurement:</b> 5"</li> <li><b>Proposed Solution:</b> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>3</b>	<b>Women's restroom</b>					
4047	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4048	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4049	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4050	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE WB07</p> <p>ADAAG 4.17.6*</p> <p>CSAS 1115B.8</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4051	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE WB10</p> <p>ADAAG 4.16.5 &amp; 4.27.4</p> <p>CSAS 1502.0</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4052	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,500	<b>\$1,500</b>
4053	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4054	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$120	<b>\$240</b>
4055	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.</li> <li>• <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory.</li> </ul>	PCODE <b>WD06</b> ADAAG <b>4.19.5</b> CSAS <b>1504.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$600	<b>\$600</b>
4056	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor.</li> <li>• <i>As-is Measurement:</i> 48"</li> <li>• <i>Proposed Solution:</i> Relocate or provide new accessible mirror.</li> </ul>	PCODE <b>WG03</b> ADAAG <b>4.19.6</b> CSAS <b>1115B.9.1.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4057	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4058	<p>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4"</p> <p>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</p>	<p>PCODE <b>WG02BNT</b></p> <p>ADAAG <b>Fig. 28</b></p> <p>CSAS <b>DSA/AC # 99-07</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$150	<b>\$150</b>
4059	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 43" F.T.D: 50"</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE <b>WG01A</b></p> <p>ADAAG <b>28 CFR 35.133(a)</b></p> <p>CSAS <b>1115B.9.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$100	<b>\$200</b>
4060	<p>• <i>As-Built Description:</i> Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide).</p> <p>• <i>As-is Measurement:</i> 34"</p> <p>• <i>Proposed Solution:</i> Modify facility passage to be min. 44" wide. Demolish existing partition and replace.</p>	<p>PCODE <b>WC02A</b></p> <p>ADAAG <b>4.3.3</b></p> <p>CSAS <b>1115B.7.1.3</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	9	LF	\$170	<b>\$1,530</b>
4061	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area.</p>	<p>PCODE <b>ID06</b></p> <p>CSAS <b>1133B.2.6</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
<b>4 Lounge room (#189)</b>						
4062	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE <b>SA07A</b></p> <p>ADAAG <b>4.30.6</b></p> <p>CSAS <b>1117B.5.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4064	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4065	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area.</p>	<p>PCODE ID06</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
5002	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	3	JOB	\$50	<b>\$150</b>
<b>5 Com. Medical Center</b>						
4067	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4068	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 &amp; 6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>



Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4069	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$50	<b>\$150</b>
4070	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
<b>6 Rooms (#s 185-186)</b>						
4071	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE <b>ID07C</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>7 Classroom (#188)</b>						
4072	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4073	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4075	<p>• <i>As-Built Description:</i> At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "TO EXIT" sign at door.</p>	<p>PCODE SA10E ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4076	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	3	JOB	\$75	<b>\$225</b>
4077	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 13 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4078	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
4079	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</p> <p>• <i>As-is Measurement:</i> 8"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02B ADAAG 4.15.5(1) &amp; Fig.27(a) CSAS 1507.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4080	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4081	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>
<b>Total Costs for Area/Floor: Level 1</b>					<b>\$23,535.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 5** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Pomo Cluster -Building 5				<b>\$23,535.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Entrance/exit door at west side</b>						
4082	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4083	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
4084	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 13 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
4085	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
<b>2 Faculty offices #101-104</b>						
4086	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	5	JOB	\$250	<b>\$1,250</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4087	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
4088	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4089	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>3 Custodian room</b>						
4090	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>4 Faculty offices (#105-106)</b>						
4091	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4092	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
<b>5 Room (#107)</b>						
4093	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4094	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4095	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4096	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4097	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs, 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>6</b>	<b>Environmental Science Lab (#108)</b>					
4098	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4099	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Minimum of one accessible fume hood station with specialized laboratory equipment not provided. (height between 28" -34", with knee space 27" high X 30" wide X 19" deep)</li> <li>• <i>As-is Measurement:</i> 39"</li> <li>• <i>Proposed Solution:</i> Provide worktop at accessible height.</li> </ul>	PCODE LB02NT ADAAG 4.1.3(18) CSAS 3103A(d)2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,500	<b>\$4,500</b>
4100	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$250	<b>\$750</b>
4101	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4102	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>



Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>7</b>	<b>Prep. room</b>					
4103	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4104	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4105	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4106	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area.</li> </ul>	PCODE <b>ID06</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4107	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 37"</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</li> </ul>	PCODE <b>IN06REF</b> ADAAG <b>4.24.2</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4108	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE <b>IN06A</b> ADAAG <b>4.24.3</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,850	<b>\$1,850</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4109	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE <b>IN06BREF</b> ADAAG <b>4.24.4</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4110	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
<b>8 Room #111</b>						
4111	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4112	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>9 Men's restrooms</b>						
4113	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE <b>SA15</b> CSAS <b>1115B.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4114	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4115	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 12 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4116	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 48" deep</p> <p>• <i>Proposed Solution:</i> Change door swing.</p>	<p>PCODE ID27</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4117	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 48" deep</p> <p>• <i>Proposed Solution:</i> Change door swing.</p>	<p>PCODE WC03REF</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
4118	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 13"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4119	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 35"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4120	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4121	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4122	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4123	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4124	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</li> <li>• <i>As-is Measurement:</i> 15"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet.</li> </ul>	PCODE <b>WB08</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,400	<b>\$1,400</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4125	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</li> <li>• <i>As-is Measurement:</i> 16.5"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</li> </ul>	PCODE <b>WB02REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4126	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$120	<b>\$600</b>
4127	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 46"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4128	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door swings into required clear space in front of lavatory.</li> <li>• <i>Proposed Solution:</i> Relocate existing lavatory.</li> </ul>	PCODE <b>WD01ANT</b> ADAAG <b>4.19.3</b> CSAS <b>1504.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$900	<b>\$900</b>
4129	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE01</b> CSAS <b>1503.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,000	<b>\$4,000</b>
4130	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>As-is Measurement:</i> 47"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</li> </ul>	PCODE <b>WE03</b> ADAAG <b>4.18.4</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>10 Drinking fountain</b>						
4131	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02B</b> ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4132	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4133	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>
4134	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 38"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
<b>11 Women's restrooms</b>						
4135	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE <b>SA15</b> CSAS <b>1115B.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4136	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4137	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4138	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 48" deep</p> <p>• <i>Proposed Solution:</i> Change door swing.</p>	<p>PCODE ID27</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4139	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 48" deep</p> <p>• <i>Proposed Solution:</i> Change door swing.</p>	<p>PCODE WC03REF</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
4140	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 14"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>
4141	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06REF</p> <p>ADAAG 4.17.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4142	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4143	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4144	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4145	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$150	<b>\$150</b>
4146	<p>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4"</p> <p>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</p>	<p>PCODE <b>WG02BNT</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$150	<b>\$150</b>
4147	<p>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</p> <p>• <i>As-is Measurement:</i> 15"</p> <p>• <i>Proposed Solution:</i> Provide new accessible water closet.</p>	<p>PCODE <b>WB08</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$1,400	<b>\$1,400</b>



Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4148	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$120	<b>\$240</b>
4149	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 43" F.T.D: 50"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$100	<b>\$200</b>
<b>12 Entrance/exit door</b>						
4150	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4151	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
4152	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4153	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 15 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	\$100
<b>13 Custodian room</b>						
4154	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	\$250
<b>Total Costs for Area/Floor: Level 1</b>					<b>\$35,325.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Entrance doors at east side</b>						
4155	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4156	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>
4157	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 13 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4158	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
<b>2 Drinking fountain</b>						
4159	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4160	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4161	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4162	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>
<b>3 Faculty offices #201-202, #204-205</b>						
4163	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
4164	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$250	<b>\$1,250</b>
4165	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>4 Custodian room #203</b>						
4166	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>5 Faculty offices #207-208, #210-211</b>						
4167	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
4168	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$250	<b>\$1,250</b>
4169	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>6 Custodian room (#209)</b>						
4170	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>7</b>	<b>Chemestry Lab (#214)</b>					
4171	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>
4172	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$250	<b>\$500</b>
4173	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 7 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
4174	<p>• <i>As-Built Description:</i> Accessible science lab fixed work station(s) not provided (5% of stations; not less than one).</p> <p>• <i>As-is Measurement:</i> 36" high</p> <p>• <i>Proposed Solution:</i> Provide accessible science lab fixed work station (s).</p>	<p>PCODE LB01 ADAAG 4.1.3 (18) CSAS 3103A(d)1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$9,200	<b>\$9,200</b>
4175	<p>• <i>As-Built Description:</i> Sink in workstation not accessible.</p> <p>• <i>As-is Measurement:</i> no knee clearance</p> <p>• <i>Proposed Solution:</i> Provide new accessible sink.</p>	<p>PCODE LF01AREF ADAAG 4.19.2 CSAS 1504(a) C.P.C. Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>		REF		
4176	<p>• <i>As-Built Description:</i> Minimum of one accessible fume hood station with specialized laboratory equipment not provided. (height between 28"-34", with knee space 27" high X 30" wide X 19" deep).</p> <p>• <i>Proposed Solution:</i> Provide worktop at accessible height.</p>	<p>PCODE LB02NT ADAAG 4.1.3(18) CSAS 3103A(d)2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$4,500	<b>\$4,500</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4177	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.</li> <li>• <i>As-is Measurement:</i> 42"</li> <li>• <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation.</li> </ul>	PCODE <b>IN03</b> ADAAG <b>7.2(3)</b> CSAS <b>1122B.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
5003	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At reach height where front approach is available, exceeds 48".</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Modify emergency shower handle to be within 48" A.F.F.</li> </ul>	PCODE <b>IE01NT</b> ADAAG <b>4.2.5</b> CSAS <b>1118B.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB		
<b>8 Chemistry Preparatory Area</b>						
4178	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4179	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4180	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4181	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>As-is Measurement:</i> 7"</li> <li>• <i>Proposed Solution:</i> Change door swing.</li> </ul>	PCODE <b>ID23</b> ADAAG <b>Fig. 25(a)</b> CSAS <b>11B-26A(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4182	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</li> <li>• <i>As-is Measurement:</i> 3"</li> <li>• <i>Proposed Solution:</i> Remove closer, if latch is to remain on door leading to hallway.</li> </ul>	PCODE <b>ID24ANT</b> ADAAG <b>Fig. 25(a)</b> CSAS <b>11B-26A(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>9 Instrumentation room (#215)</b>						
4183	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4184	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>10 Private office (#212)</b>						
4185	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>



Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4186	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>11 Exit door at west side</b>						
4187	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4188	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4189	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 12 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4190	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>

**Total Costs for****Area/Floor: Level 2****\$25,675.00**

---

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster -Building 6** Area/Floor: **Level 2**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Pomo Cluster -Building 6				<b>\$61,000.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster - Building 7** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Entrance/exit at east side</b>						
4191	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4192	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
4193	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
4194	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
<b>2 Lecture room (#190)</b>						
4195	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster - Building 7** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4196	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4197	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>3 Lecture room (#191-192)</b>						
4198	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4199	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4200	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$250	<b>\$1,000</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster - Building 7** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4201	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$50	<b>\$150</b>
4202	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</li> </ul>	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4203	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,850	<b>\$1,850</b>
4204	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	REF		
4205	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE IN06C ADAAG 4.24.6 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
4206	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster - Building 7** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>4</b>	<b>Pantry (#193)</b>					
4207	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4208	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4209	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</li> </ul>	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4210	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,850	<b>\$1,850</b>
4211	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	REF		
4212	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE IN06C ADAAG 4.24.6 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster - Building 7** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>5 Faculty offices</b>						
4213	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$90	<b>\$450</b>
4214	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	6	JOB	\$250	<b>\$1,500</b>
<b>6 Custodian</b>						
4215	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>7 Drinking fountain</b>						
4216	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4217	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA02REF ADAAG 4.15.5(1) CSAS 1507.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster - Building 7** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4218	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 38"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4219	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>
<b>8 Exit door at south side</b>						
4220	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4221	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4222	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>



Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster - Building 7** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total	
<b>9</b>	<b>Lecture room (#199)</b>						
4223	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>	
4224	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>	
4225	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>	
<b>Total Costs for</b>					<b>Area/Floor: Level 1</b>	<b>\$13,660.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Pomo Cluster - Building 7** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Pomo Cluster - Building 7				<b>\$13,660.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Entrance/Exit door adjacent to women's restrooms</b>					
4226	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4228	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>
4229	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4230	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
4231	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2</b>	<b>Studio (#120)</b>					
4232	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE <b>ID03</b></p> <p>ADAAG <b>4.13.10 &amp; 11</b></p> <p>CSAS <b>1133B.2.5</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	5	JOB	\$50	<b>\$250</b>
4233	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b></p> <p>CSAS <b>1133B.2.6</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
4234	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE <b>ID07</b></p> <p>ADAAG <b>4.13.9</b></p> <p>CSAS <b>1133B.2.5.1</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	3	JOB	\$250	<b>\$750</b>
4235	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE <b>SA07A</b></p> <p>ADAAG <b>4.30.6</b></p> <p>CSAS <b>1117B.5.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4236	<p>• <i>As-Built Description:</i> Lockers do not have accessible operating hardware. (2% of total; no less than one).</p> <p>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching or twisting.</p>	<p>PCODE <b>GG01NT</b></p> <p>-</p> <p>CSAS <b>3103(a)2D(5)</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4237	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 2"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	150	SF	\$12	<b>\$1,800</b>
<b>3 Studio (#122)</b>						
4238	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 2"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	265		\$12	<b>\$3,180</b>
4239	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$250	<b>\$1,250</b>
4240	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4241	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$75	<b>\$225</b>
4243	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Lockers (one for every 100, no less than one do not have accessible operating hardware).</li> <li>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching or twisting.</li> </ul>	PCODE GG01NT - CSAS 3103(a)2D(5) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4244	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	6	JOB	\$50	<b>\$300</b>
<b>4 Exit door from central display area</b>						
4245	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 &amp; 6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4246	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4247	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 10 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4248	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 2.25"</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE ID02A</p> <p>ADAAG 4.13.8</p> <p>CSAS 1133B.2.4.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	115	SF	\$12	<b>\$1,380</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4249	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
<b>5 Drinking fountain</b>						
4250	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02B</b> ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4251	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 20"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4252	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 43"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4253	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>6</b>	<b>Men's restrooms</b>					
4254	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4255	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4256	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4257	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 47" deep</p> <p>• <i>Proposed Solution:</i> Relocate screen wall to provide sufficient maneuvering clearance</p>	<p>PCODE ID27BNT</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,600	<b>\$2,600</b>
4258	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 47" deep</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</p>	<p>PCODE WC03BREF</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		



Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4259	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 13"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4260	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4261	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4262	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4263	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4264	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4265	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</li> <li>• <i>As-is Measurement:</i> 17"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</li> </ul>	PCODE <b>WB02</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,600	<b>\$4,600</b>
4266	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$120	<b>\$600</b>
4267	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 47" A.F.F.</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4268	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE01</b> CSAS <b>1503.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,000	<b>\$4,000</b>
4269	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>As-is Measurement:</i> 48"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</li> </ul>	PCODE <b>WE03</b> ADAAG <b>4.18.4</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4270	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door swings into required clear space in front of lavatory.</li> <li>• <i>Proposed Solution:</i> Relocate existing lavatory.</li> </ul>	PCODE <b>WD01ANT</b> ADAAG <b>4.19.3</b> CSAS <b>1504.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$900	<b>\$900</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>7</b>	<b>Women's restrooms</b>					
4271	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4272	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4273	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4274	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 47" deep</p> <p>• <i>Proposed Solution:</i> Relocate screen wall to provide sufficient maneuvering clearance.</p>	<p>PCODE ID27BNT</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,600	<b>\$2,600</b>
4275	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</p>	<p>PCODE WC03BREF</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4276	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 13"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4277	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4278	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4279	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4280	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4281	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 4"</li> <li>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</li> </ul>	PCODE <b>WG02BNT</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4282	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4283	<p>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</p> <p>• <i>As-is Measurement:</i> 16"</p> <p>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</p>	<p>PCODE <b>WB02</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$4,600	<b>\$4,600</b>
4284	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$120	<b>\$240</b>
4285	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 44" F.T.D: 43"</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$100	<b>\$200</b>
<b>8 Custodian room</b>						
4286	<p>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</p>	<p>PCODE <b>ID07C</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$250	<b>\$250</b>

**Total Costs for****Area/Floor: Level 1****\$44,160.00**

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Entrance/exit door at south-west side</b>					
4287	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</li> </ul>	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4288	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>
4289	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4290	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	50	SF	\$12	<b>\$600</b>
4291	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Rooms #231-236</b>						
4292	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li><i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	7	JOB	\$250	<b>\$1,750</b>
4293	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li><i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	6	JOB	\$90	<b>\$540</b>
4294	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li><i>As-is Measurement:</i> 7 lbs</li> <li><i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>3 Drinking fountain</b>						
4295	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li><i>As-is Measurement:</i> 8"</li> <li><i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4296	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li><i>As-is Measurement:</i> 18"</li> <li><i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA02REF ADAAG 4.15.5(1) CSAS 1507.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4297	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 40"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4298	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>
<b>4 Rooms (#220 &amp; 222)</b>						
4299	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4300	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$250	<b>\$750</b>
4301	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>5 Room (#223)</b>						
4302	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>



Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4303	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4304	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
<b>6 Lecture room (#226)</b>						
4305	<p>• <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.</p> <p>• <i>As-is Measurement:</i> 29"</p> <p>• <i>Proposed Solution:</i> Provide new, unequal width door leaves in existing frame for pair of doors.</p>	<p>PCODE <b>ID08A</b> ADAAG <b>4.13.4</b> CSAS <b>1133B.2.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$1,500	<b>\$3,000</b>
4306	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
4307	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE <b>SA10D</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	3	JOB	\$90	<b>\$270</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4308	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$50	<b>\$150</b>
4309	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4310	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Access to raised areas and platforms not provided.</li> <li>• <i>As-is Measurement:</i> 6"</li> <li>• <i>Proposed Solution:</i> Provide ramp and handrails.</li> </ul>	PCODE CD02A ADAAG 4.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	12	LF	\$130	<b>\$1,560</b>
<b>7 Storage room (#225)</b>						
4311	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4312	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4313	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.</li> <li>• <i>As-is Measurement:</i> 28"</li> <li>• <i>Proposed Solution:</i> Provide new, unequal width door leaves in existing frame for pair of doors.</li> </ul>	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,500	<b>\$1,500</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>8</b>	<b>Room (#228-229)</b>					
4314	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>
4315	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$250	<b>\$500</b>
4316	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4317	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>Proposed Solution:</i> Change latch/hinge side.</p>	<p>PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4318	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 8 lbs.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>9</b>	<b>Exit door at south-east side</b>					
4319	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "TO EXIT" sign at door.</li> </ul>	PCODE SA10E ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <i>TBD</i> DSA App. # <i>TBD</i> Funding <i>TBD</i>	1	JOB	\$90	<b>\$90</b>
4320	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <i>TBD</i> DSA App. # <i>TBD</i> Funding <i>TBD</i>	1	JOB	\$75	<b>\$75</b>
4321	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <i>TBD</i> DSA App. # <i>TBD</i> Funding <i>TBD</i>	1	JOB	\$50	<b>\$50</b>
4322	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>As-is Measurement:</i> 6"</li> <li>• <i>Proposed Solution:</i> Change latch/hinge side.</li> </ul>	PCODE ID23NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <i>TBD</i> DSA App. # <i>TBD</i> Funding <i>TBD</i>	1	JOB	\$500	<b>\$500</b>
4323	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 2"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <i>TBD</i> DSA App. # <i>TBD</i> Funding <i>TBD</i>	50	SF	\$12	<b>\$600</b>

**Total Costs for****Area/Floor:** Level 2**\$18,695.00**

---

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Miwok Cluster				<b>\$62,855.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Entrance/exit doors adjacent to room #141</b>					
4324	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4325	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4326	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
4327	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 1.5"</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	60	SF	\$12	<b>\$720</b>
4328	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Room #141</b>						
4329	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4330	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 8 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>3 Rooms (#142-143)</b>						
4331	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4332	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4333	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>4 Multimedia Center (#144)</b>						
4334	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li><i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4335	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li><i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>
4336	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li><i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</li> </ul>	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4337	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li><i>As-is Measurement:</i> 10 lbs</li> <li><i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
<b>5 Rooms (#145-149 ; #151-153)</b>						
4338	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li><i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	8	JOB	\$250	<b>\$2,000</b>



Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>6</b>	<b>Classroom #140</b>					
4339	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4340	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4341	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>As-is Measurement:</i> 1"</li> <li>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</li> </ul>	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4342	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4343	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	40	SF	\$12	<b>\$480</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>7</b>	<b>Rooms (#153-155)</b>					
4344	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$250	<b>\$750</b>
<b>Total Costs for</b>					<b>Area/Floor: Level 2</b>	<b>\$6,710.00</b>

---

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 2**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Miwok Cluster				<b>\$6,710.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Dance Studio (#170)</b>					
4345	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>
4346	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 1"</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	135	SF	\$12	<b>\$1,620</b>
4347	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4348	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	3	JOB	\$90	<b>\$270</b>
4349	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	3	JOB	\$50	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2</b>	<b>Classroom #171</b>					
4350	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4351	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$250	<b>\$250</b>
4352	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4353	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
4354	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
4355	<p>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</p>	<p>PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4356	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE <b>IN06A</b> ADAAG <b>4.24.3</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,850	<b>\$1,850</b>
4357	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE <b>IN06BREF</b> ADAAG <b>4.24.4</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4358	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
4359	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>As-is Measurement:</i> 15"</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</li> </ul>	PCODE <b>ID23B</b> ADAAG <b>Fig. 25(a)</b> CSAS <b>11B-26A(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,600	<b>\$2,600</b>
<b>3 Private offices (#173-174)</b>						
4360	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>4 Deli (#180)</b>						
4361	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4362	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4363	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>
4364	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	120	SF	\$12	<b>\$1,440</b>
<b>5 Studio Theater</b>						
4365	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	120		\$12	<b>\$1,440</b>
4366	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$90	<b>\$270</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4367	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>
4368	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	3	JOB	\$75	<b>\$225</b>
4369	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	3	JOB	\$50	<b>\$150</b>
4370	<p>• <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.</p> <p>• <i>As-is Measurement:</i> 27.5"</p> <p>• <i>Proposed Solution:</i> Provide new, unequal width door leafs in existing frame for pair of doors.</p>	<p>PCODE ID08A</p> <p>ADAAG 4.13.4</p> <p>CSAS 1133B.2.3.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$1,500	<b>\$3,000</b>
4371	<p>• <i>As-Built Description:</i> Wheelchair space (33"x48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat).</p> <p>• <i>Proposed Solution:</i> Remove fixed seating and provide wheelchair space plus necessary maneuvering clearance.</p>	<p>PCODE GB01A</p> <p>ADAAG 4.2.4</p> <p>CSAS 1104.3.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
4372	<p>• <i>As-Built Description:</i> Stage, enclosed and unenclosed platform, backstage areas or orchestra pit not accessible.</p> <p>• <i>Proposed Solution:</i> Provide ramp to raised platforms.</p>	<p>PCODE GC01B</p> <p>ADAAG 4.33.5</p> <p>CSAS 1104B.3.10</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	20	LF	\$400	<b>\$8,000</b>



Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4373	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</p> <p>• <i>As-is Measurement:</i> 8"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE <b>IA02B</b></p> <p>ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b></p> <p>CSAS <b>1507.3.1</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>
4374	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</p> <p>• <i>As-is Measurement:</i> 19"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE <b>IA02REF</b></p> <p>ADAAG <b>4.15.5(1)</b></p> <p>CSAS <b>1507.3.1</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
4375	<p>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</p> <p>• <i>As-is Measurement:</i> 40"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE <b>IA03BREF</b></p> <p>ADAAG <b>4.15.2</b></p> <p>CSAS <b>1507.3.3</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
4376	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE <b>IA05C</b></p> <p>ADAAG <b>4.4.1</b></p> <p>CSAS <b>Fig. 11B-3</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$1,900	<b>\$1,900</b>
<b>6 Men's restrooms</b>						
4377	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE <b>SA15</b></p> <p>CSAS <b>1115B.5</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4378	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4379	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4380	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>
4381	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06REF</p> <p>ADAAG 4.17.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
4382	<p>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</p> <p>• <i>As-is Measurement:</i> 30"</p> <p>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</p>	<p>PCODE WB03REF</p> <p>ADAAG 4.17.3</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4383	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4384	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4385	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4386	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	3	JOB	\$120	<b>\$360</b>
4387	<p>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE <b>WE01</b> CSAS <b>1503.2.1 C.P.C.</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$4,000	<b>\$4,000</b>
4388	<p>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>As-is Measurement:</i> 47"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</p>	<p>PCODE <b>WE03</b> ADAAG <b>4.18.4</b> CSAS <b>1503.2 C.P.C.</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4389	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet.</li> <li>• <i>As-is Measurement:</i> 19"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</li> </ul>	PCODE <b>WB02A</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,600	<b>\$4,600</b>
4390	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide).</li> <li>• <i>As-is Measurement:</i> 34"</li> <li>• <i>Proposed Solution:</i> Modify facility passage to be min. 44" wide. Demolish existing partition and replace.</li> </ul>	PCODE <b>WC02A</b> ADAAG <b>4.3.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	9	LF	\$170	<b>\$1,530</b>
4391	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).</li> <li>• <i>Proposed Solution:</i> Relocate existing lavatory.</li> </ul>	PCODE <b>WD01A</b> ADAAG <b>4.19.3</b> CSAS <b>1504.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$900	<b>\$900</b>
4392	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
<b>7 Women's restrooms</b>						
4393	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE <b>SA15</b> CSAS <b>1115B.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4394	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4395	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4396	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4397	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 12"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>
4398	<p>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</p>	<p>PCODE WB06REF</p> <p>ADAAG 4.17.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4399	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4400	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4401	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4402	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4403	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 4"</li> <li>• <i>Proposed Solution:</i> Feminine recessed napkin disposal container.</li> </ul>	PCODE <b>WG02BNT</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total	
4404	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>	
4405	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>As-is Measurement:</i> 32"</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$120	<b>\$360</b>	
4406	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide).</li> <li>• <i>Proposed Solution:</i> Modify facility passage to be min. 44" wide. Demolish existing partition and replace.</li> </ul>	PCODE <b>WC02A</b> ADAAG <b>4.3.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	14	LF	\$170	<b>\$2,380</b>	
4407	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).</li> <li>• <i>As-is Measurement:</i> 32"</li> <li>• <i>Proposed Solution:</i> Relocate existing lavatory.</li> </ul>	PCODE <b>WD01A</b> ADAAG <b>4.19.3</b> CSAS <b>1504.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$900	<b>\$900</b>	
<b>Total Costs for</b>					<b>Area/Floor: Level 1</b>	<b>\$50,210.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Miwok Cluster				<b>\$50,210.00</b>	



Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Entrance/exit doors adjacent to room #115</b>					
4408	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4409	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
4410	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
4411	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4412	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	60	SF	\$12	<b>\$720</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Private offices (#101-104)</b>						
4413	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
4414	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$250	<b>\$1,250</b>
4415	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>3 Room #103</b>						
4416	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4417	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>4 Room #117</b>						
4418	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4419	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>5 Private offices #109-111</b>						
4420	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
4421	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$250	<b>\$1,250</b>
4422	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>6 Room #109</b>						
4423	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4424	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>7 Exit door adjacent to room #112</b>						
4425	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4426	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4427	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4428	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
4429	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE <b>ID02A</b> ADAAG <b>4.13.8</b> CSAS <b>1133B.2.4.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>
<b>8 Electrical room (#112)</b>						
4430	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4431	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE <b>ID07C</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>9 Classroom (#113)</b>						
4432	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4433	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4434	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>10 Storage room (#118)</b>						
4435	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4436	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE <b>ID07C</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>11 Classroom #114</b>						
4437	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4438	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$250	<b>\$1,000</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4439	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	\$100
4440	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	\$720
<b>12 Laboratory #115</b>						
4441	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	\$90
4442	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	\$500
4443	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</li> </ul>	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4444	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,850	\$1,850

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4445	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE <b>IN06BREF</b> ADAAG <b>4.24.4</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	REF		
4446	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
<b>13 Drinking fountain</b>						
4447	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02B</b> ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4448	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 19"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4449	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 40"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4450	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>

**Total Costs for****Area/Floor: Level 1****\$16,625.00**



Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Entrance/exit doors adjacent to room #215</b>					
4451	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4452	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4453	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
4454	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 13 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4455	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 1.5"</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Veteran's offices #201-205</b>						
4456	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	6	JOB	\$250	<b>\$1,500</b>
4457	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$90	<b>\$450</b>
4458	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 8 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>3 Drinking fountain</b>						
4459	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02B</b> ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4460	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 38"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4461	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4462	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>
<b>4 Veteran's offices (#207-211)</b>						
4463	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$90	<b>\$450</b>
4464	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	6	JOB	\$250	<b>\$1,500</b>
4465	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>5</b>	<b>Exit door adjacent to room 212</b>					
4466	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4467	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4468	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 12 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4469	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 1.5"</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	60	SF	\$12	<b>\$720</b>
4470	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>6 Classroom #212</b>						
4471	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4472	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4473	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>7 Classroom #214</b>						
4474	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4475	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total	
4476	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 8 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>	
<b>8 Classroom #215</b>							
4477	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>	
4478	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>	
4479	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 8 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>	
<b>Total Costs for</b>					<b>Area/Floor: Level 1</b>	<b>\$12,230.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Miwok Cluster				<b>\$28,855.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Library entrance doors</b>						
4480	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b></p> <p>CSAS <b>1133B.2.6</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
<b>2 Circulation desk</b>						
4481	<p>• <i>As-Built Description:</i> Information desk or circulation counter or section not 36" max. high and min. 36" wide (CA only: top 28" to 34" high, min. 36" counter length).</p> <p>• <i>As-is Measurement:</i> 42"</p> <p>• <i>Proposed Solution:</i> Provide new accessible desk/counter section when remodeling area. Relocate or modify electrical outlets and equipment as needed. Interim: provide equivalent facilitation.</p>	<p>PCODE <b>BE02</b></p> <p>ADAAG <b>8.3</b></p> <p>CSAS <b>1122B.4</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$4,000	<b>\$4,000</b>
<b>3 Exit doors</b>						
4482	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b></p> <p>CSAS <b>1133B.2.6</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	6	JOB	\$75	<b>\$450</b>
4483	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE <b>IC03</b></p> <p>ADAAG <b>4.2.5</b></p> <p>CSAS <b>760-10</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
4484	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE <b>SA10A</b></p> <p>ADAAG <b>4.1.3 (16)</b></p> <p>CSAS <b>1117B.5.2 &amp; 6</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>



Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>4 Staircase</b>						
4485	<p>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top &amp; bottom treads (required in CA only).</p> <p>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top &amp; bottom treads when altering area.</p>	<p>PCODE <b>II02B</b></p> <p>CSAS <b>1133B.4.4</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	28	LF	\$14	<b>\$392</b>
4486	<p>• <i>As-Built Description:</i> Stair handrail does not extend one tread width sloped plus 12" min. horizontally beyond bottom riser.</p> <p>• <i>Proposed Solution:</i> Extend stair handrail at bottom (cost for each extension piece).</p>	<p>PCODE <b>ED07</b></p> <p>ADAAG <b>4.9.4(2)</b></p> <p>CSAS <b>1133B.4.2.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$170	<b>\$340</b>
<b>5 Women's restrooms</b>						
4487	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE <b>SA15</b></p> <p>CSAS <b>1115B.5</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4488	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE <b>SA11A</b></p> <p>ADAAG <b>4.1.3(16)(a)</b></p> <p>CSAS <b>1117B.5.9</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4489	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 8 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE <b>ID03</b></p> <p>ADAAG <b>4.13.10 &amp; 11</b></p> <p>CSAS <b>1133B.2.5</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4490	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 7"</p> <p>• <i>Proposed Solution:</i> Relocate existing drinking fountain.</p>	<p>PCODE <b>ID24NT</b></p> <p>ADAAG <b>Fig. 25(a)</b></p> <p>CSAS <b>11B-26A(a)</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4491	<p>• <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations.</p> <p>• <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom.</p>	<p>PCODE <b>WA01</b></p> <p>ADAAG <b>4.22</b></p> <p>CSAS <b>1115B.7.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$17,000	<b>\$17,000</b>
4492	<p>• <i>As-Built Description:</i> CA only: In existing buildings a single accommodation restroom has less than 36" wide x 48" long space in front of a water closet or less than 32" in front when 32" from side wall to water closet are provided.</p> <p>• <i>As-is Measurement:</i> 25" in front of wc</p> <p>• <i>Proposed Solution:</i> Provide accessible water closet, remodel walls, reroute plumbing and HVAC systems, repair tiled surfaces, patch finishes to match and repaint as needed. Provide accessible accessories and grab bars.</p>	<p>PCODE <b>WB01BREF</b></p> <p>CSAS <b>Fig. 11B-1C</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
4493	<p>• <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet.</p> <p>• <i>As-is Measurement:</i> 21.5"</p> <p>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</p>	<p>PCODE <b>WB02AREF</b></p> <p>ADAAG <b>4.17.3</b></p> <p>CSAS <b>1115B.7.1.3</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
4494	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE <b>WB10REF</b></p> <p>ADAAG <b>4.16.5 &amp; 4.27.4</b></p> <p>CSAS <b>1502.0</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4495	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Relocate water closet. Remodel restroom as needed.</li> </ul>	PCODE <b>WB01REF</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4496	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02BREF</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4497	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet.</li> </ul>	PCODE <b>WB08REF</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4498	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).</li> <li>• <i>As-is Measurement:</i> 34"</li> <li>• <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed.</li> </ul>	PCODE <b>WD01REF</b> ADAAG <b>4.19.3</b> CSAS <b>1504.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4499	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01AREF</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4500	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07REF</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>6</b>	<b>Men's restrooms</b>					
4501	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4502	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4503	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 8 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4504	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 7"</p> <p>• <i>Proposed Solution:</i> Relocate existing drinking fountain.</p>	<p>PCODE ID24NT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4505	<p>• <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations.</p> <p>• <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom.</p>	<p>PCODE WA01</p> <p>ADAAG 4.22</p> <p>CSAS 1115B.7.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$17,000	<b>\$17,000</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4507	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet.</li> <li>• <i>As-is Measurement:</i> 21.5"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</li> </ul>	PCODE <b>WB02AREF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4508	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10REF</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4509	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Relocate water closet. Remodel restroom as needed.</li> </ul>	PCODE <b>WB01REF</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4510	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02BREF</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4511	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet.</li> </ul>	PCODE <b>WB08REF</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4512	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).</li> <li>• <i>As-is Measurement:</i> 34"</li> <li>• <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed.</li> </ul>	PCODE <b>WD01REF</b> ADAAG <b>4.19.3</b> CSAS <b>1504.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4513	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01AREF</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4514	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07REF</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
4515	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Urinal not accessible.</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel partitions, reroute plumbing and HVAC systems, repair tiled surfaces, patch finishes to match and repaint as needed.</li> </ul>	PCODE <b>WEREF</b> ADAAG <b>4.18</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
5008	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: In existing buildings a single accommodation restroom has less than 36" wide x 48" long space in front of a water closet or less than 32" in front when 32" from side wall to water closet are provided.</li> <li>• <i>As-is Measurement:</i> 25" in front of wc.</li> <li>• <i>Proposed Solution:</i> Provide accessible water closet, remodel walls, reroute plumbing and HVAC systems, repair tiled surfaces, patch finishes to match and repaint as needed. Provide accessible accessories and grab bars.</li> </ul>	PCODE <b>WB01BREF</b> CSAS <b>Fig. 11B-1C</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				REF
<b>7 Drinking fountain</b>						
4516	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02B</b> ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4517	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4518	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 40"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4519	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>
<b>8 Room #107</b>						
4520	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4521	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4522	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>9 Digital Village Foundation (#101)</b>						
4523	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4524	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>10 Private office (#102)</b>						
4525	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4526	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>11 Reference office (#103)</b>						
4527	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4528	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>



Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4529	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>As-is Measurement:</i> 3"</li> <li>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</li> </ul>	PCODE <b>ID23A</b> ADAAG <b>Fig. 25(a)</b> CSAS <b>11B-26A(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>12 Room (#104-106)</b>						
4530	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$90	<b>\$270</b>
4531	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$250	<b>\$750</b>
<b>13 Exit corridor</b>						
4532	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4533	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 12 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4534	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4535	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
<b>14 Elevator</b>						
4536	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> "Door opening has less than 36"" clear opening width. "</li> <li>• <i>As-is Measurement:</i> 32"</li> <li>• <i>Proposed Solution:</i> "Enlarge elevator door opening to 36"" width."</li> </ul>	PCODE <b>IK03</b> ADAAG <b>4.10.9</b> CSAS <b>5103 (d.1) 3.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$19,600	<b>\$19,600</b>
4537	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Small size of car makes elevator difficult to use or unusable by persons in wheelchairs.</li> <li>• <i>As-is Measurement:</i> 60"W x 39"D</li> <li>• <i>Proposed Solution:</i> Provide new elevator with two stops.</li> </ul>	PCODE <b>IK04</b> ADAAG <b>4.10.9</b> CSAS <b>5103 (d.1) 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	?	<b>\$120,000</b>
4538	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Elevator car lacks emergency communication device that is not dependent on speaking/hearing ability of elevator passenger.</li> <li>• <i>Proposed Solution:</i> Provide elevator communication device that has combination voice and light signal communications.</li> </ul>	PCODE <b>IK06A</b> ADAAG <b>4.10.14</b> CSAS <b>5103 (d.1) 6A</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$700	<b>\$700</b>
4539	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> "Elevator control panel buttons less than 3/4"" minimum dimension and/or not raised at least 1/8"" . "</li> <li>• <i>Proposed Solution:</i> Provide new elevator control panel buttons.</li> </ul>	PCODE <b>IK07A</b> ADAAG <b>4.10.12(1)</b> CSAS <b>5103(d.1)6*</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$980	<b>\$980</b>

Campus: **Indian Valley Campus** Building/Part: **Miwok Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4540	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Braille or tactile symbols at numerals not provided on elevator control panel.</li> <li>• <i>Proposed Solution:</i> Provide Braille and tactile symbols on elevator control panel.</li> </ul>	PCODE <b>IK07D</b> ADAAG <b>4.10.12(2)</b> CSAS <b>5103 (d.1) 6B.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$110	<b>\$110</b>
4541	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> "Handrail not mounted with top 32""", plus or minus one inch, above the floor of car."</li> <li>• <i>As-is Measurement:</i> 40"</li> <li>• <i>Proposed Solution:</i> "Remount handrail at 32"" above floor."</li> </ul>	PCODE <b>IK08A</b> - CSAS <b>5103 (d.1) 7.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$360	<b>\$360</b>
4542	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> "Floor numbers not provided at all elevator entrances with both raised characters 2"" high and Braille numbers, on each entrance jamb."</li> <li>• <i>Proposed Solution:</i> Provide compliant floor numbering on elevator door jambs.</li> </ul>	PCODE <b>IK11</b> ADAAG <b>4.10.5*</b> CSAS <b>5103 (d.1) 10.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	SET	\$50	<b>\$50</b>
4543	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Neither audible signal nor visual wall lantern provided.</li> <li>• <i>Proposed Solution:</i> "Provide audible signal, and wall lantern device."</li> </ul>	PCODE <b>IK10C</b> ADAAG <b>4.10.4</b> CSAS <b>5103 (d.1) 9</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,510	<b>\$2,510</b>
4544	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Call buttons in lobby / hall not centered 3'-6" above floor.</li> <li>• <i>As-is Measurement:</i> 46"</li> <li>• <i>Proposed Solution:</i> Provide new or relocate elevator call buttons to 3'-6" above floor at exterior landing.</li> </ul>	PCODE <b>IK09</b> ADAAG <b>4.10.3</b> CSAS <b>3003.4.9b</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	FLR	\$450	<b>\$450</b>
<b>15 Staircase</b>						
4545	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stairs: There is no 2" wide contrasting color strip 1" from nosing on top &amp; bottom treads (required in CA only).</li> <li>• <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" from nosing on top &amp; bottom treads when altering area.</li> </ul>	PCODE <b>II02B</b> CSAS <b>1133B.4.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	20	LF	\$14	<b>\$280</b>

**Total Costs for****Area/Floor: Level 1****\$194,482.00**

Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Elevator Lobby</b>					
4546	<p>• <i>As-Built Description:</i> "Floor numbers not provided at all elevator entrances with both raised characters 2" high and Braille numbers, on each entrance jamb."</p> <p>• <i>Proposed Solution:</i> Provide compliant floor numbering on elevator door jambs.</p>	<p>PCODE <b>IK11</b> ADAAG <b>4.10.5*</b> CSAS <b>5103 (d.1) 10.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	SET	\$50	<b>\$50</b>
4547	<p>• <i>As-Built Description:</i> Neither audible signal nor visual wall lantern provided.</p> <p>• <i>Proposed Solution:</i> "Provide audible signal, and wall lantern device."</p>	<p>PCODE <b>IK10C</b> ADAAG <b>4.10.4</b> CSAS <b>5103 (d.1) 9</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$2,510	<b>\$2,510</b>
4548	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$250	<b>\$250</b>
4549	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4550	<p>• <i>As-Built Description:</i> At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "TO EXIT" sign at door.</p>	<p>PCODE <b>SA10E</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Library stacks</b>						
4551	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Open stacks (i.e. public use) do not have min 36" (44" preferred) wide aisles (CA only: 44" min. width at main aisles and 36" min. at end aisles).</li> <li>• <i>As-is Measurement:</i> 34"</li> <li>• <i>Proposed Solution:</i> Enlarge open stack aisles to 44" wide and/or end of aisles to 36".</li> </ul>	PCODE <b>BB01</b> ADAAG <b>8.5</b> CSAS <b>1106B.4.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	600	LF	\$60	<b>\$36,000</b>
4552	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Book shelves are more than 54" maximum height.</li> <li>• <i>As-is Measurement:</i> 78"</li> <li>• <i>Proposed Solution:</i> Provide attendant when needed.</li> </ul>	PCODE <b>BD01A</b> CSAS <b>1106B.4.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$0	
<b>3 Rooms (#202 &amp; 208)</b>						
4553	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE <b>ID07C</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>4 Women's restroom</b>						
4554	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE <b>SA15</b> CSAS <b>1115B.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4555	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</li> <li>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</li> </ul>	PCODE <b>SA11A</b> ADAAG <b>4.1.3(16)(a)</b> CSAS <b>1117B.5.9</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4556	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</li> <li>• <i>As-is Measurement:</i> 44" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</li> </ul>	PCODE <b>ID27B</b> ADAAG <b>Fig. 25(c)</b> CSAS <b>11B-26A(c)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,600	<b>\$2,600</b>
4557	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</li> <li>• <i>As-is Measurement:</i> 44" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</li> </ul>	PCODE <b>WC03BREF</b> CSAS <b>Fig.No.31-1B</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4558	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4559	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4560	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 35"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4561	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</li> <li>• <i>As-is Measurement:</i> 17"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</li> </ul>	PCODE <b>WB02</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,600	<b>\$4,600</b>
4562	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4563	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4564	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4565	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</li> </ul>	PCODE <b>WG02BNT</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4566	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4567	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$120	<b>\$240</b>
4568	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 46" A.F.F.</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4569	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
<b>5 Men's restroom</b>						
4570	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE <b>SA15</b> CSAS <b>1115B.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4571	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</li> <li>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</li> </ul>	PCODE <b>SA11A</b> ADAAG <b>4.1.3(16)(a)</b> CSAS <b>1117B.5.9</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>



Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4572	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</li> <li>• <i>As-is Measurement:</i> 44" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</li> </ul>	PCODE <b>ID27B</b> ADAAG <b>Fig. 25(c)</b> CSAS <b>11B-26A(c)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,600	<b>\$2,600</b>
4573	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</li> <li>• <i>As-is Measurement:</i> 44" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</li> </ul>	PCODE <b>WC03BREF</b> CSAS <b>Fig.No.31-1B</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4574	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs.for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4575	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4576	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 35"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4577	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</li> <li>• <i>As-is Measurement:</i> 17"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</li> </ul>	PCODE <b>WB02</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,600	<b>\$4,600</b>
4578	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4579	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4580	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4582	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4583	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$120	<b>\$240</b>

Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4584	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 46" A.F.F.</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE <b>WG01A</b></p> <p>ADAAG <b>28 CFR 35.133(a)</b></p> <p>CSAS <b>1115B.9.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4585	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b></p> <p>CSAS <b>1133B.2.6</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4586	<p>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE <b>WE01</b></p> <p>CSAS <b>1503.2.1 C.P.C.</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$4,000	<b>\$4,000</b>
4587	<p>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>As-is Measurement:</i> 47"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</p>	<p>PCODE <b>WE03</b></p> <p>ADAAG <b>4.18.4</b></p> <p>CSAS <b>1503.2 C.P.C.</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
<b>6 Drinking fountain</b>						
4588	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</p> <p>• <i>As-is Measurement:</i> 8"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE <b>IA02B</b></p> <p>ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b></p> <p>CSAS <b>1507.3.1</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>

Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4589	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4590	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 40"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4591	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>
<b>Total Costs for Area/Floor: Level 1</b>					<b>\$70,000.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Library** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Library				<b>\$264,482.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Main entrance</b>					
4592	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4593	<p>• <i>As-Built Description:</i> Accessible building entrance when not all are accessible not identified with a sign showing the International Symbol of Accessibility.</p> <p>• <i>Proposed Solution:</i> Provide building entrance sign that shows international symbol at accessible entrance.</p>	<p>PCODE SA12 ADAAG 4.1.2(7)(c) CSAS 1117B.5.7 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4594	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 1.75"</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	90	SF	\$12	<b>\$1,080</b>
4595	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
4596	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4597	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
<b>2 Reception area</b>						
4598	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02B</b> ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4599	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide).</li> <li>• <i>As-is Measurement:</i> 42"</li> <li>• <i>Proposed Solution:</i> Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table.</li> </ul>	PCODE <b>IN03A</b> ADAAG <b>4.32.3 &amp; 4</b> CSAS <b>1122B.3 &amp; 4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,200	<b>\$1,200</b>
4600	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4601	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>3 Mac Computer Lab (#121)</b>						
4602	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4603	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4604	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4605	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</li> </ul>	PCODE ID24A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>4 Computer Skills Lab (#122)</b>						
4606	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>



Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4607	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4608	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4609	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>As-is Measurement:</i> 9"</li> <li>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</li> </ul>	PCODE ID23A ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>5 Learning Center (#123)</b>						
4610	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4611	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4612	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$50	<b>\$150</b>
4613	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Recommended only: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.</li> <li>• <i>As-is Measurement:</i> 24" wide</li> <li>• <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture.</li> </ul>	PCODE <b>IN02A</b> ADAAG <b>4.32.3 &amp; .4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,600	<b>\$1,600</b>
4614	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
<b>6 Private offices (#130-132)</b>						
4615	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$90	<b>\$270</b>
4616	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$250	<b>\$750</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>7 Group study (#126-129)</b>						
4617	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
4618	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$250	<b>\$1,000</b>
<b>8 Storage rooms (#124-125)</b>						
4619	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4620	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
<b>9 Lounge area (#133)</b>						
4621	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4622	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4623	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
4624	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4625	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 6.5"</p> <p>• <i>Proposed Solution:</i> Change latch/hinge side.</p>	<p>PCODE <b>ID24NT</b> ADAAG <b>Fig. 25(a)</b> CSAS <b>11B-26A(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4626	<p>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Remove or relocate furniture or storage items.</p>	<p>PCODE <b>ID23A</b> ADAAG <b>Fig. 25(a)</b> CSAS <b>11B-26A(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4627	<p>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</p>	<p>PCODE <b>IN06REF</b> ADAAG <b>4.24.2</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4628	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE <b>IN06A</b> ADAAG <b>4.24.3</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,850	<b>\$1,850</b>
4629	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE <b>IN06BREF</b> ADAAG <b>4.24.4</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4630	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
<b>10 Electrical room (#134)</b>						
4631	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4632	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE <b>ID07C</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>11 Private office (#135)</b>						
4633	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4634	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>12 Exit door adjacent to room (#135)</b>						
4635	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4636	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4637	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>
4638	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>

**Total Costs for****Area/Floor: Level 1****\$18,040.00**

---

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Ohlone Cluster				<b>\$18,040.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Main entrance</b>					
4639	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 &amp; 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4640	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
4641	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
4642	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 1.25"</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	60	SF	\$12	<b>\$720</b>
4643	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>



Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Private offices (#141-144)</b>						
4644	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li><i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
4645	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li><i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$250	<b>\$1,000</b>
<b>3 Custodian's room (#170)</b>						
4646	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Non-common use areas within this facility, such as offices, do not have accessible door hardware.</li> <li><i>Proposed Solution:</i> Provide lever handle or other accessible hardware when a specific need is identified in the future or when altering area.</li> </ul>	PCODE ID07C ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
<b>4 Children's Center Offices (#146-148)</b>						
4647	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li><i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
4648	<ul style="list-style-type: none"> <li><i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li><i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$250	<b>\$1,000</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>5 Lounge (#149)</b>						
4649	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4650	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$250	<b>\$750</b>
<b>6 Classroom #153</b>						
4651	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4652	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4653	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4654	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4655	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 2"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE <b>ID02A</b> ADAAG <b>4.13.8</b> CSAS <b>1133B.2.4.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>
<b>7 Classroom #154</b>						
4656	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4657	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4658	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4659	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 2"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>
<b>8 Exit doors adjacent to room #154</b>						
4660	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4661	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>
4662	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4663	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4664	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>
<b>9 Classroom #156</b>						
4665	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4666	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$250	<b>\$1,000</b>
4667	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$50	<b>\$200</b>
4668	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	120	SF	\$12	<b>\$1,440</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>10 Office occupations (#157)</b>						
4669	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4670	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4671	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 8 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>11 Office occupations (#158)</b>						
4672	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4673	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$250	<b>\$1,000</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4674	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4675	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>
<b>12 Office occupations #159</b>						
4676	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4677	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4678	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 12 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>13 Private offices #161-164</b>						
4679	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$90	<b>\$360</b>
4680	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$250	<b>\$1,250</b>
4681	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 8 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4682	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
<b>14 Drinking fountain</b>						
4683	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE IA02B ADAAG 4.15.5(1) & Fig.27(a) CSAS 1507.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>



Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4684	<p>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</p> <p>• <i>As-is Measurement:</i> 18"</p> <p>• <i>Proposed Solution:</i> Provide new, accessible fountain.</p>	<p>PCODE IA02REF</p> <p>ADAAG 4.15.5(1)</p> <p>CSAS 1507.3.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		
4685	<p>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</p> <p>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</p>	<p>PCODE IA05C</p> <p>ADAAG 4.4.1</p> <p>CSAS Fig. 11B-3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$1,900	<b>\$1,900</b>
<b>15 Men's restroom</b>						
4686	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4687	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4688	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4689	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4690	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</li> <li>• <i>As-is Measurement:</i> 47" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</li> </ul>	PCODE <b>ID27B</b> ADAAG <b>Fig. 25(c)</b> CSAS <b>11B-26A(c)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,600	<b>\$2,600</b>
4691	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</li> <li>• <i>As-is Measurement:</i> 47" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</li> </ul>	PCODE <b>WC03BREF</b> CSAS <b>Fig.No.31-1B</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4692	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4693	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4694	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4695	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4696	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4697	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4698	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4699	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4700	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$120	<b>\$600</b>
4701	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> P.T.D: 47" A.F.F.</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4702	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE01</b> CSAS <b>1503.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,000	<b>\$4,000</b>
4703	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>As-is Measurement:</i> 47"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</li> </ul>	PCODE <b>WE03</b> ADAAG <b>4.18.4</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4704	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> 30" x 48" clear floor space in front of accessible urinal not provided.</li> <li>• <i>As-is Measurement:</i> 37"</li> <li>• <i>Proposed Solution:</i> Provide clear floor space in front of accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE04</b> ADAAG <b>4.18.3</b> CSAS <b>1115B.9.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,500	<b>\$1,500</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>16</b>	<b>Women's restroom</b>					
4705	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4706	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4707	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4708	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>As-is Measurement:</i> 2"</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID24B</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,600	<b>\$2,600</b>
4709	<p>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</p> <p>• <i>As-is Measurement:</i> 12"</p> <p>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</p>	<p>PCODE WB01A</p> <p>CSAS 1115B.7.3</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,000	<b>\$2,000</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4710	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				
4711	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				
4712	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>				
4713	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4714	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4715	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4716	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4717	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 4"</li> <li>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</li> </ul>	PCODE <b>WG02BNT</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4718	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$120	<b>\$360</b>
<b>Total Costs for Area/Floor: Level 1</b>					<b>\$40,560.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Main entrance</b>					
4719	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</li> </ul>	PCODE SA10D ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4720	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>
4721	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4722	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE ID02A ADAAG 4.13.8 CSAS 1133B.2.4.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>
4723	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE IC03 ADAAG 4.2.5 CSAS 760-10 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>



Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>2 Drinking fountain</b>						
4724	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Drinking fountain less than 17"-19" deep (front to back).</li> <li>• <i>As-is Measurement:</i> 9"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02B</b> ADAAG <b>4.15.5(1) &amp; Fig.27(a)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4725	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).</li> <li>• <i>As-is Measurement:</i> 18"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA02REF</b> ADAAG <b>4.15.5(1)</b> CSAS <b>1507.3.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4726	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 41"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03BREF</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4727	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain lacks protection for visually impaired persons.</li> <li>• <i>Proposed Solution:</i> Provide alternate wing walls, 32" wide min. x 18" min. out from wall, which are drinking fountain height and not more than 6" from floor."</li> </ul>	PCODE <b>IA05C</b> ADAAG <b>4.4.1</b> CSAS <b>Fig. 11B-3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,900	<b>\$1,900</b>
<b>3 Classroom #200</b>						
4728	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4729	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4730	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 8 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>4 Faculty offices #202-207</b>						
4731	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	6	JOB	\$90	<b>\$540</b>
4732	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	8	JOB	\$250	<b>\$2,000</b>
4733	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
4734	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</li> <li>• <i>As-is Measurement:</i> 3"</li> <li>• <i>Proposed Solution:</i> Remove door closer if latch is required.</li> </ul>	PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4735	<p>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</p>	<p>PCODE SA10D</p> <p>ADAAG 4.1.3 (16)</p> <p>CSAS 1117B.5.2 &amp; 6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>
<b>5 Room #209</b>						
4736	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4737	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$250	<b>\$250</b>
4738	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4739	<p>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</p> <p>• <i>Proposed Solution:</i> Change latch/hinge side.</p>	<p>PCODE ID24NT</p> <p>ADAAG Fig. 25(a)</p> <p>CSAS 11B-26A(a)</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>6</b>	<b>Typing classroom (#210)</b>					
4740	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>
4741	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$250	<b>\$500</b>
4742	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03 ADAAG 4.13.10 &amp; 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$50	<b>\$100</b>
4743	<p>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</p> <p>• <i>As-is Measurement:</i> no knee clearance</p> <p>• <i>Proposed Solution:</i> Remodel sink cabinet.</p>	<p>PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$1,850	<b>\$1,850</b>
4744	<p>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</p> <p>• <i>As-is Measurement:</i> 36"</p> <p>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</p>	<p>PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>		REF		
4745	<p>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</p> <p>• <i>As-is Measurement:</i> 8"</p> <p>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</p>	<p>PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4746	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
<b>7 Classroom (#211)</b>						
4747	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4748	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4749	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>8 Exit doors adjacent to room (#211)</b>						
4750	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "TO EXIT" sign at door.</li> </ul>	PCODE <b>SA10E</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4751	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE <b>ID06A</b></p> <p>CSAS <b>1133B.2.6</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
4753	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 11 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE <b>ID03</b></p> <p>ADAAG <b>4.13.10 &amp; 11</b></p> <p>CSAS <b>1133B.2.5</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2		\$50	<b>\$100</b>
4754	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE <b>ID02A</b></p> <p>ADAAG <b>4.13.8</b></p> <p>CSAS <b>1133B.2.4.1</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	60	SF	\$12	<b>\$720</b>
4755	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE <b>IC03</b></p> <p>ADAAG <b>4.2.5</b></p> <p>CSAS <b>760-10</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
<b>9 Court reporting (#214)</b>						
4756	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE <b>SA07A</b></p> <p>ADAAG <b>4.30.6</b></p> <p>CSAS <b>1117B.5.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4757	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$250	<b>\$750</b>
4758	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$50	<b>\$150</b>
4759	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Access to raised areas and platforms not provided.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide ramp and handrails.</li> </ul>	PCODE CD02A ADAAG 4.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	13	LF	\$130	<b>\$1,690</b>
<b>10 Accounting classroom (#215)</b>						
4760	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4761	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4762	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 8 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>11 Classroom (#216)</b>						
4763	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4764	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4765	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$50	<b>\$100</b>
<b>12 Faculty offices (#221-222)</b>						
4766	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$90	<b>\$270</b>
4767	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$250	<b>\$1,000</b>



Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4768	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4769	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 11 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>Total Costs for</b>					<b>Area/Floor: Level 1</b>	<b>\$19,815.00</b>

---

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Ohlone Cluster				<b>\$60,375.00</b>	

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1</b>	<b>Classroom (#104)</b>					
4770	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE <b>ID02A</b> ADAAG <b>4.13.8</b> CSAS <b>1133B.2.4.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	120	SF	\$12	<b>\$1,440</b>
4771	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4772	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Accessible building entrance when not all are accessible not identified with a sign showing the International Symbol of Accessibility.</li> <li>• <i>Proposed Solution:</i> Provide building entrance sign that shows international symbol at accessible entrance.</li> </ul>	PCODE <b>SA12</b> ADAAG <b>4.1.2(7)(c)</b> CSAS <b>1117B.5.7</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4773	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door.</li> </ul>	PCODE <b>SA10D</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4774	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4775	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
4776	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4777	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
<b>2 Classroom (#103)</b>						
4778	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4779	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 8 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4780	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).</li> <li>• <i>As-is Measurement:</i> 6.5"</li> <li>• <i>Proposed Solution:</i> Remove door closer if latch is required.</li> </ul>	PCODE ID24NT ADAAG Fig. 25(a) CSAS 11B-26A(a) Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4781	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
<b>3 Room (#101-102)</b>						
4782	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4783	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4784	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 7 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4785	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</li> </ul>	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4786	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE <b>IN06A</b> ADAAG <b>4.24.3</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,850	<b>\$1,850</b>
4787	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE <b>IN06BREF</b> ADAAG <b>4.24.4</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4788	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>IN06C</b> ADAAG <b>4.24.6</b> CSAS <b>1117B.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
<b>4 Exit door adjacent to room #101</b>						
4789	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4790	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route.</li> <li>• <i>Proposed Solution:</i> Provide directional sign.</li> </ul>	PCODE <b>SA20</b> ADAAG <b>35.163(b)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$170	<b>\$170</b>
4791	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4792	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 12 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4793	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE <b>ID02A</b> ADAAG <b>4.13.8</b> CSAS <b>1133B.2.4.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>
<b>5 Snack shop</b>						
4794	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4795	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Existing threshold at door is less than 3/4" but without a beveled edge on both sides.</li> <li>• <i>As-is Measurement:</i> 1/2"</li> <li>• <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side.</li> </ul>	PCODE <b>ID02</b> ADAAG <b>4.1.6(3)(d)(ii)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4796	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4797	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
<b>6 Gymnasium (#106)</b>						
4798	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.</li> <li>• <i>As-is Measurement:</i> 29"</li> <li>• <i>Proposed Solution:</i> Provide new, unequal width door leafs in existing frame for pair of doors.</li> </ul>	PCODE ID08A ADAAG 4.13.4 CSAS 1133B.2.3.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,500	<b>\$1,500</b>
4799	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE ID06A CSAS 1133B.2.6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4800	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	5	JOB	\$50	<b>\$250</b>
4801	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE SA10A ADAAG 4.1.3 (16) CSAS 1117B.5.2 & 6 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$90	<b>\$270</b>



Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4802	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>
4803	<p>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</p> <p>• <i>As-is Measurement:</i> 2"</p> <p>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</p>	<p>PCODE <b>ID02A</b> ADAAG <b>4.13.8</b> CSAS <b>1133B.2.4.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	200	SF	\$12	<b>\$2,400</b>
<b>7 Men's restroom</b>						
4804	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE <b>SA15</b> CSAS <b>1115B.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4805	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE <b>SA11A</b> ADAAG <b>4.1.3(16)(a)</b> CSAS <b>1117B.5.9</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4806	<p>• <i>As-Built Description:</i> Existing threshold at door is less than 3/4" but without a beveled edge on both sides.</p> <p>• <i>As-is Measurement:</i> 1/2"</p> <p>• <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side.</p>	<p>PCODE <b>ID02</b> ADAAG <b>4.1.6(3)(d)(ii)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$250	<b>\$250</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4807	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 13.5"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4808	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4809	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4810	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4811	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</li> <li>• <i>As-is Measurement:</i> 15.5"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</li> </ul>	PCODE <b>WB02</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,600	<b>\$4,600</b>
4812	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4813	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4814	<p>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</p> <p>• <i>Proposed Solution:</i> Provide accessible grab bars.</p>	<p>PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4815	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$150	<b>\$150</b>
4816	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	3	JOB	\$120	<b>\$360</b>
4817	<p>• <i>As-Built Description:</i> Bottom of flat, not tilted mirror more than 40" above floor.</p> <p>• <i>As-is Measurement:</i> 48"</p> <p>• <i>Proposed Solution:</i> Relocate or provide new accessible mirror.</p>	<p>PCODE <b>WG03</b> ADAAG <b>4.19.6</b> CSAS <b>1115B.9.1.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$150	<b>\$150</b>
4818	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 42"</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4819	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide).</li> <li>• <i>As-is Measurement:</i> 35.5"</li> <li>• <i>Proposed Solution:</i> Modify facility passage to be min. 44" wide. Demolish existing partition and replace.</li> </ul>	PCODE WC02A ADAAG 4.3.3 CSAS 1115B.7.1.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	6	LF	\$170	<b>\$1,020</b>
4820	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE WE01 CSAS 1503.2.1 C.P.C. Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,000	<b>\$4,000</b>
4821	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>As-is Measurement:</i> 47"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</li> </ul>	PCODE WE03 ADAAG 4.18.4 CSAS 1503.2 C.P.C. Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
<b>8 Women's restrooms</b>						
4822	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE SA15 CSAS 1115B.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4823	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</li> <li>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</li> </ul>	PCODE SA11A ADAAG 4.1.3(16)(a) CSAS 1117B.5.9 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4824	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Existing threshold at door is less than 3/4" but without a beveled edge on both sides.</li> <li>• <i>As-is Measurement:</i> 1/2"</li> <li>• <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side.</li> </ul>	PCODE <b>ID02</b> ADAAG <b>4.1.6(3)(d)(ii)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4825	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,500	<b>\$1,500</b>
4826	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 18" from near side wall to center line of water closet (proposed new ADAAG: 16"-18").</li> <li>• <i>As-is Measurement:</i> 16.5"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing.</li> </ul>	PCODE <b>WB02</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,600	<b>\$4,600</b>
4827	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> The location of the stall door is not in front of the clear space (next to the water closet), with a maximum stile width of 4 ".</li> <li>• <i>Proposed Solution:</i> Remodel compartment.</li> </ul>	PCODE <b>WB05D</b> ADAAG <b>4.17.3 &amp; Fig. 30(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4828	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4829	<p>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4"</p> <p>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</p>	<p>PCODE <b>WG02BNT</b></p> <p>ADAAG <b>Fig. 28</b></p> <p>CSAS <b>DSA/AC # 99-07</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$150	<b>\$150</b>
4830	<p>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</p>	<p>PCODE <b>WB10</b></p> <p>ADAAG <b>4.16.5 &amp; 4.27.4</b></p> <p>CSAS <b>1502.0</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>
4831	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 45"</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE <b>WG01A</b></p> <p>ADAAG <b>28 CFR 35.133(a)</b></p> <p>CSAS <b>1115B.9.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4832	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE <b>WD05</b></p> <p>ADAAG <b>4.19.4</b></p> <p>CSAS <b>1504.2.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	3	JOB	\$120	<b>\$360</b>
4833	<p>• <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).</p> <p>• <i>As-is Measurement:</i> 33"</p> <p>• <i>Proposed Solution:</i> Relocate existing lavatory.</p>	<p>PCODE <b>WD01A</b></p> <p>ADAAG <b>4.19.3</b></p> <p>CSAS <b>1504.2.1 C.P.C.</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$900	<b>\$900</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4834	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).</li> <li>• <i>As-is Measurement:</i> 52.5" from rear wall</li> <li>• <i>Proposed Solution:</i> Provide or relocate accessible side grab bar.</li> </ul>	PCODE <b>WB07A</b> ADAAG <b>4.17.6</b> CSAS <b>1115B.8.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$300	<b>\$300</b>
4835	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall.</li> <li>• <i>As-is Measurement:</i> 38" from side wall</li> <li>• <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar.</li> </ul>	PCODE <b>WB07BNT</b> ADAAG <b>4.17.6</b> CSAS <b>1115B.8.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$300	<b>\$300</b>
<b>Total Costs for Area/Floor: Level 1</b>					<b>\$36,910.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Ohlone Cluster				<b>\$36,910.00</b>	



Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>1 Information/Tickets counter</b>						
4836	<p>• <i>As-Built Description:</i> Ticket Booth: Auditorium, theater, stadium, or gymnasium counter is not accessible (with min. 36" counter length and max. 36" high), or auxiliary counter in close proximity not provided.</p> <p>• <i>As-is Measurement:</i> 42"</p> <p>• <i>Proposed Solution:</i> Make ticket booth accessible or provide auxiliary counter in close proximity. Equivalent facilitation (foldable writing shelf) possible.</p>	<p>PCODE <b>GD01</b></p> <p>ADAAG <b>7.2.(2)</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$3,000	<b>\$3,000</b>
4837	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE <b>SA07A</b></p> <p>ADAAG <b>4.30.6</b></p> <p>CSAS <b>1117B.5.2</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4838	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE <b>ID03</b></p> <p>ADAAG <b>4.13.10 &amp; 11</b></p> <p>CSAS <b>1133B.2.5</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
<b>2 Women's restroom</b>						
4839	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE <b>SA15</b></p> <p>CSAS <b>1115B.5</b></p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4840	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4841	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$250	<b>\$250</b>
4842	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 14 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	<b>\$50</b>
4843	<p>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</p> <p>• <i>As-is Measurement:</i> 47" deep</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</p>	<p>PCODE ID27B</p> <p>ADAAG Fig. 25(c)</p> <p>CSAS 11B-26A(c)</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$2,600	<b>\$2,600</b>
4844	<p>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</p> <p>• <i>As-is Measurement:</i> 47" deep</p> <p>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</p>	<p>PCODE WC03BREF</p> <p>CSAS Fig.No.31-1B</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>		REF		

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4845	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 12"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4846	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 37"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4847	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4848	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4849	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet.</li> <li>• <i>As-is Measurement:</i> 19"</li> <li>• <i>Proposed Solution:</i> Fur out sidewall with 60" x 60" panel to provide 18" dimension. Install grab bar and recess toilet paper dispenser.</li> </ul>	PCODE <b>WB02B</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,000	<b>\$1,000</b>
4850	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4851	<p>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</p> <p>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</p>	<p>PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$100	<b>\$100</b>
4852	<p>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</p> <p>• <i>As-is Measurement:</i> 15"</p> <p>• <i>Proposed Solution:</i> Provide new accessible water closet.</p>	<p>PCODE <b>WB08</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$1,400	<b>\$1,400</b>
4853	<p>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 5"</p> <p>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</p>	<p>PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$150	<b>\$150</b>
4854	<p>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</p> <p>• <i>As-is Measurement:</i> 4.5"</p> <p>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</p>	<p>PCODE <b>WG02BNT</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$150	<b>\$150</b>
4855	<p>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</p> <p>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</p>	<p>PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$120	<b>\$120</b>
4856	<p>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</p> <p>• <i>As-is Measurement:</i> P.T.D: 50" S.D: 45"</p> <p>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</p>	<p>PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	2	JOB	\$100	<b>\$200</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4857	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 35"</li> <li>• <i>Proposed Solution:</i> Remount compliant fixture at accessible height.</li> </ul>	PCODE <b>WD02A</b> ADAAG <b>4.19.2</b> CSAS <b>1504.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$900	<b>\$900</b>
<b>3 Men's restroom</b>						
4858	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE <b>SA15</b> CSAS <b>1115B.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4859	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</li> <li>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</li> </ul>	PCODE <b>SA11A</b> ADAAG <b>4.1.3(16)(a)</b> CSAS <b>1117B.5.9</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4860	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE <b>ID07</b> ADAAG <b>4.13.9</b> CSAS <b>1133B.2.5.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$250	<b>\$250</b>
4861	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 14 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4862	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60").</li> <li>• <i>As-is Measurement:</i> 47" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed.</li> </ul>	PCODE <b>ID27B</b> ADAAG <b>Fig. 25(c)</b> CSAS <b>11B-26A(c)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,600	<b>\$2,600</b>
4863	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Restroom entry / exit door: 60" square clear space not provided at door swing side.</li> <li>• <i>As-is Measurement:</i> 47" deep</li> <li>• <i>Proposed Solution:</i> Provide relocated new door and frame. Remodel walls as needed.</li> </ul>	PCODE <b>WC03BREF</b> CSAS <b>Fig.No.31-1B</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4864	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Less than 32" from side of water closet to far side of stall wall or 28" to adjacent fixture.</li> <li>• <i>As-is Measurement:</i> 12"</li> <li>• <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet.</li> </ul>	PCODE <b>WB01A</b> CSAS <b>1115B.7.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4865	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet stall less than 60" wide.</li> <li>• <i>As-is Measurement:</i> 37"</li> <li>• <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).</li> </ul>	PCODE <b>WB06REF</b> ADAAG <b>4.17.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4866	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03REF</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4867	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door).</li> <li>• <i>As-is Measurement:</i> 30"</li> <li>• <i>Proposed Solution:</i> Provide new partition and stall door with compliant width.</li> </ul>	PCODE <b>WB05REF</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4868	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet.</li> <li>• <i>As-is Measurement:</i> 19"</li> <li>• <i>Proposed Solution:</i> Fur out sidewall with 60" x 60" panel to provide 18" dimension. Install grab bar and recess toilet paper dispenser.</li> </ul>	PCODE <b>WB02B</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.1.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,000	<b>\$1,000</b>
4869	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bars not provided or are not code compliant.</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07</b> ADAAG <b>4.17.6*</b> CSAS <b>1115B.8</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4870	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4871	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</li> <li>• <i>As-is Measurement:</i> 15"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet.</li> </ul>	PCODE <b>WB08</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,400	<b>\$1,400</b>
4872	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4874	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$120	<b>\$120</b>
4877	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> S.D: 45"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4878	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</li> <li>• <i>As-is Measurement:</i> 11"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE01</b> CSAS <b>1503.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$4,000	<b>\$4,000</b>
4879	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor.</li> <li>• <i>As-is Measurement:</i> 24"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</li> </ul>	PCODE <b>WE02REF</b> ADAAG <b>4.18.2</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4880	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>As-is Measurement:</i> 53"</li> <li>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</li> </ul>	PCODE <b>WE03</b> ADAAG <b>4.18.4</b> CSAS <b>1503.2 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>



Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>4</b>	<b>Women's locker room</b>					
4881	<p>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</p> <p>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</p>	<p>PCODE SA15</p> <p>CSAS 1115B.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$100	<b>\$200</b>
4882	<p>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</p> <p>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</p>	<p>PCODE SA11A</p> <p>ADAAG 4.1.3(16)(a)</p> <p>CSAS 1117B.5.9</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$90	<b>\$180</b>
4883	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$75	<b>\$150</b>
4884	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	3	JOB	\$50	<b>\$150</b>
4885	<p>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</p> <p>• <i>As-is Measurement:</i> 66"</p> <p>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</p>	<p>PCODE IC03</p> <p>ADAAG 4.2.5</p> <p>CSAS 760-10</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$450	<b>\$450</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4886	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 39"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03B</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4887	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.</li> <li>• <i>As-is Measurement:</i> 27" wide</li> <li>• <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.</li> </ul>	PCODE <b>IA04NT</b> CSAS <b>1117B.1.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4888	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,500	<b>\$1,500</b>
4889	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> The location of the stall door is not in front of the clear space (next to the water closet), with a maximum stile width of 4".</li> <li>• <i>Proposed Solution:</i> Remodel compartment.</li> </ul>	PCODE <b>WB05D</b> ADAAG <b>4.17.3 &amp; Fig. 30(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4890	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4891	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4892	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).</li> <li>• <i>As-is Measurement:</i> 51" from rear wall</li> <li>• <i>Proposed Solution:</i> Provide or relocate accessible side grab bar.</li> </ul>	PCODE <b>WB07A</b> ADAAG <b>4.17.6</b> CSAS <b>1115B.8.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$300	<b>\$300</b>
4893	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall.</li> <li>• <i>As-is Measurement:</i> 40" from side wall</li> <li>• <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar.</li> </ul>	PCODE <b>WB07BNT</b> ADAAG <b>4.17.6</b> CSAS <b>1115B.8.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$300	<b>\$300</b>
4894	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bar clearance not 1-1/2" from wall.</li> <li>• <i>As-is Measurement:</i> 2.75"</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07EREF</b> ADAAG <b>4.26.2</b> CSAS <b>1115B.8.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4895	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
4896	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Feminine napkin disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>Proposed Solution:</i> Provide recessed feminine napkin disposal container.</li> </ul>	PCODE <b>WG02BNT</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4897	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$120	<b>\$480</b>
4898	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Remount compliant fixture at accessible height.</li> </ul>	PCODE <b>WD02A</b> ADAAG <b>4.19.2</b> CSAS <b>1504.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$900	<b>\$900</b>
4899	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</li> <li>• <i>As-is Measurement:</i> 15"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet.</li> </ul>	PCODE <b>WB08</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,400	<b>\$1,400</b>
4900	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 40" from floor to highest operating slot or control.</li> <li>• <i>As-is Measurement:</i> F.T.D: 46"</li> <li>• <i>Proposed Solution:</i> Relocate existing restroom accessories.</li> </ul>	PCODE <b>WG01A</b> ADAAG <b>28 CFR 35.133(a)</b> CSAS <b>1115B.9.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4901	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Where extreme vandalism is a consideration, two fixed shower heads that can be operated independently and one mounted at 48" [+/- 1"] are not provided.</li> <li>• <i>Proposed Solution:</i> Provide additional shower head at accessible height.</li> </ul>	PCODE <b>WF05ANT</b> CSAS <b>1115B.6.2.4.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4902	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> In 36" x 36" shower stall, L-shaped grab bar to be located along the full depth of the control wall (opposite the seat) and halfway along the back wall (18") is not provided.</li> <li>• <i>Proposed Solution:</i> Provide new grab bar in shower.</li> </ul>	PCODE <b>WF08ANT</b> ADAAG <b>Fig. 37(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4903	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> In 36" x 36" stall no seat at 17" to 19" height above floor opposite controls provided (CA only: folding seat at 18").</li> <li>• <i>Proposed Solution:</i> Provide new, or relocate, folding wall-mounted shower seat.</li> </ul>	PCODE <b>WF07NT</b> ADAAG <b>4.21.3</b> CSAS <b>1115B.6.2.4.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$550	<b>\$550</b>
4904	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Individuals using wheelchairs, crutches, or walkers cannot reach paper towel and/or soap dispensers from designated accessible sink(s) or lavatory(s).</li> <li>• <i>As-is Measurement:</i> wall mounted hair dryer : 61"</li> <li>• <i>Proposed Solution:</i> Relocate paper towel wall mounted hair dryer to be within immediate reach range of a person standing or sitting at an accessible sink or lavatory.</li> </ul>	PCODE <b>WG01BNT</b> ADAAG <b>Fig. A3(a)</b> CSAS <b>Gov. Code, Sec. 4450</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4905	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</li> <li>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</li> </ul>	PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
5009	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No accessible bench section provided at accessible lockers.</li> <li>• <i>Proposed Solution:</i> Provide new accessible bench.</li> </ul>	PCODE <b>GG01NT</b> - CSAS <b>3103(a)2D(5)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
<b>5 Women's staff room (#122)</b>						
4906	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE <b>SA07A</b> ADAAG <b>4.30.6</b> CSAS <b>1117B.5.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4907	<p>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</p> <p>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</p>	<p>PCODE ID06A</p> <p>CSAS 1133B.2.6</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$75	\$75
4908	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>As-is Measurement:</i> 9 lbs</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	\$50
<b>6 Equipment issue (#151)</b>						
4909	<p>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</p> <p>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</p>	<p>PCODE SA07A</p> <p>ADAAG 4.30.6</p> <p>CSAS 1117B.5.2</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$90	\$90
4910	<p>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</p> <p>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</p>	<p>PCODE ID03</p> <p>ADAAG 4.13.10 &amp; 11</p> <p>CSAS 1133B.2.5</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	1	JOB	\$50	\$50
4911	<p>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</p> <p>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</p>	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>CSAS 1133B.2.5.1</p> <p>Year Mitigated <b>TBD</b></p> <p>DSA App. # <b>TBD</b></p> <p>Funding <b>TBD</b></p>	2	JOB	\$250	\$500

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4912	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide).</li> <li>• <i>As-is Measurement:</i> 42"</li> <li>• <i>Proposed Solution:</i> Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table.</li> </ul>	PCODE IN03A ADAAG 4.32.3 & 4 CSAS 1122B.3 & 4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,200	<b>\$1,200</b>
<b>7 Equipment store (#150)</b>						
4913	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4914	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4915	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
4916	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide).</li> <li>• <i>As-is Measurement:</i> 42"</li> <li>• <i>Proposed Solution:</i> Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table.</li> </ul>	PCODE IN03A ADAAG 4.32.3 & 4 CSAS 1122B.3 & 4 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,200	<b>\$1,200</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>8</b>	<b>Room #149</b>					
4917	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille.</li> <li>• <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille.</li> </ul>	PCODE SA07A ADAAG 4.30.6 CSAS 1117B.5.2 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$90	<b>\$90</b>
4918	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door does not have accessible operating hardware.</li> <li>• <i>Proposed Solution:</i> Provide lever handle or other accessible hardware.</li> </ul>	PCODE ID07 ADAAG 4.13.9 CSAS 1133B.2.5.1 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$250	<b>\$500</b>
4919	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink rim higher than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet to lower sink.</li> </ul>	PCODE IN06REF ADAAG 4.24.2 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4920	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink does not have knee space min. 27" high x 19" deep x 30" wide.</li> <li>• <i>As-is Measurement:</i> no knee clearance</li> <li>• <i>Proposed Solution:</i> Remodel sink cabinet.</li> </ul>	PCODE IN06A ADAAG 4.24.3 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,850	<b>\$1,850</b>
4921	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Kitchenette sink is more than 6 1/2" deep.</li> <li>• <i>As-is Measurement:</i> 8"</li> <li>• <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed.</li> </ul>	PCODE IN06BREF ADAAG 4.24.4 CSAS 1117B.3 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4922	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 10 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE ID03 ADAAG 4.13.10 & 11 CSAS 1133B.2.5 Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>



Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4923	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 3/4" high, up to 6" high.</li> <li>• <i>As-is Measurement:</i> 1.5"</li> <li>• <i>Proposed Solution:</i> Remove existing paving at door and provide landing with edge ramping (slope 1:20 max) as needed.</li> </ul>	PCODE <b>ID02A</b> ADAAG <b>4.13.8</b> CSAS <b>1133B.2.4.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	60	SF	\$12	<b>\$720</b>
<b>9 Men's locker room</b>						
4924	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Required in CA only: identification symbol centered 60" high on sanitary facility door not provided (women: 12" ø circle, men: 12" triangle, unisex: combined symbol).</li> <li>• <i>Proposed Solution:</i> Provide properly mounted sanitary facility symbol when altering area. If wheelchair accessible, include International Symbol of Accessibility on sign.</li> </ul>	PCODE <b>SA15</b> CSAS <b>1115B.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$100	<b>\$200</b>
4925	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Entrance to toilet or bathing facility identified with California signage on door leaf not identified with ADAAG compliant signage.</li> <li>• <i>Proposed Solution:</i> Provide ADAAG compliant sign, mounted 5' AFF o.c., on nearest adjacent wall, including raised letters and pictogram, and California Grade 2 Braille.</li> </ul>	PCODE <b>SA11A</b> ADAAG <b>4.1.3(16)(a)</b> CSAS <b>1117B.5.9</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$90	<b>\$180</b>
4926	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	2	JOB	\$75	<b>\$150</b>
4927	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	3	JOB	\$50	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4928	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location is to be remodeled.</li> <li>• <i>As-is Measurement:</i> 66"</li> <li>• <i>Proposed Solution:</i> Fire alarm station to be 48" from floor to center.</li> </ul>	PCODE <b>IC03</b> ADAAG <b>4.2.5</b> CSAS <b>760-10</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$450	<b>\$450</b>
4929	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor; unit in poor condition.</li> <li>• <i>As-is Measurement:</i> 39"</li> <li>• <i>Proposed Solution:</i> Provide new, accessible fountain.</li> </ul>	PCODE <b>IA03B</b> ADAAG <b>4.15.2</b> CSAS <b>1507.3.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4930	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) unless provision would be unreasonable hardship.</li> <li>• <i>As-is Measurement:</i> 27" wide</li> <li>• <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide textured floor surface or wing walls.</li> </ul>	PCODE <b>IA04NT</b> CSAS <b>1117B.1.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$2,000	<b>\$2,000</b>
4931	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Less than 59" from back wall to front wall or door swing of toilet stall, or less than 56" if water closet is wall-hung (CA only: Less than 48" from front of water closet to door in front entry stall).</li> <li>• <i>As-is Measurement:</i> 31"</li> <li>• <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture.</li> </ul>	PCODE <b>WB03</b> ADAAG <b>4.17.3</b> CSAS <b>1115B.7.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,500	<b>\$1,500</b>
4932	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> The location of the stall door is not in front of the clear space (next to the water closet), with a maximum stile width of 4".</li> <li>• <i>Proposed Solution:</i> Remodel compartment.</li> </ul>	PCODE <b>WB05D</b> ADAAG <b>4.17.3 &amp; Fig. 30(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4933	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock).</li> <li>• <i>Proposed Solution:</i> Provide new accesible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides.</li> </ul>	PCODE <b>WB05C</b> ADAAG <b>4.17.5</b> CSAS <b>1115B.7.1.4</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$100	<b>\$100</b>
4934	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall, mounted more than 44" above floor and/or requires more than 5 lbs. force to operate.</li> <li>• <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type.</li> </ul>	PCODE <b>WB10</b> ADAAG <b>4.16.5 &amp; 4.27.4</b> CSAS <b>1502.0</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4935	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Side grab bar less than 42" long, or starting less than 54" from rear wall (CA only: front end min 24" in front of water closet).</li> <li>• <i>As-is Measurement:</i> 51" from rear wall</li> <li>• <i>Proposed Solution:</i> Provide or relocate accessible side grab bar.</li> </ul>	PCODE <b>WB07A</b> ADAAG <b>4.17.6</b> CSAS <b>1115B.8.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$300	<b>\$300</b>
4936	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Rear grab bar less than 36" long, or starting less than 42" from side wall.</li> <li>• <i>As-is Measurement:</i> 40" from side wall</li> <li>• <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar.</li> </ul>	PCODE <b>WB07BNT</b> ADAAG <b>4.17.6</b> CSAS <b>1115B.8.1</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$300	<b>\$300</b>
4937	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Grab bar clearance not 1-1/2" from wall.</li> <li>• <i>As-is Measurement:</i> 2.75"</li> <li>• <i>Proposed Solution:</i> Provide accessible grab bars.</li> </ul>	PCODE <b>WB07EREF</b> ADAAG <b>4.26.2</b> CSAS <b>1115B.8.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>		REF		
4938	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Toilet paper dispenser or disposal container protrudes more than 3" out from side wall, into clear 30x48 space in front of water closet.</li> <li>• <i>As-is Measurement:</i> 5"</li> <li>• <i>Proposed Solution:</i> Provide recessed toilet paper dispenser or disposal container.</li> </ul>	PCODE <b>WG02B</b> ADAAG <b>Fig. 28</b> CSAS <b>DSA/AC # 99-07</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4940	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Hot or sharp-surfaced water/drain pipe not insulated or covered.</li> <li>• <i>Proposed Solution:</i> Insulate or cover water/drain pipe.</li> </ul>	PCODE <b>WD05</b> ADAAG <b>4.19.4</b> CSAS <b>1504.2.2</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	4	JOB	\$120	<b>\$480</b>
4941	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor.</li> <li>• <i>As-is Measurement:</i> 36"</li> <li>• <i>Proposed Solution:</i> Remount compliant fixture at accessible height.</li> </ul>	PCODE <b>WD02A</b> ADAAG <b>4.19.2</b> CSAS <b>1504.2.1 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$900	<b>\$900</b>
4942	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor.</li> <li>• <i>As-is Measurement:</i> 15"</li> <li>• <i>Proposed Solution:</i> Provide new accessible water closet.</li> </ul>	PCODE <b>WB08</b> ADAAG <b>4.16.3</b> CSAS <b>1502 C.P.C.</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$1,400	<b>\$1,400</b>
4944	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> CA only: Where extreme vandalism is a consideration, two fixed shower heads that can be operated independently and one mounted at 48" [+/- 1"] are not provided.</li> <li>• <i>Proposed Solution:</i> Provide additional shower head at accessible height.</li> </ul>	PCODE <b>WF05ANT</b> CSAS <b>1115B.6.2.4.3</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4945	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> In 36" x 36" shower stall, L-shaped grab bar to be located along the full depth of the control wall (opposite the seat) and halfway along the back wall (18") is not provided.</li> <li>• <i>Proposed Solution:</i> Provide new grab bar in shower.</li> </ul>	PCODE <b>WF08ANT</b> ADAAG <b>Fig. 37(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
4946	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> In 36" x 36" stall no seat at 17" to 19" height above floor opposite controls provided (CA only: folding seat at 18").</li> <li>• <i>Proposed Solution:</i> Provide new, or relocate, folding wall-mounted shower seat.</li> </ul>	PCODE <b>WF07</b> ADAAG <b>4.21.3</b> CSAS <b>1115B.6.2.4.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$550	<b>\$550</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4947	<p>• <i>As-Built Description:</i> Individuals using wheelchairs, crutches, or walkers cannot reach paper towel and/or soap dispensers from designated accessible sink(s) or lavatory(s).</p> <p>• <i>As-is Measurement:</i> wall mounted hair dryer:61"</p> <p>• <i>Proposed Solution:</i> Relocate wall mounted hair dryer to be within immediate reach range of a person standing or sitting at an accessible sink or lavatory.</p>	<p>PCODE <b>WG01B</b> ADAAG <b>Fig. A3(a)</b> CSAS <b>Gov. Code, Sec. 4450</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$75	<b>\$75</b>
4948	<p>• <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.</p> <p>• <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door.</p>	<p>PCODE <b>SA10A</b> ADAAG <b>4.1.3 (16)</b> CSAS <b>1117B.5.2 &amp; 6</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$90	<b>\$90</b>
4949	<p>• <i>As-Built Description:</i> CA only: Front of rim projects less than 14" from wall.</p> <p>• <i>As-is Measurement:</i> 11"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE <b>WE01</b> CSAS <b>1503.2.1 C.P.C.</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$4,000	<b>\$4,000</b>
4950	<p>• <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor.</p> <p>• <i>As-is Measurement:</i> 24"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed.</p>	<p>PCODE <b>WE02REF</b> ADAAG <b>4.18.2</b> CSAS <b>1503.2 C.P.C.</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>		REF		
4951	<p>• <i>As-Built Description:</i> Urinal flush control lever more than 44" above floor and/or requires more than 5 lbs. force to operate.</p> <p>• <i>As-is Measurement:</i> 51"</p> <p>• <i>Proposed Solution:</i> Provide accessible urinal flush control.</p>	<p>PCODE <b>WE03</b> ADAAG <b>4.18.4</b> CSAS <b>1503.2 C.P.C.</b></p> <p>Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b></p>	1	JOB	\$500	<b>\$500</b>

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4952	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60" (CA only: exterior door width plus 24").</li> <li>• <i>As-is Measurement:</i> 3"</li> <li>• <i>Proposed Solution:</i> Change latch/hinge side.</li> </ul>	PCODE <b>ID23NT</b> ADAAG <b>Fig. 25(a)</b> CSAS <b>11B-26A(a)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$500	<b>\$500</b>
5010	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> No accessible bench section provided at accessible lockers.</li> <li>• <i>Proposed Solution:</i> Provide new accessible bench.</li> </ul>	PCODE <b>GG01NT</b> - CSAS <b>3103(a)2D(5)</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$150	<b>\$150</b>
<b>10 Room #144</b>						
4953	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> At push side of framed glass or panel door on accessible route, bottom 10" does not have a smooth, uninterrupted surface (required in CA only).</li> <li>• <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge.</li> </ul>	PCODE <b>ID06A</b> CSAS <b>1133B.2.6</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$75	<b>\$75</b>
4954	<ul style="list-style-type: none"> <li>• <i>As-Built Description:</i> Excessive force required to open door (5 lbs. for interior doors; 8.5 lbs. for exterior doors) and/or door closing time of less than 3 seconds.</li> <li>• <i>As-is Measurement:</i> 9 lbs</li> <li>• <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs. for interior doors; 8.5 lbs. for exterior doors).</li> </ul>	PCODE <b>ID03</b> ADAAG <b>4.13.10 &amp; 11</b> CSAS <b>1133B.2.5</b> Year Mitigated <b>TBD</b> DSA App. # <b>TBD</b> Funding <b>TBD</b>	1	JOB	\$50	<b>\$50</b>
<b>Total Costs for</b>					<b>Area/Floor: Level 1</b>	<b>\$64,440.00</b>

---

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Total Costs for</b>	<b>Building/Part:</b> Ohlone Cluster				<b>\$64,440.00</b>	

---

Campus: **Indian Valley Campus** Building/Part: **Ohlone Cluster** Area/Floor: **Level 1**

---

Item No	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<b>Grand Total for</b>	<b>Campus: Indian Valley Campus</b>				<b>\$1,278,017.00</b>	